

State of Colorado
Energy & Carbon Management Commission



1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Document Number:
403545041

Date Received:
09/28/2023

FIR RESOLUTION FORM

Overall Status: CAC

CA Summary:

3 of 3 CAs from the FIR responded to on this Form

3 CA Completed
0 Factual Review Request

OPERATOR INFORMATION

OGCC Operator Number: 46290
Name of Operator: KP KAUFFMAN COMPANY INC
Address: 1700 LINCOLN ST STE 4550
City: DENVER State: CO Zip: 80203

Contact Name and Telephone:
Name: _____
Phone: () _____ Fax: () _____
Email: _____

Additional Operator Contact:

Contact Name	Phone	Email
<u>Canfield, Chris</u>	<u>303-825-4822</u>	<u>chris.canfield@state.co.us</u>
<u>.</u>	<u>cogcc@kpk.com</u>	

COGCC INSPECTION SUMMARY:

FIR Document Number: 707901110
Inspection Date: 09/27/2023 FIR Submit Date: 09/27/2023 FIR Status: _____

Inspected Operator Information:

Company Name: KP KAUFFMAN COMPANY INC Company Number: 46290
Address: 1700 LINCOLN ST STE 4550
City: DENVER State: CO Zip: 80203

LOCATION - Location ID: 320508

Location Name: MORRISON-61S68W Number: 1SWSE County: ADAMS
Qtrqtr: SWSE Sec: 1 Twp: 1S Range: 68W Meridian: 6
Latitude: 39.988714 Longitude: -104.947481

FACILITY - API Number: 05-001- -00 Facility ID: 272091

Facility Name: MORRISON Number: 15-1
Qtrqtr: SWSE Sec: 1 Twp: 1S Range: 68W Meridian: 6
Latitude: 39.988714 Longitude: -104.947481

CORRECTIVE ACTIONS:

1 CA# 182301

Corrective Action: Report spill or release of E&P waste or produced fluids Remove free fluids and contact COGCC EPS staff per Rule 912.b. Date: 09/28/2023

Response: CA COMPLETED Date of Completion: 09/28/2023

Operator Comment: The attached spreadsheet shows the results of monthly braden head tests performed at Morrison 15-1 since January 2022. No pressure has been noted on the braden head. Following receipt of the ECMC inspection, KPK crews removed stained soil (8 feet by 4 feet by 3 inches). Photographs post soil scraping/removal are attached. Four locations surrounding the valve were field screened using a photoionization detector (PID) after soil

removal, and all soil samples reported readings below 10 parts per million (ppm) indicating volatile organic compounds are not present. Less than 10 cubic yards of impacted soil were removed. Therefore, this release is not reportable per ECMC Rule 912.b.

COGCC Decision: Approved pending re-inspection

COGCC
Representative:

2 CA# 182302

Corrective Action: Securely fasten all valves, pipes, fittings, and Production Facilities to ensure good mechanical condition, inspect at regular intervals and maintain in good mechanical condition per Rule 608.e.

Date: 09/28/2023

Response: CA COMPLETED

Date of Completion: 09/28/2023

Operator Comment: The site is inspected on a monthly basis during the braden head tests. Following receipt of the ECMC inspection, KPK crews tightened all the fittings. Photographs post maintenance and soil scraping/removal are attached.

COGCC Decision: Approved pending re-inspection

COGCC
Representative:

3 CA# 182303

Corrective Action: Comply with rule 606

Date: 10/04/2023

Response: CA COMPLETED

Date of Completion: 09/28/2023

Operator Comment: Following receipt of the ECMC inspection, KPK crews sprayed for weeds.

COGCC Decision: Approved pending re-inspection

COGCC
Representative:

OPERATOR COMMENT AND SUBMITTAL

Comment:

I hereby certify that the statements made in this form are, to the best of my knowledge, true, correct, and complete.

Print Name: Katherine Kahn

Signed: _____

Title: Senior Hydrogeologist

Date: 9/28/2023 4:44:33 PM

ATTACHMENT LIST

View Attachments in Imaged Documents on COGCC website (<http://ogccweblink.state.co.us/>) - Search by Document Number.

<u>Document Number</u>	<u>Description</u>
403545041	FIR RESOLUTION SUBMITTED
403545050	Site Photographs
403545051	Morrison 15-1 Monthly Braden Head Test Results

Total Attach: 3 Files