

**FORM
INSP**Rev
X/20**State of Colorado
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

10/05/2023

Submitted Date:

10/09/2023

Document Number:

713600284**FIELD INSPECTION FORM**Loc ID 324848 Inspector Name: COSTA, RYAN On-Site Inspection ☐ 2A Doc Num: **Operator Information:**OGCC Operator Number: 16520Name of Operator: CHEMCO INCAddress: 6970 SOUTH HOLLY CIR STE 206City: CENTENNIAL State: CO Zip: 80112**Status Summary:**

- ☒ THIS IS A FOLLOW UP INSPECTION
- ☒ FOLLOW UP INSPECTION REQUIRED
- ☐ NO FOLLOW UP INSPECTION REQUIRED

Findings:5 Number of Comments3 Number of Corrective Actions☒ Corrective Action Response Requested**ANY CORRECTIVE ACTION(S) FROM
PREVIOUS INSPECTIONS THAT HAVE NOT
BEEN ADDRESSED ARE STILL APPLICABLE****Contact Information:**

Contact Name	Phone	Email	Comment
Neher, Morgan	303-771-7777	morgan@chemco-og.com	
Neher, Gray		gh.neher@chemco-og.com	
Sanchez, Chris		chris.sanchez@state.co.us	

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
213127	WELL	SI	12/01/2021	OW	061-06488	BAUGHMAN 8	RI

General Comment:

On 10/5/2023, Ryan Costa conducted a follow up of the previous inspection #713600092.
 The corrective actions of the previous reclamation inspection have not been performed.
 Operator is directed to perform corrective actions outlined on this inspection report immediately.
 See attached photos and additional details within this report.

LocationOverall Good: ☐

Emergency Contact Number:

Comment:

Corrective Action:

Date: _____

Overall Good: ☐**Spills:**

Type	Area	Volume		
Crude Oil	Tank			
Comment:	There are oil stained soils where pipe containment had spilled over. There are also oil stained soils along the east side of the berm that need to be cleaned up.			
Corrective Action:	Immediately clean up per Rule 912.a.			Date: 10/05/2023

In Containment: No

Comment:

☐ Multiple Spills and Releases?**Fencing/:**

Type			
PUMP JACK			
Comment:	The fence around the pumpjack is not adequate to prevent livestock entry and is only 2ft. tall near the well sign. There are wires sticking out which could injury livestock. Corrective action will remain out of compliance until completed.		
Corrective Action:	Comply with the fencing requirements per the 1002a rules		
		Date:	08/09/2023

Tanks and Berms:

Contents	#	Capacity	Type	Tank ID	SE GPS	
PRODUCED WATER	1	1000 BBLS	STEEL AST		,	
Comment:						
Corrective Action:						Date:

Paint

Condition		
Other (Content)		
Other (Capacity)		
Other (Type)		

Berms

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
Earth	Inadequate	Walls Insufficient	Base Insufficient	Inadequate
Comment:	The berm around the tank battery is not adequate to contain a spill of the tank. Berms around the tank need to be adequately sized with compacted non-permeable material. Previous corrective action was not completed. Corrective action will remain out of compliance until completed.			
Corrective Action:	Repair or install berms or other secondary containment devices per Rule 603.o.			Date: 08/09/2023

Venting:

Yes/No		
Comment:		

Corrective Action:		Date:	
Flaring:			
Type			
Comment:			
Corrective Action:		Date:	

Reclamation - Storm Water - Pit**Storm Water:**

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment

Comment: [The cattleguard has been cleaned up since previous inspection. The chemical tote at the pumpjack was removed.](#)

Corrective Action:

Date: _____

Pits: ☒ NO SURFACE INDICATION OF PIT

Attached Documents

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
403554351	INSPECTION SUBMITTED	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=6278064
713600285	Inspection Photos	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=6278037