

# Inspection Photos

API: 061-06365

Operator: STRACHAN EXPLORATION INC

Inspection Date: 11/29/2023



## Inspection Photos



**Photo 1.** 8/24/23 Drone aerial photo facing east toward the location.





## Inspection Photos



**Photo 2.** 8/24/23 Drone aerial photo facing west at the north side of the location





## Inspection Photos



**Photo 3.** Facing southeast at the location. The two large volume tanks do not have proper labeling or secondary containment. If the tanks are unused then they need to be removed. Previous corrective action was not completed.



## Inspection Photos



**Photo 4.** Facing at the north side of the location. The fence around the tank battery is inadequate to prevent livestock entry and is not maintained. Berm is insufficient to contain a spill (150% of tank capacity). Previous corrective action was not completed.



**COLORADO**  
Energy & Carbon Management  
Commission  
Department of Natural Resources

API: 061-06365 | Date: 11/29/2023



## Inspection Photos



**Photo 5.** Facing northwest at the location.



## Inspection Photos



**Photo 6.** The northwest at the wellsite and production equipment. The fence around the equipment is inadequate to prevent livestock entry. Cattle track have previously been observed inside the 2 strand fence.





## Inspection Photos



**Photo 7.** Facing toward the pumpjack. The well sign posted does not meet the signage requirements of the rules.





## Inspection Photos



**Photo 8.** Facing toward the tanks at southeast side of the location. There is wet soils where the truck load out occurred and signs that the hose leak out water while disconnecting.



## Inspection Photos



**Photo 9.** Facing northwest toward the tank battery. There was a recent spill that had occurred at the tank shown at red arrow. Soils have been pushed and secondary containment is not adequate. Loose soils are susceptible to erosion and all contaminated soils need to be cleaned up and removed.





## Inspection Photos



**Photo 10.** The berm pushed up is inadequate for secondary containment due to loose soils and inadequate size.





## Inspection Photos



**Photo 11.** It appears dirt was pushed over the spill area which was not cleaned up. Shovel uncovered the fresh dirt placed over the oil stained soils show the stained oily soils at red arrow.





## Inspection Photos



**Photo 12.** The loader had pushed up contaminated oil soils into the berm.





## Inspection Photos



**Photo 13.** Facing back at the spill area where fresh dirt was spread over the spilled area of oil stained soils. Red arrows show the stained soils that uncovered the dirt laced over the spill area.

