

Henderson 1

ECMC Inspection 696305448

Corrective Action: Disconnected flowline risers not OOSLAT

Operator Response: Risers have been marked. Risers are still in use.



Henderson 1

ECMC Inspection 696305448

Corrective Action: Disconnected flowline risers not OOSLAT

Operator Response: Risers have been marked. Risers are still in use.

