



<div>FORM 6</div> <div>Rev 11/20</div>	<div>State of Colorado</div> <div>Energy & Carbon Management Commission</div> <div>1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109</div>		<div></div>		<table><tr><td>DE</td><td>ET</td><td>OE</td><td>ES</td></tr></table>				DE	ET	OE	ES																										
	DE	ET	OE	ES																																		
<div>WELL ABANDONMENT REPORT</div> <div>This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.</div>				<div>Document Number: 403689385</div> <div>Date Received:</div>																																		
<div>OGCC Operator Number: 24045</div> <div>Name of Operator: ROBERTSON* DEXTER</div> <div>Address: 320 EAST 8TH AVE</div> <div>City: YUMA State: CO Zip: 80759</div> <div>Contact Name: Kit Robertson</div> <div>Phone: (970) 630-5487</div> <div>Fax:</div> <div>Email: kit@yumarealty.net</div>																																						
<div>For "Intent" 24 hour notice required, Name: St John, William (Cal) Tel: (720) 545-5624</div> <div>COGCC contact: Email: cal.stjohn@state.co.us</div>																																						
<div>Type of Well Abandonment Report: <input checked="" type="checkbox"/> Notice of Intent to Abandon <input type="checkbox"/> Subsequent Report of Abandonment</div>																																						
<div>API Number 05-125-07794-00</div> <div>Well Name: ROBERTSON Well Number: 13-31</div> <div>Location: QtrQtr: NWSW Section: 31 Township: 2N Range: 46W Meridian: 6</div> <div>County: YUMA Federal, Indian or State Lease Number:</div> <div>Field Name: SCHRAMM Field Number: 76825</div>																																						
<div>Only Complete the Following Background Information for Intent to Abandon</div> <div>Latitude: 40.094648 Longitude: -102.564410</div> <div>GPS Data: GPS Quality Value: Type of GPS Quality Value: Date of Measurement:</div> <div>Reason for Abandonment: <input type="checkbox"/> Dry <input checked="" type="checkbox"/> Production Sub-economic <input type="checkbox"/> Mechanical Problems</div> <div><input type="checkbox"/> Other</div> <div>Casing to be pulled: <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No Estimated Depth:</div> <div>Fish in Hole: <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No If yes, explain details below</div> <div>Wellbore has Uncemented Casing leaks: <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No If yes, explain details below</div> <div>Details:</div>																																						
<div>Current and Previously Abandoned Zones</div> <table><tr><th>Formation</th><th>Perf. Top</th><th>Perf. Btm</th><th>Abandoned Date</th><th>Method of Isolation</th><th>Plug Depth</th></tr><tr><td>NIOBRARA</td><td>2630</td><td>2664</td><td></td><td></td><td></td></tr></table> <div>Total: 1 zone(s)</div>						Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth	NIOBRARA	2630	2664																								
Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth																																	
NIOBRARA	2630	2664																																				
<div>Casing History</div> <table><tr><th>Casing Type</th><th>Size of Hole</th><th>Size of Casing</th><th>Grade</th><th>Wt/Ft</th><th>Csg/Liner Top</th><th>Setting Depth</th><th>Sacks Cmt</th><th>Cmt Btm</th><th>Cmt Top</th><th>Status</th></tr><tr><td>SURF</td><td>9+7/8</td><td>7</td><td>J-55</td><td>17</td><td>0</td><td>454</td><td>255</td><td>454</td><td>0</td><td>VISU</td></tr><tr><td>1ST</td><td>6+1/4</td><td>4+1/2</td><td>J-55</td><td>9.5</td><td>0</td><td>2809</td><td>200</td><td>2809</td><td>0</td><td>VISU</td></tr></table>						Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status	SURF	9+7/8	7	J-55	17	0	454	255	454	0	VISU	1ST	6+1/4	4+1/2	J-55	9.5	0	2809	200	2809	0	VISU
Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status																												
SURF	9+7/8	7	J-55	17	0	454	255	454	0	VISU																												
1ST	6+1/4	4+1/2	J-55	9.5	0	2809	200	2809	0	VISU																												

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 2580 with 2 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 25 sks cmt from 1300 ft. to 1200 ft. Plug Type: CASING Plug Tagged: ☐
Set 45 sks cmt from 504 ft. to 0 ft. Plug Type: CASING Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged: ☐

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Number of Days from Setting Surface Plug to Capping or Sealing the Well: _____
Surface Plug Setting Date: _____ Cut and Cap Date: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Kit Robertson

Title: Representative/Contact Date: _____ Email: kit@yumarealty.net

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____ Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____ Expiration Date: _____

COA Type **Description**

0 COA	

Attachment List

Att Doc Num**Name**

403694832	WELLBORE DIAGRAM
403703342	WELLBORE DIAGRAM

Total Attach: 2 Files

General Comments

User Group**Comment****Comment Date**

Permit	Missing current wellbore diagram attachment. Returned to draft.	02/27/2024
--------	---	------------

Total: 1 comment(s)