



<div>FORM</div> <div>6</div> <div>Rev 11/20</div>	<div>State of Colorado</div> <div>Energy &amp; Carbon Management Commission</div> <div>1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109</div>		<div><div></div></div>		<div>DE</div> <div>ET</div> <div>OE</div> <div>ES</div>
	<div>Replug By Other Operator</div> <div>Document Number: 403706082</div> <div>Date Received: 03/14/2024</div>				

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

ECMC Operator Number: 10459		Contact Name: Derek Clark	
Name of Operator: EXTRACTION OIL & GAS INC		Phone: (720) 270-4921	
Address: 555 17TH STREET SUITE 3700		Fax:	
City: DENVER	State: CO	Zip: 80202	Email: declark@civiresources.com
For "Intent" 24 hour notice required,		Name: Petrie, Erica	Tel: (303) 726-3822
ECMC contact:		Email: erica.petrie@state.co.us	

Type of Well Abandonment Report: ☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

API Number 05-123-14961-00		Well Name: TAYLOR		Well Number: 15-2 (OWP)	
Location: QtrQtr: NWSE	Section: 15	Township: 6N	Range: 61W	Meridian: 6	
County: WELD		Federal, Indian or State Lease Number: 55995			
Field Name: GREASEWOOD		Field Number: 32300			

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.485573		Longitude: -104.192584	
GPS Data: GPS Quality Value: 2.2	Type of GPS Quality Value:	Date of Measurement: 10/26/2010	
Reason for Abandonment: <input type="checkbox"/> Dry <input type="checkbox"/> Production Sub-economic <input type="checkbox"/> Mechanical Problems			
<input checked="" type="checkbox"/> Other P&A Orphan Well			
Casing to be pulled: <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No		Estimated Depth: 1100	
Fish in Hole: <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No		If yes, explain details below	
Wellbore has Uncemented Casing leaks: <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No		If yes, explain details below	
Details:			

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
D SAND	6766	6771			
Total: 1 zone(s)					

Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/2	8+5/8	J-55	24	0	311	158	311	0	VISU
1ST	7+7/8	5+1/2	J-55	15.5	0	6874	170	6874	6100	CALC
S.C. 1.1						1496	160	1866	1126	CALC

Date Run: 3/23/2024 Doc [#403706082] Well Name: TAYLOR 15-2 (OWP)

Page 1 of 4

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6700 with 4 sacks cmt on top. CIBP #2: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 30 sks cmt from 6000 ft. to 5800 ft. Plug Type: CASING Plug Tagged: ☐  
Set 87 sks cmt from 1200 ft. to 900 ft. Plug Type: STUB PLUG Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at 6050 ft. with 36 sacks. Leave at least 100 ft. in casing 6000 CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 130 sacks half in. half out surface casing from 411 ft. to 0 ft. Plug Tagged: ☒

Set 10 sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing

Surface Plug Setting Date: \_\_\_\_\_ Cut and Cap Date: \_\_\_\_\_ Number of Days from Setting Surface Plug to Capping or Sealing the Well: \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_

\*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No

Technical Detail/Comments:

Proposed WBD Attached  
CPW consult is not required for pronghorn winter concentration area.  
Notify OWP Supervisor. This well will be plugged per Civitas' Agreement for Plugging Operations, dated October, 17th, 2022

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Ashley Noonan

Title: Sr. Regulatory Analyst Date: 3/14/2024 Email: regulatory@civiresources.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

ECMC Approved: Wolfe, Stephen Date: 3/23/2024

CONDITIONS OF APPROVAL, IF ANY:

Expiration Date: 9/22/2024

COA Type	Description
	<p>Bradenhead Testing Prior to starting plugging operations a bradenhead test shall be performed if there has not been a reported bradenhead test within the 60 days immediately preceding the start of plugging operations.</p> <p>1) If, before opening the bradenhead valve, the beginning pressure is greater than 25 psi, sampling is required.</p> <p>2) If pressure remains at the conclusion of the test, or if any liquids were present during the test, sampling is required.</p> <p>The Form 17 shall be submitted within 10 days of the test. Sampling shall comply with Operator Guidance - Bradenhead Testing and Reporting Instructions. If samples are collected, copies of all final laboratory analytical results shall be provided to the ECMC within three (3) months of collecting the samples.</p> <p>If there is a need for sampling, contact ECMC engineering for verification of plugging procedure.</p>
	<p>Form 27 must be approved prior to cut and cap. Allow 30 days for Director's review of the Form 27; include the Form 27 document number on the Form 6 Subsequent. Any historic Spill or Release discovered beyond the excavation required to safely cut and cap, will be reported on a Form 19, Spill/Release Report.</p>
	<p>Plugging</p> <p>1) Provide electronic Form 42 Notice of MIRU 2 business days ahead of operations and electronic Form 42 Notice of Plugging Operations 48 hours prior to mobilizing for plugging operations.</p> <p>2) Plugs and squeezes will be placed as stated in the Plugging Procedure section of the approved NOIA unless revised by COA or prior approval from ECMC is obtained.</p> <p>3) The wellbore must be static prior to placing cement plugs which are to be a minimum of 100' in length for all but surface plugs. Mechanical isolation requires a 25' cement plug, minimum. For plugs not specified to be tagged, a tag is required if circulation is not maintained while pumping plug and displacing to depth. Wait on cement(WOC) a minimum of 4 hrs before tagging a plug. Tag at tops specified or shallower. Notify ECMC Area Engineer before adding cement to previous plug due to low cement top.</p> <p>4) Place a 50' plug (minimum) at the surface, both inside the inner most casing and in all annular spaces. Surface plugs shall be circulated to surface or placed in such a way as to ensure the full 50' plug. Confirm cement to surface and complete isolation in all strings during cut and cap. After cut and prior to cap, verify isolation by either a 15 minute bubble test or 15 minute optical gas imaging recording. If there is indication of flow contact ECMC Engineering. Provide a statement on the 6 SRA which method was used and what was observed. Retain records of final isolation test for 5 years.</p> <p>5) With the Form 6 SRA operator must provide written documentation which positively affirms each COA has been addressed.</p> <p>6) No current Form 17 on file with ECMC. Contact ECMC area engineer with results of pre-plugging bradenhead test for confirmation of plugging procedure prior to commencing plugging operations.</p> <p>7) Operator must wait a sufficient time on all plugs to achieve the intended design. If at any time during the plugging there is evidence of previously unreported pressure or fluid migration, contact ECMC Area Engineer before continuing operations.</p> <p>8) After setting Plug #1, load the hole and run a CBL from 6700' to confirm cement coverage as reported on this Form 6(N). Contact ECMC Area Engineer with results prior to continuing operations to confirm the placement of subsequent plugs.</p> <p>9) Plugging procedure has been modified as follows,  Plug #1 - 6700', CIBP with 2 sx of cement,  Plug #2 - 6050', perf and squeeze with 36 sx of cement through a CICR set at 6000', upper holes at 5850', spot 30 sx of cement on top of the CICR,  Cut and pull production casing from 3000' +/-,  Plug #3 - 1200-900', 87 sx stub plug,  Plug #4 - 411-0', 130 sx casing plug, circulate to surface, WOC and tag if cement does not remain at the surface,  Plug #5 - 50' of cement at the surface in both the casing and the annulus per COA #4.</p> <p>10) Submit any logs run during the plugging with the Form 6 SRA.</p>
3 COAs	

### Attachment List

<u>Att Doc Num</u>	<u>Name</u>
403706082	WELL ABANDONMENT REPORT (INTENT)
403710722	WELLBORE DIAGRAM
403729291	FORM 6 INTENT SUBMITTED

Total Attach: 3 Files

### General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
Engineer	Civitas is completing the wellbore abandonment. Any historic Spill or Release discovered beyond the excavation required to safely cut and cap, will be reported on a Form 19, Spill/Release Report, and those impacts will be addressed by the Orphaned Well Program. The ECMC Orphan Well Program will complete flowline abandonment and location closure and reclamation.	03/22/2024
Engineer	Groundwater=Laramie-Fox Hills, Upper Pierre Deepest water well=273'(2mi, 18 records) Log=123-15054 6/23/91 GR=4732 L-FH behind surface casing, UP 480-1480	03/22/2024
OGLA	LAS review complete.	03/19/2024
OGLA	Well is in a CPW mapped Pronghorn Winter Concentration Area High Priority Habitat. Although plugging and abandonment operations with heavy equipment will be allowed, the operator is strongly encouraged to avoid them from January 1 through April 30.	03/19/2024
Permit	Confirmed as-drilled well location. Confirmed productive intervals docnum: 1122776. Production reporting delinquent 10/2019- present. Reviewed WBDs. Pass.	03/18/2024

Total: 5 comment(s)