

**FORM
INSP**

Rev
X/20

**State of Colorado
Oil and Gas Conservation Commission**

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Inspection Date:

04/04/2024

Submitted Date:

04/07/2024

Document Number:

708301986

FIELD INSPECTION FORM

Loc ID 324072 Inspector Name: Morris, Matthew On-Site Inspection 2A Doc Num: _____

Status Summary:

- THIS IS A FOLLOW UP INSPECTION
- FOLLOW UP INSPECTION REQUIRED
- NO FOLLOW UP INSPECTION REQUIRED

Operator Information:

ECMC Operator Number: 96850
Name of Operator: TEP ROCKY MOUNTAIN LLC
Address: 1058 COUNTY ROAD 215
City: PARACHUTE State: CO Zip: 81635

Findings:

- 9 Number of Comments
- 1 Number of Corrective Actions
- Corrective Action Response Requested

ANY CORRECTIVE ACTION(S) FROM PREVIOUS INSPECTIONS THAT HAVE NOT BEEN ADDRESSED ARE STILL APPLICABLE

Contact Information:

Contact Name	Phone	Email	Comment
, TEP		COGCCInspectionReports@terraep.com	

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
199990	WELL	PR	11/04/1999	GW	045-07411	FEDERAL GM 14-4	PR

General Comment:

[COGCC Inspection Report Summary](#)

On 4/4/2024 at approximately 11:30, Compliance Inspector Matthew Morris conducted a follow-up inspection at TEP ROCKY MOUNTAIN LLC, FEDERAL-67S96W/4SWSW at Location ID #324072 in Garfield County, Colorado.

Normal production operations were observed.

During the inspection, the following compliance issues were observed:

- 1) Stormwater; refer to Stormwater section

A follow-up on this site inspection will be conducted to ensure the compliance issues have been corrected to comply with CECMC rules.

This location is within or in close proximity to, a CPW Density/High Priority Habitat, Black Bear, NSO Habitat, or Wildlife Management area.

Location

Overall Good:

Signs/Marker:			
Type	BATTERY		
Comment:			
Corrective Action:		Date:	
Type	WELLHEAD		
Comment:			
Corrective Action:		Date:	
Type	TANK LABELS/PLACARDS		
Comment:			
Corrective Action:		Date:	
Type	OTHER		
Comment:	Separator units include attached storage tanks. The sight glass on the side of the unit indicates that the storage tank contains an unknown fluid. No form of labeling or markers is present to identify a potential hazard or the contents of the storage tank.		
Corrective Action:		Date:	

Emergency Contact Number:			
Comment:	911/(970) 285-9377		
Corrective Action:		Date:	_____

Overall Good:

Spills:			
Type	Area	Volume	

In Containment: No _____

Comment: _____

Multiple Spills and Releases?

Fencing/:			
Type	TANK BATTERY		
Comment:	Hog panels		
Corrective Action:		Date:	
Type	WELLHEAD		
Comment:	Pipe rails		
Corrective Action:		Date:	
Type	SEPARATOR		
Comment:	Hog panels		
Corrective Action:		Date:	

Equipment:			corrective date
Type: Dehydrator	# 1		
Comment:			
Corrective Action:		Date:	

Type: Gas Meter Run	# 1		
Comment:			
Corrective Action:			Date:
Type: Plunger Lift	# 1		
Comment:			
Corrective Action:			Date:
Type: Horizontal Heated Separator	# 1		
Comment:			
Corrective Action:			Date:
Type: Bradenhead	# 1		
Comment:			
Corrective Action:			Date:
Type: Bird Protectors	# 3		
Comment:			
Corrective Action:			Date:

Tanks and Berms:

Contents	#	Capacity	Type	Tank ID	SE GPS
PRODUCED WATER	1	<100 BBLs	STEEL AST		
Comment:					
Corrective Action:					Date:

Paint

Condition	Adequate	
Other (Content)		
Other (Capacity)	80 bbls	
Other (Type)		

Berms

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
Metal	Adequate	Walls Sufficient	Base Sufficient	Adequate
Comment:				
Corrective Action:				Date:

Venting:

Yes/No	NO	
Comment:		
Corrective Action:		Date:

Flaring:

Type	
Comment:	
Corrective Action:	Date:

Inspected Facilities

Facility ID: 199990 Type: WELL API Number: 045-07411 Status: PR Insp. Status: PR

Producing Well

Comment:

Corrective Action:

Date:

The subreport 'InspWellFlowline' could not be found at the specified location \\10.14.12

Reclamation - Storm Water - Pit

Storm Water:

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment
		Ditches				
Gravel						
		Culverts				
		Gravel				
		Rip Rap				
Compaction	Fail					Lack of stabilization
		Compaction				
		Sediment Traps				
		Check Dams				
Berms						
Other	Fail					Insufficient tracking BMPs

Comment: [Location surface lacks stabilization with insufficient vehicle tracking BMPs in place to minimize transportation of sediment.](#)

Corrective Action: **1002.f.(2): Oil and gas operators shall implement and maintain Best Management Practices (BMPs) at all oil and gas locations to control Stormwater runoff in a manner that minimizes erosion, transport of sediment offsite, and site degradation. BMPs shall be maintained until the facility is abandoned and final reclamation is achieved pursuant to Rule 1004.**

Date: 04/22/2024

Pits: NO SURFACE INDICATION OF PIT

Attached Documents

You can go to ECMC Images (<https://ecmc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
403745486	INSPECTION SUBMITTED	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=6498741
708301987	Photo Log	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=6498737