

State of Colorado
Energy & Carbon Management Commission



1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Document Number:
403228898

Date Received:
11/14/2022

FIR RESOLUTION FORM

Overall Status:

CA Summary:

3 of 3 CAs from the FIR responded to on this Form

3 CA Completed
0 Factual Review Request

OPERATOR INFORMATION

ECMC Operator Number: 10133
Name of Operator: HILCORP ENERGY COMPANY
Address: P O BOX 61229
City: HOUSTON State: TX Zip: 77208

Contact Name and Telephone:
Name: _____
Phone: () _____ Fax: () _____
Email: _____

Additional Operator Contact:

Contact Name	Phone	Email
<u>Labowskie, Steve</u>		<u>steve.labowskie@state.co.us</u>
<u>.General</u>		<u>FarmingtonRegulatoryTechs@hilcorp.com</u>

ECMC INSPECTION SUMMARY:

FIR Document Number: 702500763
Inspection Date: 11/09/2022 FIR Submit Date: 11/09/2022 FIR Status: _____

Inspected Operator Information:

Company Name: HILCORP ENERGY COMPANY Company Number: 10133
Address: P O BOX 61229
City: HOUSTON State: TX Zip: 77208

LOCATION - Location ID: 326511

Location Name: HUBER-BURKETT-N34N8W Number: 3SESW County: LA PLATA
Qtrqr: SESW Sec: 3 Twp: 34N Range: 8W Meridian: N
Latitude: 37.239580 Longitude: -107.736720

FACILITY - API Number: 05-067- -00 Facility ID: 89124

Facility Name: HUBER-BURKETT Number: 4-3
Qtrqr: SESW Sec: 3 Twp: 34N Range: 8W Meridian: N
Latitude: 37.239580 Longitude: -107.736720

CORRECTIVE ACTIONS:

1 CA# 166024

Corrective Action: Remove impacted material and dispose of in approved manner per rule 906 and 1002.f. Date: 11/17/2022

Response: CA COMPLETED Date of Completion: 11/14/2022

Operator Comment: Impacted material from lube oil at wellhead has been removed and disposed of properly. See attached photos.

ECMC Decision: _____

ECMC Representative: _____

2 CA# 166025

Corrective Action: All unused equipment must be returned to use or stored off location per rule 606. Date: 11/24/2022

Response: CA COMPLETED Date of Completion: 11/14/2022

Operator Comment: 1" pipe at separator, 5 gallon lube oil container at wellhead have been removed. 2" muffler exhaust hose at separator, See attached photos.

ECMC Decision: _____

ECMC Representative: _____

3 CA# 166026

Corrective Action: Install proper guy line markers per Rule 1003.a Date: 11/24/2022

Response: CA COMPLETED Date of Completion: 11/14/2022

Operator Comment: 4 of 4 anchors are marked properly. See attached photos.

ECMC Decision: _____

ECMC Representative: _____

OPERATOR COMMENT AND SUBMITTAL

Comment: _____

I hereby certify that the statements made in this form are, to the best of my knowledge, true, correct, and complete.

Print Name: Priscilla Shorty Signed: _____

Title: OperationsRegulatory Tech Date: 11/14/2022 3:35:23 PM

ATTACHMENT LIST

View Attachments in Imaged Documents on ECMC website (<http://ecmcweblink.state.co.us/>) - Search by Document Number.

Document Number	Description
403228898	FIR RESOLUTION SUBMITTED
403228915	Huber Burkett 4-3Resolved Photos

Total Attach: 2 Files