

Inspection Photos

API: 061-06365

Operator: STRACHAN EXPLORATION INC

Inspection Date: 10/3/2024



Inspection Photos



Photo 1. 8/24/23 Drone aerial photo facing east toward the location.



Inspection Photos



Photo 2. Facing southeast toward by the wellsite. Impacted oily soils was spread all the way from the tank battery to the roadway. Red arrows point to visible impacted stained soils that have not been cleaned up. Previous CA was not completed.



Inspection Photos



Photo 3. View of the stained soils that still remains along the road where oily material was spread along the road.



Photo 4. View of the stained soils that still remains along the road where oily material was spread along the road.



COLORADO
Energy & Carbon Management
Commission
Department of Natural Resources

API: 061-06365 | Date: 10/3/2024

Inspection Photos



Photo 5. Facing toward the pump jack. A new well sign has been installed. The 2 wire fence around the equipment is not sufficient to prevent livestock entry.



COLORADO
Energy & Carbon Management
Commission
Department of Natural Resources

API: 061-06365 | Date: 10/3/2024

Inspection Photos



Photo 6. There is still oil stained soils at the back side of the pumpjack that must be cleaned up. Previous CA was not completed.



COLORADO
Energy & Carbon Management
Commission
Department of Natural Resources

API: 061-06365 | Date: 10/3/2024

Inspection Photos



Photo 7. The plastic container at the pumpjack is broke and needs to be removed and disposed.



Inspection Photos



Photo 8. Facing northeast by the tank battery. There is still oil stained soils where spill crude oil was spread along the road. Red arrows point to visible oil impacted soils.



Inspection Photos



Photo 9. Facing northeast toward the tank battery where previous spill had occurred. The berm around the tanks has been rebuilt but contains oily impacted material with hydrocarbon odor.



Inspection Photos



Photo 10. The berm around the tanks has been rebuilt but contains oily impacted material with hydrocarbon odor. The contaminated berm material must be removed and properly disposed. Previous CA was not completed.



Inspection Photos



Photo 11. The berms around the tanks contains oily impacted material with hydrocarbon odor. The spill at the tank has not been cleaned up. Previous CA was not completed.



Inspection Photos



Photo 12. There are still impacted soils around the tank where spill had occurred. It is unknown the amount that was spilled and impacts still remain. Previous CA was not completed. The tank will likely need to be removed to excavate and remove all of the impacted soils.



COLORADO
Energy & Carbon Management
Commission
Department of Natural Resources

API: 061-06365 | Date: 10/3/2024

Inspection Photos



October 3, 2024
+38.439171,-103.059564

Photo 13. Facing southeast at the location. The two large volume tanks do not have proper labeling or secondary containment. If the tanks are unused then they need to be removed. Previous corrective action was not completed.



COLORADO
Energy & Carbon Management
Commission
Department of Natural Resources

API: 061-06365 | Date: 10/3/2024

Inspection Photos



Photo 14. Facing at the north side of the location. The fence around the tank battery is inadequate to prevent livestock entry and is not maintained. The berm around the tank has been rebuilt.



Inspection Photos



Photo 15. Facing northeast at the north side of the location. The dilapidated shed has been removed from this area.

