

**FORM
INSP**Rev
X/20**State of Colorado
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

10/03/2024

Submitted Date:

10/04/2024

Document Number:

708302858

FIELD INSPECTION FORMLoc ID 334795 Inspector Name: Morris, Matthew On-Site Inspection ☐ 2A Doc Num: _____**Operator Information:**

ECMC Operator Number: 96850

Name of Operator: TEP ROCKY MOUNTAIN LLC

Address: 1058 COUNTY ROAD 215

City: PARACHUTE State: CO Zip: 81635

Status Summary:

- ☒ THIS IS A FOLLOW UP INSPECTION
- ☒ FOLLOW UP INSPECTION REQUIRED
- ☐ NO FOLLOW UP INSPECTION REQUIRED

Findings:

11 Number of Comments

3 Number of Corrective Actions

- ☒ Corrective Action Response Requested

**ANY CORRECTIVE ACTION(S) FROM
PREVIOUS INSPECTIONS THAT HAVE NOT
BEEN ADDRESSED ARE STILL APPLICABLE****Contact Information:**

Contact Name	Phone	Email	Comment
, TEP		COGCCInspectionReports@terraep.com	

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
211555	WELL	PR	12/30/1998	GW	045-07315	FEDERAL GM 33-4	PR
272856	WELL	PR	05/01/2013	GW	045-10181	FEDERAL GM 433-4	PR
272863	WELL	PR	01/01/2012	GW	045-10176	FEDERAL GM 532-4	PR
272865	WELL	PR	10/02/2005	GW	045-10182	FEDERAL GM 333-4	PR

General Comment:**CECMC Inspection Report Summary**

On 10/3/2024 at approximately 11:20, Compliance Inspector Matthew Morris conducted a follow-up inspection at TEP ROCKY MOUNTAIN LLC, FEDERAL-67S96W/4NWSE at Location ID #334795 in Garfield County, Colorado.

During the inspection, the following compliance issues were observed:

- 1) Open-ended lines on storage tanks
- 2) Stormwater; refer to Stormwater section

A follow-up on this site inspection will be conducted to ensure the compliance issues have been corrected to comply with CECMC rules.

This location is within or in close proximity to, a CPW Density/High Priority Habitat, Black Bear, NSO Habitat, or Wildlife Management area.

LocationOverall Good: ☐

Signs/Marker:			
Type	OTHER		
Comment:	Separator units include attached storage tanks. The sight glass on the side of the unit indicates that the storage tank contains an unknown fluid. No form of labeling or markers is present to identify a potential hazard or the contents of the storage tank.		
Corrective Action:		Date:	
Type	WELLHEAD		
Comment:			
Corrective Action:		Date:	
Type	TANK LABELS/PLACARDS		
Comment:			
Corrective Action:		Date:	
Type	BATTERY		
Comment:			
Corrective Action:		Date:	

Emergency Contact Number:

Comment: 911/(970)285-9377

Corrective Action:

Date: _____

Overall Good: ☐

Spills:				
Type	Area	Volume		
In Containment: No _____				
Comment: _____				
<input type="checkbox"/> Multiple Spills and Releases?				

Fencing/:			
Type	TANK BATTERY		
Comment:	Hog panels		
Corrective Action:		Date:	
Type	WELLHEAD		
Comment:	Hog panels		
Corrective Action:		Date:	
Type	SEPARATOR		
Comment:	Hog panels		
Corrective Action:		Date:	

Equipment:			corrective date
Type: Gas Meter Run	# 4		
Comment:			
Corrective Action:		Date:	

Type: Plunger Lift	# 4		
Comment:			
Corrective Action:			Date:
Type: Bird Protectors	# 3		
Comment:			
Corrective Action:			Date:
Type: Bradenhead	# 4		
Comment:			
Corrective Action:			Date:
Type: Horizontal Heated Separator	# 4		
Comment:			
Corrective Action:			Date:
Type: Dehydrator	# 1		
Comment:			
Corrective Action:			Date:

Tanks and Berms:

Contents	#	Capacity	Type	Tank ID	SE GPS	
PRODUCED WATER	1	300 BBLs	STEEL AST		,	
Comment:						
Corrective Action:						Date:

Paint

Condition	Adequate	
Other (Content)		
Other (Capacity)		
Other (Type)		

Berms

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance		
Metal	Adequate	Walls Sufficient	Base Sufficient	Adequate		
Comment:						
Corrective Action:					Date:	
Contents	#	Capacity	Type	Tank ID	SE GPS	
PRODUCED WATER	1	<100 BBLs	STEEL AST		,	
Comment:	Open-ended line on tank.					
Corrective Action:	Secure equipment to comply with Rule 608.e.					
				Date:	10/11/2024	

Paint

Condition	Adequate	
Other (Content)		
Other (Capacity)	80 bbls	
Other (Type)		

Berms

Inspector Name: Morris, Matthew

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance	
Metal	Adequate	Walls Sufficent	Base Sufficent	Adequate	
Comment:					
Corrective Action:					Date:
Contents	#	Capacity	Type	Tank ID	SE GPS
CONDENSATE	2	300 BBLs	STEEL AST		,
Comment:	1) Open-ended line on tank. (Paint is peeling off of lower third of tank. No corrosion or leaks present. No CA at this time.)				
Corrective Action:	1) Secure equipment to comply with Rule 608.e.				Date: 10/11/2024

Paint

Condition	Adequate	
Other (Content)		
Other (Capacity)		
Other (Type)		

Berms

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance	
Metal	Adequate	Walls Sufficent	Base Sufficent	Adequate	
Comment:					
Corrective Action:					Date:

Venting:

Yes/No	NO		
Comment:			
Corrective Action:	Date:		

Flaring:

Type			
Comment:			
Corrective Action:	Date:		

Inspected Facilities									
Facility ID:	211555	Type:	WELL	API Number:	045-07315	Status:	PR	Insp. Status:	PR
Producing Well									
Comment:									
Corrective Action:						Date:			
The subreport 'InspWellFlowline' could not be found at the specified location \\10.14.12									
Facility ID:	272856	Type:	WELL	API Number:	045-10181	Status:	PR	Insp. Status:	PR
Producing Well									
Comment:									
Corrective Action:						Date:			
The subreport 'InspWellFlowline' could not be found at the specified location \\10.14.12									
Facility ID:	272863	Type:	WELL	API Number:	045-10176	Status:	PR	Insp. Status:	PR
Producing Well									
Comment:									
Corrective Action:						Date:			
The subreport 'InspWellFlowline' could not be found at the specified location \\10.14.12									
Facility ID:	272865	Type:	WELL	API Number:	045-10182	Status:	PR	Insp. Status:	PR
Producing Well									
Comment:									
Corrective Action:						Date:			
The subreport 'InspWellFlowline' could not be found at the specified location \\10.14.12									

Reclamation - Storm Water - Pit

Storm Water:

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment
		Rip Rap				
Compaction						
		Check Dams				
		Culverts				
		Other	Fail			Insufficient erosion control
		Gravel				
		Sediment Traps				
Berms						
Gravel						
		Compaction	Fail			Rill erosion on lease road
		Ditches				

Comment: Rill erosion on lease road to location is bypassing ditch and check dam BMPs.

Corrective Action: 1002.f.(2): Oil and gas operators shall implement and maintain Best Management Practices (BMPs) at all oil and gas locations to control Stormwater runoff in a manner that minimizes erosion, transport of sediment offsite, and site degradation. BMPs shall be maintained until the facility is abandoned and final reclamation is achieved pursuant to Rule 1004.

Date: 10/19/2024

Pits: ☒ NO SURFACE INDICATION OF PIT

Attached Documents

You can go to ECMC Images (<https://ecmc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
403946570	INSPECTION SUBMITTED	https://ecmc.state.co.us/weblink/DownloadDocumentPDF.aspx?DocumentId=6733638
708302859	Photo Log	https://ecmc.state.co.us/weblink/DownloadDocumentPDF.aspx?DocumentId=6733636