

FORM 6 Rev 11/20	State of Colorado Energy & Carbon Management Commission 1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109				DE	ET	OE	ES
	WELL ABANDONMENT REPORT				Document Number: 404033476 Date Received:			

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

ECMC Operator Number: 47120		Contact Name: Lorena Ruiz	
Name of Operator: KERR MCGEE OIL & GAS ONSHORE LP		Phone: (970) 336-3535	
Address: P O BOX 173779		Fax:	
City: DENVER	State: CO	Zip: 80217-	Email: lorena_ruiz@oxy.com
For "Intent" 24 hour notice required,		Name: Carlile, Craig	Tel: (970) 629-8279
ECMC contact:		Email: craig.carlile@state.co.us	

Type of Well Abandonment Report:
 ☒ Notice of Intent to Abandon
 ☐ Subsequent Report of Abandonment

API Number 05-123-18273-00		Well Number: 7-32	
Well Name: HSR-KARICH			
Location: QtrQtr: SWNE	Section: 32	Township: 3N	Range: 66W Meridian: 6
County: WELD		Federal, Indian or State Lease Number:	
Field Name: WATTENBERG		Field Number: 90750	

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.182739 Longitude: -104.798025

GPS Data: GPS Quality Value: 2.3 Type of GPS Quality Value: Date of Measurement: 10/30/2008

Reason for Abandonment:
 ☐ Dry
 ☒ Production Sub-economic
 ☐ Mechanical Problems
 ☐ Other

Casing to be pulled: ☒ Yes ☐ No Estimated Depth: 1550

Fish in Hole: ☐ Yes ☒ No If yes, explain details below

Wellbore has Uncemented Casing leaks: ☐ Yes ☒ No If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7370	7378			
NIOBRARA	7166	7169			

Total: 2 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	J-55	24	0	770	538	770	0	VISU
1ST	7+7/8	4+1/2	I-80	11.6	0	7500	540	7500	4050	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 260 with 80 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 5 sks cmt from 7136 ft. to 7075 ft. Plug Type: CASING Plug Tagged: ☐
Set 5 sks cmt from 4380 ft. to 4320 ft. Plug Type: CASING Plug Tagged: ☐
Set 45 sks cmt from 2350 ft. to 1750 ft. Plug Type: CASING Plug Tagged: ☐
Set 80 sks cmt from 260 ft. to 0 ft. Plug Type: CASING Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at 7166 ft. with 95 sacks. Leave at least 100 ft. in casing 7136 CICR Depth

Perforate and squeeze at 4410 ft. with 95 sacks. Leave at least 100 ft. in casing 4380 CICR Depth

Perforate and squeeze at 2350 ft. with 145 sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 345 sacks half in. half out surface casing from 1550 ft. to 720 ft. Plug Tagged: ☐

Set 80 sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☒ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing

Surface Plug Setting Date: _____ Cut and Cap Date: _____ Number of Days from Setting Surface Plug to Capping or Sealing the Well: _____

*Wireline Contractor: _____

*Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No

Technical Detail/Comments:

Signage for P&As:

Prior to commencing operations, Kerr McGee will post signs in conspicuous locations. The signs will indicate plugging and abandonment operations are being conducted, the well name, well, and the Operator's contact information. Signs will be placed so as not to create a potential traffic hazard.

Notifications:

Courtesy notifications will be sent to all parcel owners with building units within 1,500 feet of the location letting them know about out plugging and abandonment operations and providing contact information for Kerr McGee's response line and online resources.

Wellbore Pressure:

In some cases, wellbore pressure drawdown operations may occur approximately 1-2 days prior to Move In Rig Up (MIRU) of the workover rig. This is conducted to allow for reduced time that the workover rig is needed on location. These operations will be conducted in accordance with Form 4 and/or Form 6 requirements.

Water:

Water will be placed on dirt access roads to mitigate dust as needed.

Lighting:

Operations are daylight-only; no lighting impacts are anticipated from operations.

Noise:

Operations will be in compliance with Table 423-1 requirements. Based off the rig sound signature, rig orientation will be considered to reduce noise levels to nearby building units.

Environmental Concerns:

This location was reviewed using a desktop method to review publicly available wildlife data (including CPW & ECMC data) as well as internal wildlife datasets and aerial imagery. All field personnel are trained to identify wildlife risks and raise concerns noticed during operations with the KMOG Health, Safety, and Environment (HSE) department.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Lorena Ruiz
Title: Regulatory Tech Date: _____ Email: lorena_ruiz@oxy.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with ECMC Rules and applicable orders and is hereby approved.

ECMC Approved: _____ Date: _____

CONDITIONS OF APPROVAL, IF ANY LIST

Expiration Date: _____

<u>COA Type</u>	<u>Description</u>
0 COA	

ATTACHMENT LIST

<u>Att Doc Num</u>	<u>Name</u>
404033497	WELLBORE DIAGRAM
404033498	PROPOSED PLUGGING PROCEDURE

Total Attach: 2 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
		Stamp Upon Approval

Total: 0 comment(s)