

FORM
6Rev
11/20

State of Colorado

Energy & Carbon Management Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Replug By Other Operator

Document Number:

404126082

Date Received:

03/14/2025

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

ECMC Operator Number: 8960

Contact Name: Kara English

Name of Operator: BONANZA CREEK ENERGY OPERATING COMPANY

Phone: (720) 525-8319

Address: 555 17TH STREET SUITE 3700

Fax:

City: DENVER State: CO Zip: 80202

Email: kenglish@civiresources.com

For "Intent" 24 hour notice required,

Name: Petrie, Erica

Tel: (303) 726-3822

ECMC contact:

Email: erica.petrie@state.co.us

Type of Well Abandonment Report: ☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

API Number 05-123-05209-00

Well Name: FURROW

Well Number: 1

Location: QtrQtr: NESW Section: 29 Township: 6N Range: 61W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WILDCAT

Field Number: 99999

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.457266

Longitude: -104.235905

GPS Data: GPS Quality Value: Type of GPS Quality Value: Accuracy in Meters Date of Measurement: 06/27/1958

Reason for Abandonment: ☐ Dry ☐ Production Sub-economic ☐ Mechanical Problems☒ Other Re-enter to Re-plugCasing to be pulled: ☐ Yes ☒ No Estimated Depth:Fish in Hole: ☐ Yes ☒ No If yes, explain details belowWellbore has Uncemented Casing leaks: ☐ Yes ☒ No If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth

Total: 0 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	N/A	29	0	256	175	256	0	VISU
OPEN HOLE	7+7/8				256	7001				

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth _____ with _____ sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set	70	sks cmt from	6500	ft. to	6300	ft.	Plug Type:	OPEN HOLE	Plug Tagged:	<input type="checkbox"/>
Set	70	sks cmt from	6008	ft. to	5808	ft.	Plug Type:	OPEN HOLE	Plug Tagged:	<input type="checkbox"/>
Set	70	sks cmt from	1460	ft. to	1260	ft.	Plug Type:	OPEN HOLE	Plug Tagged:	<input checked="" type="checkbox"/>
Set		sks cmt from		ft. to		ft.	Plug Type:		Plug Tagged:	<input type="checkbox"/>
Set		sks cmt from		ft. to		ft.	Plug Type:		Plug Tagged:	<input type="checkbox"/>

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 235 sacks half in. half out surface casing from 750 ft. to 0 ft. Plug Tagged: ☒

Set 10 sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing

Surface Plug Setting Date: _____ Cut and Cap Date: _____ Number of Days from Setting Surface Plug to Capping or Sealing the Well: _____

*Wireline Contractor: _____

*Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No

Technical Detail/Comments:

Proposed WBD Attached.
PW consult is not required for big game HPH.
Unable to confirm csg grade with historical documentation (used N/A).
- Surface owner consultation attached
- Location Photos attached
Operator will use secondary containment for all tanks and other liquid containment.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Aubrey Noonan

Title: Sr. Regulatory Analyst Date: 3/14/2025 Email: regulatory@civiresources.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with ECMC Rules and applicable orders and is hereby approved.

ECMC Approved: Wolfe, Stephen Date: 3/21/2025

CONDITIONS OF APPROVAL, IF ANY LIST

Expiration Date: 9/20/2025

COA Type	Description
	Operator shall implement measures to control venting, to protect health and safety, and to ensure that vapors and odors from well plugging operations do not constitute a nuisance or hazard to public welfare.
	<p>Plugging</p> <p>1) Provide electronic Form 42 Notice of MIRU 2 business days ahead of operations and electronic Form 42 Notice of Plugging Operations 48 hours prior to mobilizing for plugging operations.</p> <p>2) Plugs and squeezes will be placed as stated in the Plugging Procedure section of the approved NOIA unless revised by COA or prior approval from ECMC is obtained.</p> <p>3) The wellbore must be static prior to placing cement plugs which are to be a minimum of 100' in length for all but surface plugs. Mechanical isolation requires a 25' cement plug (minimum) on top. For plugs not specified to be tagged, a tag is required if circulation is not maintained while pumping plug and displacing to depth. Wait on cement(WOC) a minimum of 4 hrs before tagging a plug. Tag at tops specified. Notify ECMC Area Engineer of a high(shallow) tag or before adding cement to a previous plug due to a low(deep) cement top.</p> <p>4) Place a 50' plug (minimum) at the surface, both inside the inner most casing and in all annular spaces. Surface plugs shall be circulated to surface. Confirm cement to surface and complete isolation in all strings during cut and cap. After cut and prior to cap, verify isolation by either a 15 minute bubble test or 15 minute optical gas imaging observation. If there is indication of flow contact ECMC Engineering. Provide a statement on the 6SRA which method was used and what was observed. Retain records of final isolation test for 5 years.</p> <p>5) With the Form 6 SRA operator must provide written documentation which positively affirms each COA has been addressed.</p> <p>6) Operator must wait a sufficient time on all plugs to achieve the intended design. If at any time during the plugging there is evidence of previously unreported pressure or fluid migration, contact ECMC Area Engineer before continuing operations.</p> <p>7) Plugging procedure has been modified as follows, Plug #1 - 6500-6300', 70 sx cement open hole plug, Plug #2 - 6008-5808', 70 sx cement open hole plug, Plug #3 - 1460-1260', 70 sx cement open hole plug, WOC and tag, Plug #4 - 750-0', circulate 235 sx cement to surface, WOC and tag if cement does not remain at the surface, Plug #5 - 50' of cement at the surface per COA #4.</p>
	"As-Drilled" well location GPS data has not been reported for this well. Operator will obtain the GPS data pursuant to Rule 216 and submit it on the Form 6 Subsequent Report of Abandonment.
	Operator committed to the following Best Management Practices under the Technical Detail/ Comments section on the Submit Tab: Operator will use secondary containment for all tanks and other liquid containment.
4 COAs	

ATTACHMENT LIST

Att Doc Num	Name
404126082	FORM 6 INTENT SUBMITTED
404126121	WELLBORE DIAGRAM
404126122	OTHER
404126127	OTHER

Total Attach: 4 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
Engineer	Groundwater= Laramie-Fox Hills, Upper Pierre Deepest water well= 720',280'(2mi, 37 records) Log= 123-05209 6/27/58 GR=4684 L-FH behind SC, UP base SC-1450'	03/21/2025
Permit	Passes Permitting • No completed intervals to verify; well never completed. • No production reporting to verify; well never produced.	03/19/2025
OGLA	Location is in a CPW mapped Pronghorn Winter Concentration Area High Priority Habitat. Although plugging and abandonment operations with heavy equipment will be allowed, the operator is strongly encouraged to avoid them from January 1 through April 30.	03/19/2025

Total: 3 comment(s)