

**Inspection/Audit Photos**  
**Location Name: TEP Rocky Mountain LLC CSF B Pad**  
**Location # 335054**



**Photo # 5845 From entrance to location**



**Photo # 5846 From entrance to location**

## Inspection/Audit Photos

Location Name: TEP Rocky Mountain LLC CSF B Pad

Location # 335054



Photo # 5847 Location



Photo # 5848 Location



**Inspection/Audit Photos**  
**Location Name: TEP Rocky Mountain LLC CSF B Pad**  
**Location # 335054**



**Photo # 5849 Location**



**Photo # 5850 Location**

**Inspection/Audit Photos**  
**Location Name: TEP Rocky Mountain LLC CSF B Pad**  
**Location # 335054**



**Photo # 5851 Location**



**Photo # 5852 Location**



**Inspection/Audit Photos**  
**Location Name: TEP Rocky Mountain LLC CSF B Pad**  
**Location # 335054**



**Photo # 5853 PRV vent line does not comply with CECMC pressure safety device rules**



**Photo # 5854 PRV vent line does not comply with CECMC pressure safety device rules**

**Inspection/Audit Photos**  
**Location Name: TEP Rocky Mountain LLC CSF B Pad**  
**Location # 335054**



**Photo # 5855 PRV vent line does not comply with CECMC pressure safety device rules**



**Photo # 5856 PRV vent line does not comply with CECMC pressure safety device rules**



## Inspection/Audit Photos

Location Name: TEP Rocky Mountain LLC CSF B Pad

Location # 335054



Photo # 5857 Unused equipment



Photo # 5858 Same unused equipment (Additionally the chemical tank label is faded & illegible)

**Inspection/Audit Photos**  
**Location Name: TEP Rocky Mountain LLC CSF B Pad**  
**Location # 335054**



**Photo # 5859 Open ended load line (Additionally ice that has formed at the valve/load line could indicate a possible leak)**



**Photo # 5860 Debris**