

**FORM
INSP**Rev
X/20**State of Colorado
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

03/25/2025

Submitted Date:

03/28/2025

Document Number:

718700227**FIELD INSPECTION FORM**Loc ID 317233 Inspector Name: Edwardson, Dylan On-Site Inspection ☐ 2A Doc Num: _____**Operator Information:**ECMC Operator Number: 24500Name of Operator: PADCO LLCAddress: 16508 ARMINTA STREETCity: VAN NUYS State: CA Zip: 91406**Status Summary:**☐ THIS IS A FOLLOW UP INSPECTION☒ FOLLOW UP INSPECTION REQUIRED☐ NO FOLLOW UP INSPECTION REQUIRED**Findings:**5 Number of Comments2 Number of Corrective Actions☒ Corrective Action Response Requested**ANY CORRECTIVE ACTION(S) FROM
PREVIOUS INSPECTIONS THAT HAVE NOT
BEEN ADDRESSED ARE STILL APPLICABLE****Contact Information:**

Contact Name	Phone	Email	Comment
BROTHERTON, ANDREA		abrotherton@136elcamino.com	

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
237330	WELL	PR	09/01/2020	OW	121-09831	FASSLER 6	RI
317233	LOCATION	AC			-	FASSLER-62N53W 32NENE	RI

General Comment:

This is an Interim Reclamation and Stormwater Inspection for Location ID 317233.

LocationOverall Good: ☐**Signs/Marker:**

Type			
Comment:	Tank labels/NFPA placards near wellhead day tanks are not legible (e.g. peeling, faded, cracked, etc).		
	Install sign to comply with Rule 605.g.		
Corrective Action:		Date:	

Emergency Contact Number:

Comment:		
Corrective Action:		Date: _____

Overall Good: ☐**Spills:**

Type	Area	Volume		
------	------	--------	--	--

In Containment: No

Comment: ☐ Multiple Spills and Releases?**Equipment:**

Type: Other	#		corrective date
Comment:	Previous FIR (doc #708200244) documented that guy line anchors did not appear to be properly marked (e.g. bright marker not less than four (4) feet in height). During this inspection, it does not appear that that this corrective action has been resolved as the guy line anchors do not comply with Rule 1003.a. Refer to attached inspection photos.		
Corrective Action:	Install proper guy line markers per Rule 1003.a.		Date: 04/11/2025
Type: Other	#		
Comment:	Previous FIR (doc #708200244) documented that day tanks near wellhead did not have any wildlife exclusion devices observed. During this inspection, it appears that wildlife exclusion devices have been installed since the previous inspection, however, one portion of the netting requires maintenance and/or replacement as it appears torn/inadequate. Refer to attached inspection photos.		
	Install or repair wildlife protection equipment per Rule 902.b.		
Corrective Action:		Date:	

Venting:

Yes/No		
Comment:		
Corrective Action:		Date:

Flaring:

Type		
Comment:		
Corrective Action:		Date:

Reclamation - Storm Water - Pit

Storm Water:

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment
Comment:		This location does not comply with Rule 1002.f. During this inspection, erosion degradation and unstabilized soils were observed along the access road leading to the well location. Refer to attached inspection photos.				
Corrective Action:		Install or repair required BMPs per Rule 1002.f.(2)C.				Date: 04/11/2025
Pits: <input type="checkbox"/> NO SURFACE INDICATION OF PIT						

Attached Documents

You can go to ECMC Images (<https://ecmc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
404145826	INSPECTION SUBMITTED	https://ecmc.state.co.us/weblink/DownloadDocumentPDF.aspx?DocumentId=6981721
718700253	Inspection Photos	https://ecmc.state.co.us/weblink/DownloadDocumentPDF.aspx?DocumentId=6981714