

Inspection Photos

API: 071-06094

Operator: AMOCO PRODUCTION COMPANY

Inspection Date: 7/22/2021



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-06094 | Date: 7/22/2021

Inspection Photos



Photo 1. Facing south toward the access road. The road was not recontoured and reclaimed per the rules. Stormwater BMP's have been installed along the road.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-06094 | Date: 7/22/2021

Inspection Photos



Photo 2. Facing back down the road. Rock rip/rap has been installed along the side of the road but is higher than the road which may cause stormwater to flow down the road.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-06094 | Date: 7/22/2021

Inspection Photos



Photo 3. Facing northeast along the access road.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-06094 | Date: 7/22/2021

Inspection Photos



Photo 4. Facing south along the access road.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-06094 | Date: 7/22/2021

Inspection Photos



Photo 5. Facing south toward the location. The location has not been recontoured and reclaimed per the rules.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-06094 | Date: 7/22/2021

Inspection Photos



Photo 6. The flat surface of the well pad still remains.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-06094 | Date: 7/22/2021

Inspection Photos



Photo 7. Facing northeast toward the location. A vertical unstable cut slope still remains. The fill slope material was not resloped back to the cut slope.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-06094 | Date: 7/22/2021

Inspection Photos



Photo 8. Facing northeast toward the fill slope of the location. This fill material was not recontoured back into the cut slope.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-06094 | Date: 7/22/2021

Inspection Photos



Photo 9. Facing down the fill slope of the location which was graded and seeded. It was observed that a light amount of hydromulch was applied to soils. There are only two rows of wattles installed on the steep slope which may not be sufficient.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-06094 | Date: 7/22/2021

Inspection Photos



Photo 10. Facing north along the fill slope. The wattles along the slope did not appear to be properly trenched into the soil which can cause the wattles to be displaced.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-06094 | Date: 7/22/2021

Inspection Photos



Photo 11. This wattle is displaced from wildlife in the area. BMP's will need to be monitored and maintained.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-06094 | Date: 7/22/2021

Inspection Photos



Photo 12. Standing at the bottom of the canyon facing east toward location. The fill slope was graded, seeded, and hydromulched. There does not appear to be sufficient stormwater controls along the fill slope. The red arrows point to two rows of wattles along the approximate 250 ft. slope.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-06094 | Date: 7/22/2021

Inspection Photos



Photo 13. Facing southeast toward the location standing at bottom of the canyon. Additional BMP's should be installed along the canyon bottom where concentrated stormwater flows.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-06094 | Date: 7/22/2021

Inspection Photos



Photo 14. The road that was cut to access the canyon bottom was not recontoured.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-06094 | Date: 7/22/2021

Inspection Photos

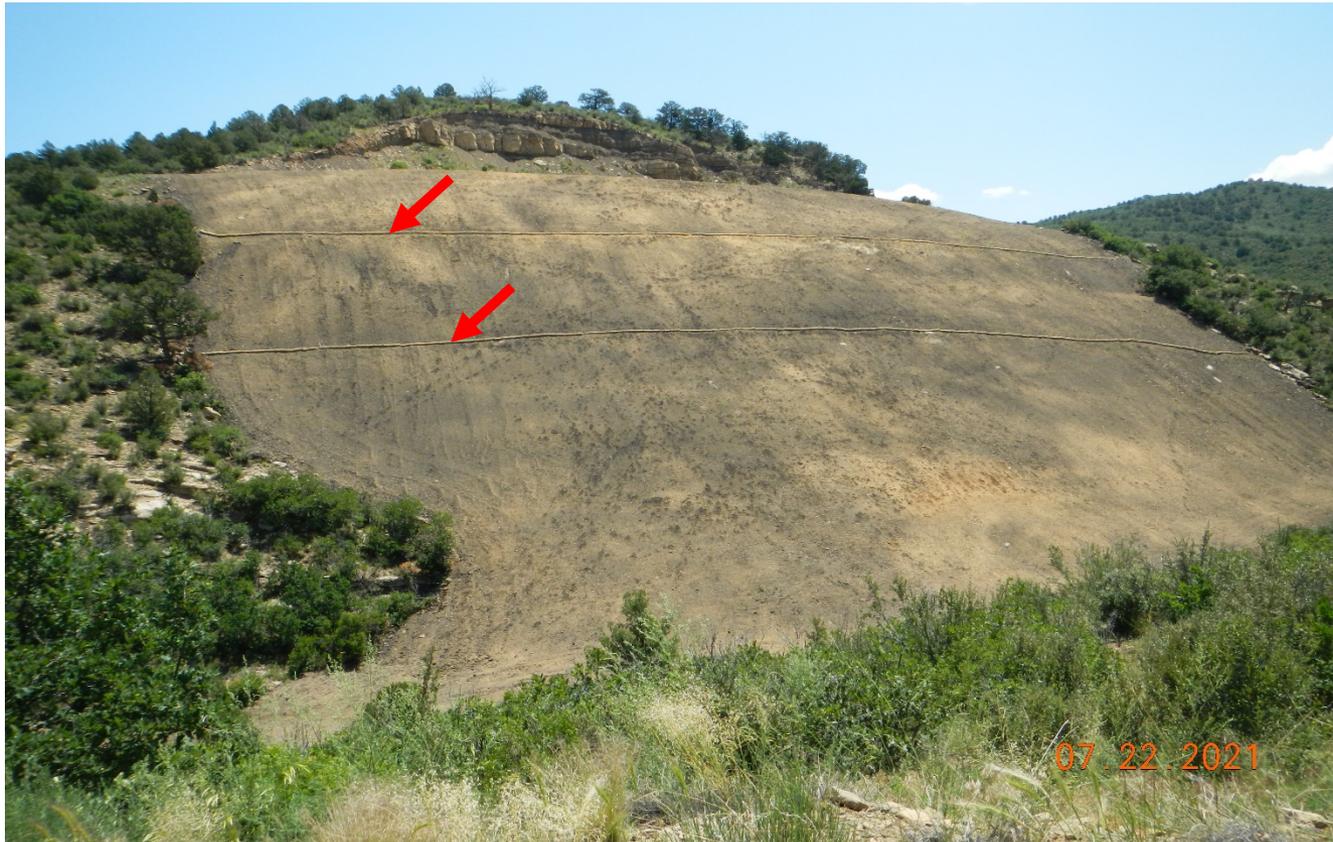


Photo 15. Standing at the road across the canyon facing east toward the location. There does not appear to be sufficient stormwater controls along the fill slope. The red arrows point to two rows of wattles along the approximate 250 ft. slope.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-06094 | Date: 7/22/2021

Inspection Photos



Photo 16. Facing northeast toward the location. The photo shows that the fill slope was graded but not recontoured and the cut slope remains.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-06094 | Date: 7/22/2021

Inspection Photos



Photo 17. Facing north toward the location. The photo shows the fill slope and cut slope remains. The location does not comply with the reclamation requirements.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-06094 | Date: 7/22/2021