

# Inspection Photos

Location Name: APADACA 33-29 CA DATE 5-6-20

API#: 05-071-06480

INSP. #: 695102



Colorado Oil & Gas Conservation Commission  
37.1413, -104.6913, 1967.0m, 301°  
2020/04/06 15:39:12




Colorado Oil & Gas Conservation Commission  
37.14135, -104.69143, 2007.0m, 61°  
2020/04/06 15:43:44

**PHOTO 1: LOCATION**

**PHOTO 2: WELL SIGN**

**Inspection Photos**  
**Location Name: APADACA 33-29 CA DATE 5-6-20**  
**API#: 05-071-06480**  
**INSP. #: 695102**

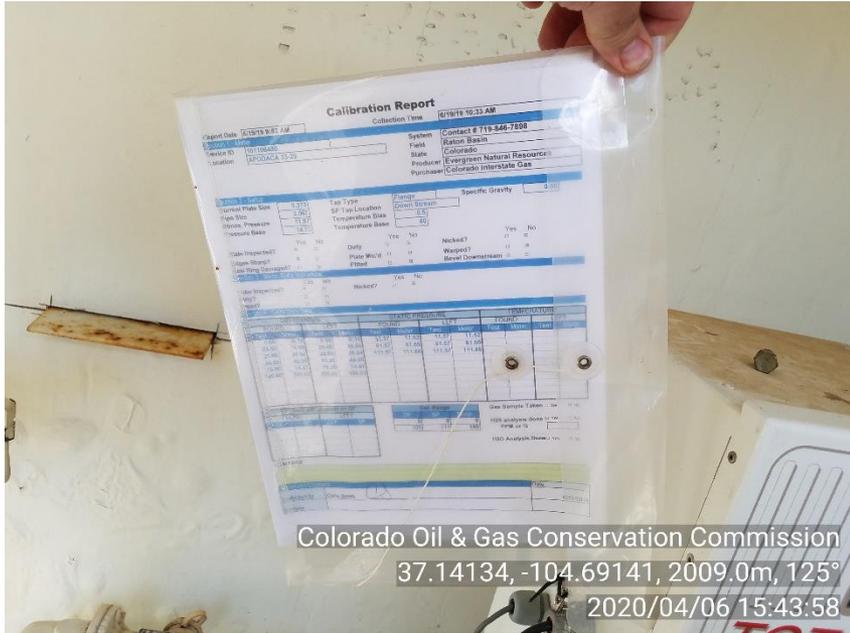

**PHOTO 3: GAS METER CAL. REPORT**

**PHOTO 4: UNUSED 1" RISER NOT LO/TO. 24 HOURS TO LO/TO 30 DAYS TO REMOVE RISER PER RULE 603.f. CA DATE 4-7-20.**

## Inspection Photos

Location Name: APADACA 33-29 CA DATE 5-6-20

API#: 05-071-06480

INSP. #: 695102



**PHOTO 5: AREA OF IMPACTED SOIL NEAR WELLHEAD APPEARS TO BE COMING FROM OIL RUNNING OFF PUMPJACK BASE. Conduct maintenance on equipment, cleanup stained material and review self inspection processes. PER RULE 1002.f.(2).D CA DATE 5-6-20.**

**PHOTO 6: AREA OF IMPACTED SOIL NEAR PUMPJACK PRIME MOVER APPEARS TO BE COMING FROM OIL PUMPJACK PRIME MOVER LEAKS. Conduct maintenance on equipment, cleanup stained material and review self inspection processes. PER RULE 1002.f.(2).D CA DATE 5-6-20.**

## Inspection Photos

Location Name: APADACA 33-29 CA DATE 5-6-20

API#: 05-071-06480

INSP. #: 695102



**PHOTO 7: AREA OF IMPACTED SOIL NEAR PUMPJACK PRIME MOVER ON THE OPPOSITE SIDE FROM PREVIOUS PHOTOS APPEARS TO BE COMING FROM OIL PUMPJACK PRIME MOVER LEAKS. Conduct maintenance on equipment, cleanup stained material and review self inspection processes. PER RULE 1002.f.(2).D CA DATE 5-6-20.**

**PHOTO 8: PUMPJACK PRIME MOVER IS SATURATED WITH WHAT APPEARS TO BE OIL. Securely fasten all valves, pipes, and fittings to ensure good mechanical condition, inspect at regular intervals and maintain in good mechanical condition per Rule 605.d. CA DATE 5-6-20**