

Inspection Photos and Issue Report

8/25/2022

Operator: PRE RESOURCES INC #10241

Location #322302

Garfield County, CO

Aaron Trujillo

NW Reclamation Specialist

COGCC

Inspection Photos
Operator Name: PRE RESOURCES INC #10241
Location #322302



August 25, 2022



August 25, 2022

Photo 1: Photos 1-2 taken from the north end of the Location. Photos provide an overview of the Location from southeast, south, southwest to west. Photos shows final reclamation including recontouring/regrading and revegetation activities have not been conducted.

Inspection Photos
Operator Name: PRE RESOURCES INC #10241
Location #322302



August 25, 2022



August 25, 2022

Photo 2: See comments under photo 1.

Inspection Photos
Operator Name: PRE RESOURCES INC #10241
Location #322302



Photo 3: Photo taken from the cut slopes on the northeast end of the Location. Photo shows slopes have not been reclaimed; BMPs to minimize erosion and degradation are missing or insufficient on Location; gully erosion and sediment transport evident. 6.5' measuring stick for reference.

Inspection Photos
Operator Name: PRE RESOURCES INC #10241
Location #322302



Photo 4: Continued from photo 3. Photo taken from the base of the cut slopes. Photo shows sediment deposition resulting from erosion degradation at the cut slopes.

Inspection Photos
Operator Name: PRE RESOURCES INC #10241
Location #322302



Photo 5: Photo shows gully erosion degradation observed at the cut slopes on the east end of the Location. 6.5' measuring stick for reference.

Inspection Photos
Operator Name: PRE RESOURCES INC #10241
Location #322302



Photo 6: Photo taken from the north east end of the Location, facing southwest. Photo shows gravel, as well as a secondary containment berm remaining on the Location.

Inspection Photos
Operator Name: PRE RESOURCES INC #10241
Location #322302



Photo 7: Continue from photo 6. Photo shows gravel, as well as a secondary containment berm remaining on the Location.

Inspection Photos
Operator Name: PRE RESOURCES INC #10241
Location #322302



Photo 8: Gravel remaining at the well site. Photo also shows vegetation on the Location remains predominantly Undesirable Weedy, as well as Noxious Plant species.

Inspection Photos
Operator Name: PRE RESOURCES INC #10241
Location #322302



Photo 9: Photo of cut slopes on Location.

Inspection Photos
Operator Name: PRE RESOURCES INC #10241
Location #322302



Photo 10: Pipe with wires remaining on the northwest end of the Location.

Inspection Photos
Operator Name: PRE RESOURCES INC #10241
Location #322302

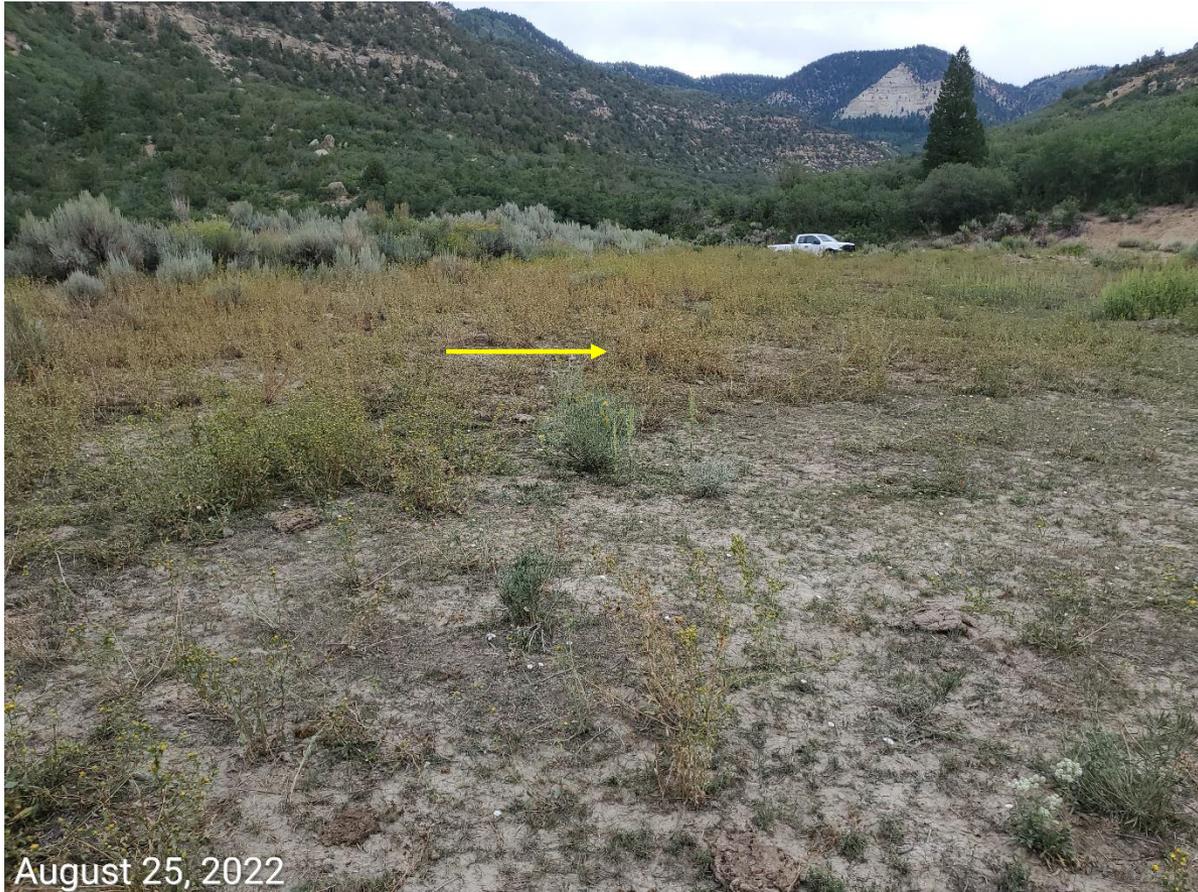


Photo 11: Photo example showing vegetation on Location; vegetation predominantly undesirable weedy plant species, including noxious weeds such as bindweed. Other Undesirable species observed include Amaranth, and Curlycup gumweed (brownish-yellow plant dominating background on the pad, arrow).

Inspection Photos
Operator Name: PRE RESOURCES INC #10241
Location #322302



Photo 12: Photo shows soil stockpile observed remaining on the southeast end of the Location.

S INC #10241



Photo 13: Photo shows compaction test pit taken from the Location. Photo shows zones of compaction evident below subsurface, including “platy” soil structures (arrow)- these structures are thin, flat plates of soil that lie horizontally and are usually found in compacted soils.

August 25, 2022

Inspection Photos
Operator Name: PRE RESOURCES INC #10241
Location #322302



Photo 14: Photo taken from the access road. Photo shows access road has not been reclaimed. Photo also show erosion degradation occurring at road.