

Construction and Stormwater Inspection

Date: 04/19/2024

Operator: KERR MCGEE OIL & GAS ONSHORE LP -
47120

Location ID: 485057

Inspection Document #: 708201180

Weld County, CO

Dylan Edwardson
Reclamation Specialist, ECMC



COLORADO

Energy & Carbon Management
Commission

Department of Natural Resources

Inspection Photos
Location Name: Vista 13-16HZ
Location ID: 485057

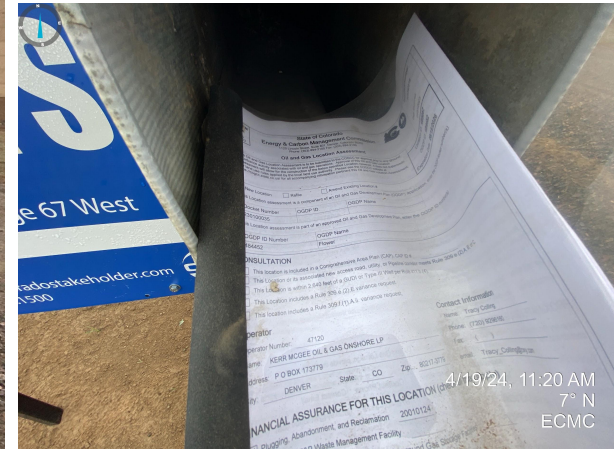


Photo 1. Form 2A was posted on location at the time of this inspection.

Inspection Photos
Location Name: Vista 13-16HZ
Location ID: 485057



Photo 2. Taken from the southern portion of the disturbance area. Stormwater control measures have been installed during the construction phase of the location. Temporarily stabilized outlets, ditch and berm and sediment traps pictured.

Inspection Photos
Location Name: Vista 13-16HZ
Location ID: 485057



Photo 2. Taken near the southern portion of the disturbance area; see comments in Photo 1.



Photo 4. Taken from the western portion of the disturbance area. Stormwater ditch and berm installed along the temporary access road to the working pad surface.



Photo 5. Taken from the western portion of the disturbance area. Stormwater ditch and berm and culvert with temporarily stabilized outlets.



Photo 6. Taken from the northwestern portion of the disturbance area. Perimeter ditch and berm do not appear to be properly stabilized as evidenced by bare/exposed soils.

Inspection Photos
Location Name: Vista 13-16HZ
Location ID: 485057



Photo 7. Taken from the northeastern portion of the disturbance area. Perimeter ditch and berm do not appear to be properly stabilized as evidenced by bare/exposed soils.



Photo 8. Taken along the east side of the disturbance area. Photo illustrates a sediment trap and temporarily stabilized outlets.



Photo 9. Taken along the eastern side of the disturbance area. erosion control logs installed in the perimeter stormwater ditch. Perimeter ditch and berm do not appear to be properly stabilized as evidenced by bare/exposed soils

Inspection Photos
Location Name: Vista 13-16HZ
Location ID: 485057



Photo 10. Taken near the eastern/southeastern portion of the disturbance area; see comments in Photo 9.



Photo 11. Taken near the eastern/southeastern portion of the disturbance area; see comments in Photo 8.



4/19/24, 11:17 AM
302° NW
ECMC

Photo 12. Taken near the southern/southeastern portion of the disturbance area. Photo illustrates outlet protections and unstabilized soils within the ditch and berm and slopes. Additional stabilization BMPs are required on the bare/exposed soils.

Inspection Photos
Location Name: Vista 13-16HZ
Location ID: 485057



Photo 13. Facing west near the construction area. Photo illustrates that the existing county road has been improved and stabilized.

Inspection Photos
Location Name: Vista 13-16HZ
Location ID: 485057



Photos 14 & 15. Examples of debris and trash observed throughout the location; Operator shall self inspect the entire location and remove all debris and trash.

Inspection Photos
Location Name: Vista 13-16HZ
Location ID: 485057



Photo 16. Taken from the cut/fill transition near the proposed production facility location. Photo illustrates that cut/fill slopes require additional stabilization BMPs.

Inspection Photos
Location Name: Vista 13-16HZ
Location ID: 485057



Photo 17. See comments in Photo 16.

Inspection Photos
Location Name: Vista 13-16HZ
Location ID: 485057



Photo 18. Taken from the cut/fill transition near the proposed well locations. Photo illustrates that cut/fill slopes require additional stabilization BMPs.



Photo 19. Taken from the southeast corner of the topsoil stockpile. Photo illustrates that the stockpile requires additional temporary stabilization BMPs.

Inspection Photos
Location Name: Vista 13-16HZ
Location ID: 485057



Photo 20. Taken from the northern portion of the topsoil stockpile; see comments in Photo 19.

Inspection Photos
Location Name: Vista 13-16HZ
Location ID: 485057



Photo 21. Taken from the eastern side of the topsoil stockpile; see comments in Photo 19.

Inspection Photos
Location Name: Vista 13-16HZ
Location ID: 485057



4/19/24, 11:38 AM
211° SW
ECMC

Photo 22. Taken from the top/center portion of the topsoil stockpile; see comments in Photo 19.