

P&A Procedure for Figure Four Ranch 499-14-83

14-4S-99W Rio Blanco County, Colo.

9 5/8" @ 1,900' TOC at Surface

5 1/2" 17# @ 9,606' TOC: Unknown

DV tool at 4,936'

Tubing: 2 3/8" at unknown

Perfs: 6,572- 7,734'

9,504-9,560'

MIRU

NDWH, NUBOP

POH and check tubing visually

RIH with bit 50' above perfs to 9,450'

POH, RIH with CIBP and set at same depth

Spot 25 sxs of cement on CIBP (216' in 5 1/2")

POH, RIH and set CIBP at 6,520'

Spot 25 sxs of cement on CIBP (216' in 5 1/2")

POH to 5,000' and spot 20 sxs of cement across the DV tool

Roll hole with produced water

Pressure test casing, if it fails call for orders

POH, Cut and pull casing from 50' below base of surface

RIH to casing stub, and spot 80 sacks of cement

POH, WOC and tag, cement must be 50' above the shoe

Add cement if necessary, POH

NDBOP, RIH to 100' circulate cement to surface

Cut off the wellhead

Top off cement in annulus if necessary

Weld a plate with well information

RDMO

All cement is 15.8# class G neat with a 1.15 cuft/sack yield

Well Name: Figure Four Ranch 499-14-83

API #: 051031095900

Location: Sec. 14 – 4S – 99W

KB: 8,440' (28' AGL)


GL: 8,412'

County/St: Rio Blanco, CO

Created By: M. Bale

Date: 2/29/2012

Current Wellbore

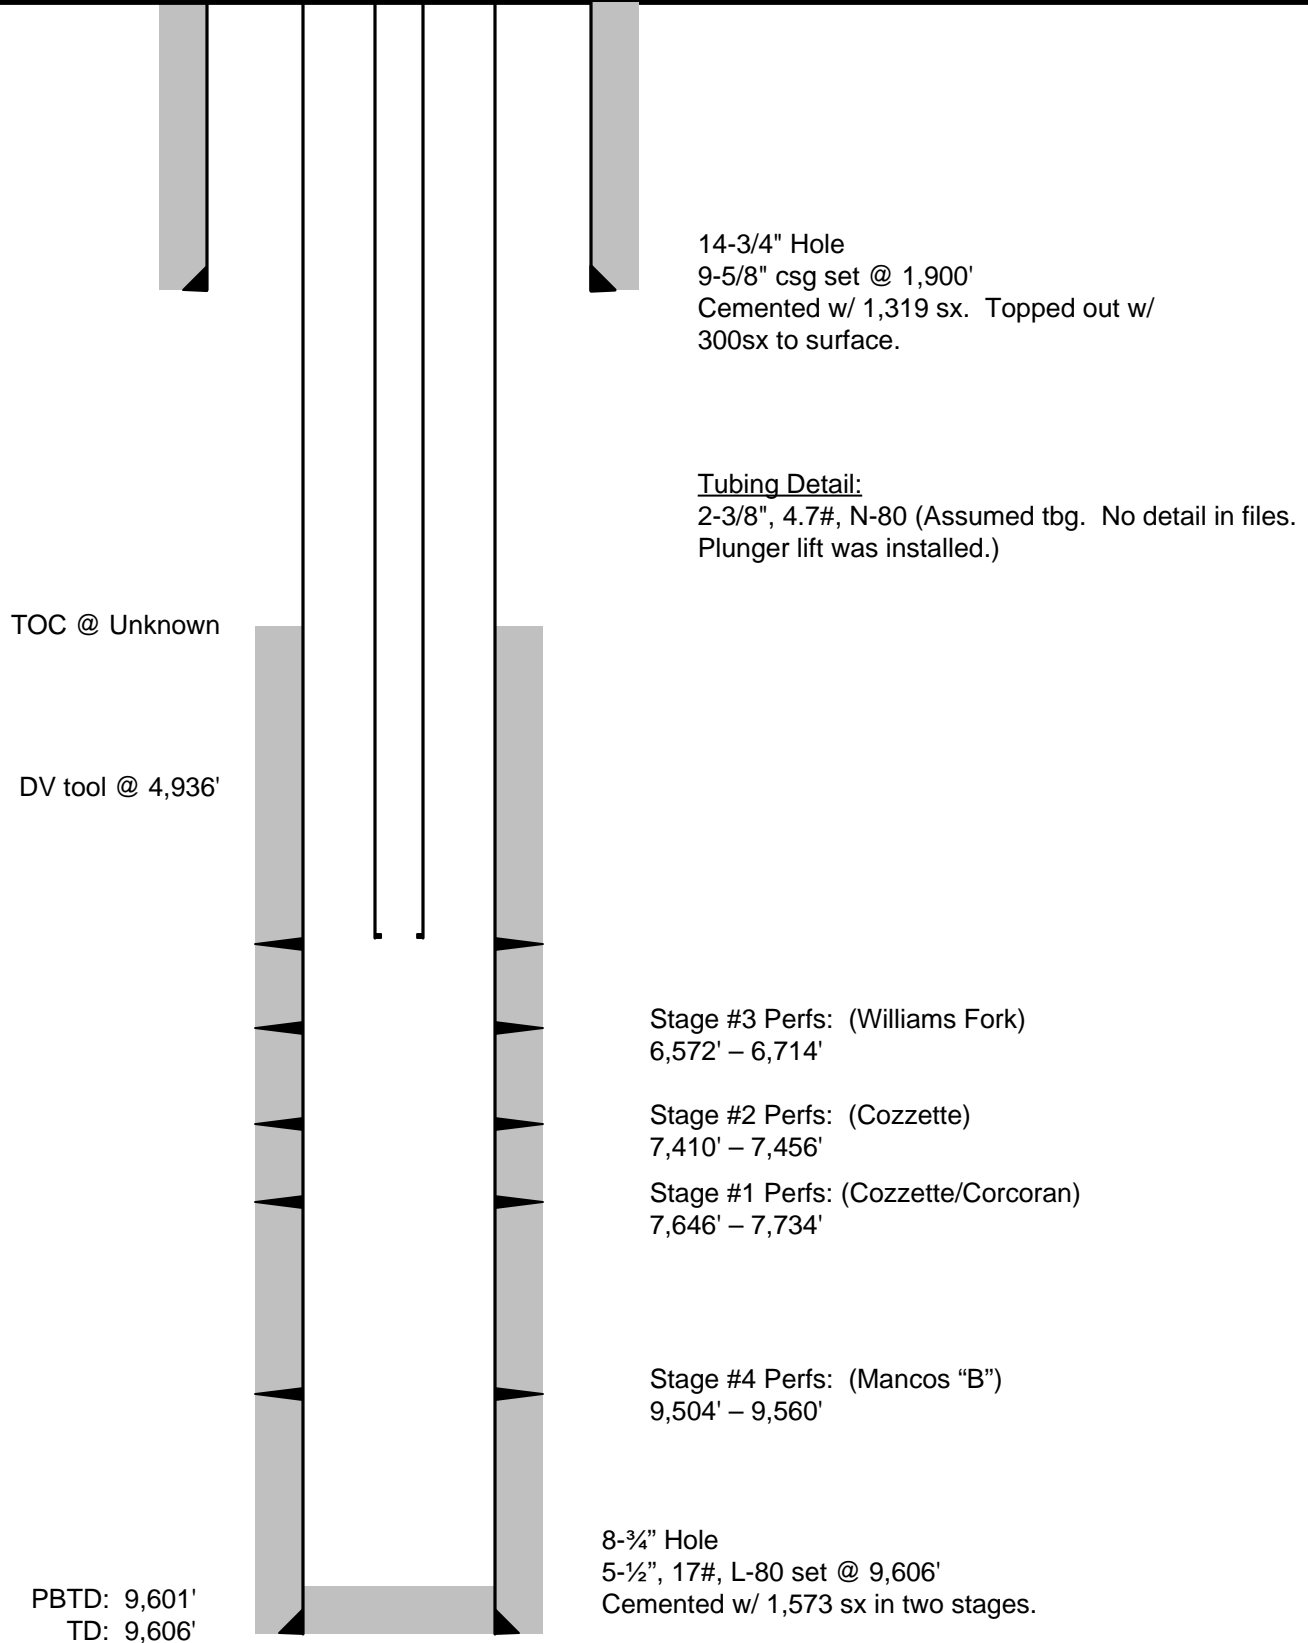

Well Name: Figure Four Ranch 499-14-83

API #: 051031095900

Location: Sec. 14 – 4S – 99W

KB: 8,440' (28' AGL)

GL: 8,412'

County/St: Rio Blanco, CO

Created By: M. Bale

Date: 2/29/2012

Proposed Wellbore

