


JR Land Surveying, LLC
 8114 Northstar Drive
 Windsor, Colorado 80528
 P. 970-576-4641

WELL LOCATION CERTIFICATE

THIS MAP DOES NOT REPRESENT A BOUNDARY SURVEY

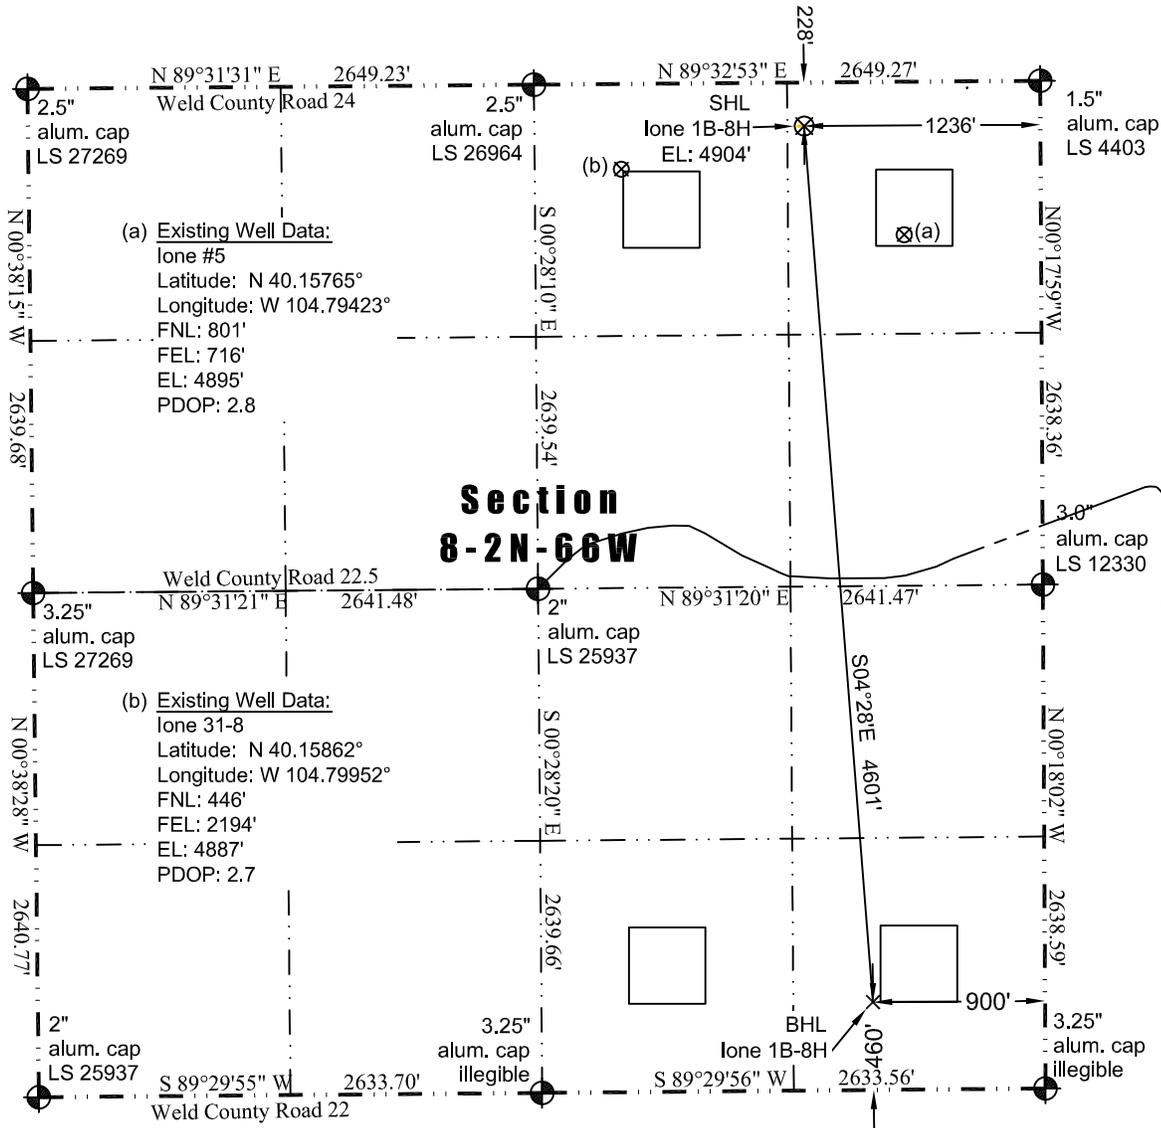

(a) Existing Well Data:
 lone #5
 Latitude: N 40.15765°
 Longitude: W 104.79423°
 FNL: 801'
 FEL: 716'
 EL: 4895'
 PDOP: 2.8

(b) Existing Well Data:
 lone 31-8
 Latitude: N 40.15862°
 Longitude: W 104.79952°
 FNL: 446'
 FEL: 2194'
 EL: 4887'
 PDOP: 2.7

In accordance with a request from Jay Knutson of EnCana Oil & Gas (USA) Inc., JR Land Surveying, LLC has determined the location of the **lone 1B-8H** well site to be SHL: 228' FNL and 1236' FEL, (BHL 460' FSL and 900' FEL), as measured at ninety (90) degrees from the section lines of Section 8, Township 2 North, Range 66 West of the 6th Principal Meridian, Weld County Colorado.

Proposed Surface Hole Data:
 Latitude: N 40.15922° (BHL 40.14662°)
 Longitude: W 104.79609° (BHL 104.79493°)
 PDOP: 1.9

Nearest:
 Building: 3,150' northeast Above Ground Utility: 1,423' west
 Public Road: 1,964' northwest Railroad: 4,667' southwest
 Property Line: 228' north Well Window: SHL is 440' outside
 Existing Well: lone #5, 773' southeast

- Notes:
- 1) Bearings and distances based on NAD 83 Colorado North State Plane Coordinates using RTK GPS observations taken 5/16/12 by operator J.R. McGehee.
 - 2) Conversion factor to ground (1.000275398).
 - 3) Elevations based on NAVD 88 GPS heights and Geoid 2003 corrections.
 - 4) See Location Drawing for visible improvements within 400 feet of pad site.
 - 5) The surface use is agricultural field.

NOTICE: According to Colorado law you must commence any legal action based upon any defect in this W.L.C. within three years after you first discover such defect. In no event may any action based upon any defect in this W.L.C. be commenced more than ten years from this said date of the certification shown hereon.

I hereby certify that this Well Location Certificate was prepared by me or under my direct supervision on 5/17/2012 for and on behalf of EnCana Oil & Gas (USA) Inc. That it is not a Land Survey Plat or an Improvement Survey Plat and that it is not to be relied upon for establishment of fences, buildings, or other future improvement lines.

5-17-2012
 PROFESSIONAL LAND SURVEYOR
 John Robert McGehee, LS#38219
 Well: lone 1B-8H WLC