



**State
of
Colorado**



02121759

045-21615

Krabacher, Jay <jay.krabacher@state.co.us>

CBL Deferment Request for Shideler Fee 31-9B

Reynolds, Scott D. <Scott.Reynolds@encana.com>

To: "Krabacher, Jay (Jay.Krabacher@state.co.us)" <Jay.Krabacher@state.co.us>

Cc: "King, Kevin" <Kevin.King@state.co.us>, "Andrews, David" <David.Andrews@state.co.us>

Tue, Oct 23, 2012 at 4:06 PM

RECEIVED

OCT 23 2012

COGCC/Rifle Office

EnCana CBL Deferment Request


Well Name:	Shideler Fee 31-9B
API Number:	05-045-21615-00
Pad Name:	K31E
Casing Size	4-1/2" 11.6# S80 BTC
Casing Setting Depth	8,509' MD-RKB
Plug Bump Date:	10-18-2012
Plug Bump Time:	06:45 hours
Top of MV:	4749' MD-RKB
Top of Gas:	6489' MD-RKB
Designed TOC:	4049' MD-RKB
Temp Log TOC:	4070' MD-RKB

Bradenhead Pressure Report

Time	Bradenhead Pressure
6 hours	0
12 hours	0
24 hours	0
48 hours	0
72 hours	0

Comments:

Cemt with SLB cementers;pressure test lins to 500 psi low/5min & 4000 psi high/10min. . Pump 40 bbls of Mudpush11; Lead cmt: pump 12.0 ppg,545sks,/173.5 bbl of cmt,Yield 1.79; Tail cmt - pump 13.0 ppg; 425 sks/108.4 bbls yield 1.88. Dropped Wiper Plug Displaced w/ 131.2 bbls of fresh water. Bump plug @06:46 am on 010/18/2012 w/ 1000 psi over at 2575 psi.Held Pressure for 7 Min. Float held, had 1.0 bbl of flow back, had good returns throughtout cement job. Lost Flow . Annulus was static after bumping the plug.

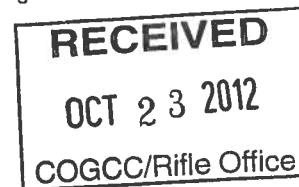

Scott Reynolds

Drilling Engineer – South Piceance

Encana Oil & Gas (USA) Inc

O: 720.876.5255

C: 303.895.0445

F: 720.876.6255

scott.reynolds@encana.com

Take a closer look: www.encana.com

Please note: Encana offices are closed the first and third Friday of each month

This email communication and any files transmitted with it may contain confidential and or proprietary information and is provided for the use of the intended recipient only. Any review, retransmission or dissemination of this information by anyone other than the intended recipient is prohibited. If you receive this email in error, please contact the sender and delete this communication and any copies immediately. Thank you.

<http://www.encana.com>

shidlerfee31-9b.pdf
9207K

Krabacher, Jay <jay.krabacher@state.co.us>
To: "Reynolds, Scott D." <Scott.Reynolds@encana.com>
Cc: "King, Kevin" <Kevin.King@state.co.us>, "Andrews, David" <David.Andrews@state.co.us>

Fri, Oct 26, 2012 at 11:40 AM

Scott:

Encana can delay the CBL on this well.
Can Weatherford also provide a "one-page" (condensed version) of the temp log?

Regards,

Jay Krabacher
[Quoted text hidden]

Jay Krabacher