



00209149

PHONE 522-1206 AREA 303

VIRG'S TESTERS, INC.

BOX 712 STERLING, COLORADO

11-7N-5300

Operator Holly Resources Corp.
Address 1038 Guaranty Bank Bldg., Denver, Colo.Well Name and No. Keller #34-11
Ticket No. 9757

Date 11-20-68

DST No. 1
No. Final Copies 5

TOOL SEQUENCE

RECEIVED

DEC - 4 1968

COLO. OIL & GAS CONS. COMM.

4519-----

4525-----

4534-----

4605-----

PRD Make Kuster AK-1
No. 1052 Cap. 3350 @ 4539
Press Field Corrected

IH	A	2516	2462
FH	G	2498	2394
PF	B	332	330
IF	D		427
FF	E	623	623
ISIP	C	1089	1086
FSIP	F	1089	1086
Pressure Below Bottom Packer Bled To			1194

Our Tester: T. J. Rittenhouse

Witnessed By: Jack D. Gray

RECOVERY IN PIPE

DID WELL FLOW - Gas Yes Oil No Water No

1 gallon of water, total recovery

Strong blow. Gas to surface in on minute. Lived off in 23 minutes at a manimum of 56 lbs. on 1 1/4" orifice, or, 2,558,000 cubic feet per pay.

REMARKS:

Corrected pressures in 5 minute increment readings on following page.

11-7N-53W

RECEIVED


DEC -4 1968

COLO. OIL & GAS CONS. COMM

T-9757

R-VT.33

BOTTOM CHART

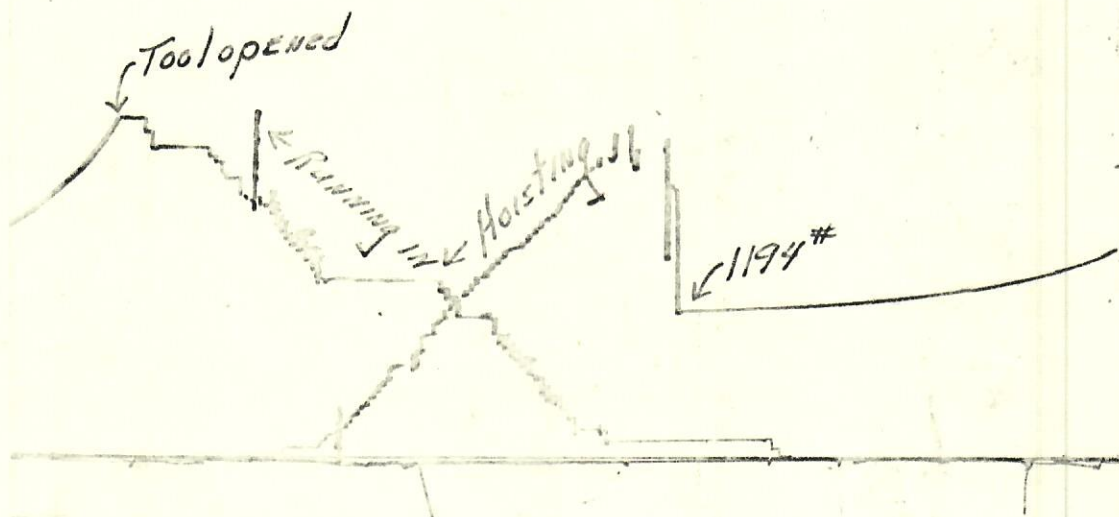

This recorder blanked off below the bottom packer and since pressure bled to only 1194 lbs., which is more than the shut-in pressure, the bottom packer held. Recorder No. VT-33

11-7N-530

RECEIVED

DEC - 4 1968

COLORADO OIL & GAS CONS. COMM.

HOLLY RESOURCES CORPORATION
Keller #34-11 DST #1 Ticker #9757

Initial Shut-in

5 mins.	1084	lbs.
10 "	1086	"
15 "	1086	"
20 "	1086	"
25 "	1086	"
30 "	1086	"

Final Shut-in

FF	623	lbs.
5 mins.	1074	"
10 "	1079	"
15 "	1082	"
20 "	1083	"
25 "	1083	"
30 "	1084	"
35 "	1084	"
40 "	1085	"
45 "	1085	"
50 "	1086	"
55 "	1086	"
60 "	1086	"