

Southern Ute FC 33-11 #1-5

Proposed P&A
Ignacio Blanco Field
1060' FSL & 1185' FWL, Section 1, T33N, R11W
La Plata County, CO, API# 05-067-09012

Today's Date: **11/16/23**
Spud: 1/8/2006
Comp: 6/7/2006
Elevation: 7172' GI
7283' KB

Directional well: 49-50 deg;
KOP @500 ft


Ojo Alamo @ 1372'
TVD

Fruitland @ 2974' TVD

Pictured Cliffs @ 3326' TVD

12-1/4" Hole

7-7/8" hole

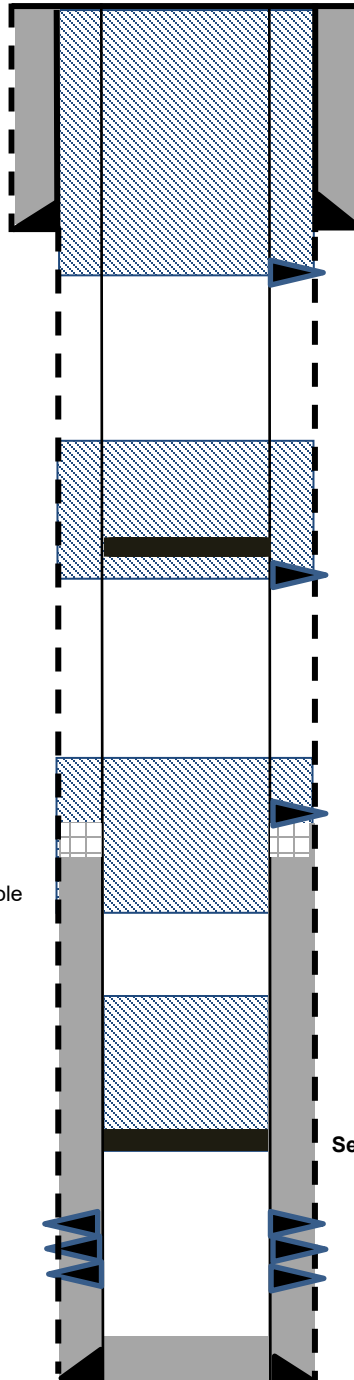

Plug #4: 468' – Surface
Class G cmt, 149 sxs
circulated out annuli

8-5/8", 24# J-55 csg set @ 418'
Cmt w/ 295 sxs Class B, circ 15 bbls
to surface

Perf @ 468'

Plug #3: 1422' – 1272'
Class G cmt, 69 sxs; 46 sxs
outside and 23 sxs inside

Set CR @ 1372'
Perforate @ 1422'

Plug #2: 3024' – 2850'
Class G cmt, 58 sxs; 31 sxs
outside and 27 sxs inside

Perforate @ 2950'
DV Tool @ 2967'
Failed to close
during cementing,
poor bond above
tool

Plug #1: 3665' – 3226'
Class G cmt, 50 sxs

Set CIBP @ 3665'

Fruitland Coal Perforations:
3715' – 4122'

5-1/2", 17# J-55 set @ 4344'
Cement with 310 sxs 65/35 Pozmix w/
100 sxs Class G, circ 12 bbls to surface,
float did not hold

PBTD 4295'
TD @ 4370'