



00054500

RECEIVED

FEB 5 1982

COLORADO OIL & GAS CONSERVATION COMMISSION

February 3, 1982

Mr. Morrell  
OIL & GAS CONSERVATION COMMISSION  
1313 Sherman Street, Room 721  
Denver, Colorado 80203

Re: Gebauer Lease

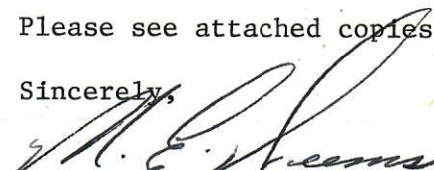
✓ Dear Mr. Morrell,

Due to the number of changes in operators regarding the Gebauer Lease and the personnel expansion in the Buckhorn/Exeter transition, some confusion evolved in regard to well identification. After a complete overhaul of our records and a field inspection, the following has been ascertained: The 1-A, 2, and 2A-28 Gebauer are all the same well.

On 4-4-80, this well had a bridge plug set at 4729' (above 'D' sand perfs), and one sack of cement was dumped on top. On 9-22-80, a Halliburton plug was set at 160' and three gallons of cement were set on top. On 9-23-80, the 4½" casing was filled from 160' to surface with 17 sacks of common cement. On 1-27-82, the 8-5/8" and 4½" casing were cut off four feet below ground level, and a steel plate was welded on top. The hole was filled in and the location cleaned.

Please see attached copies of Sundry Notices.

Sincerely,

  
Mark E. Weems, S. Div. Prod. Engr.  
BUCKHORN PET./EXETER EXPL. CO.

MEW/pr  
Attachments

xc: File

DVR	
FJP	
HHM	✓
JAM	✓
JJD	✓
RLS	
CGM	

Plugging and Abandonment Procedure (2A-28 Gebauer)

RECEIVED  
FEB 5 1982

COLORADO OIL & GAS COM. COMM.

- ~~1.~~ Dump 6 sx sand on top of wireline BP set @ 4890' and across perfs @ 4820'-4855'.
- ~~2.~~ Dump 5 sx cmt on top of the sand.
- ~~3.~~ Fill the 4½" O.D. production casing with mud-laden fluid.
- ~~4.~~ Run free point, cut, and pull the 4½" O.D. csg.
- ~~5.~~ Spot 25 sx cmt across 8-5/8" O.D. surface csg shoe (set @ 106').
- ~~6.~~ Spot a 10 sx cmt plug at the surface.
7. Cut the surface csg off 4' below G.L. and weld a lid on top.
8. Clean and restore the location.

DVR	
FJP	
HHM	
JAM	
JJD	
RLS	
CGM	