



02054531

**PETROLEUM DEVELOPMENT CORPORATION**

**State Contact:** David Andrews [david.andrews@state.co.us](mailto:david.andrews@state.co.us)

**WELL NAME** PUCKETT 21D-24D

**DATE** 09/08/2010

**API#** 05-045-16110

**LEASE#**

**PERMIT #**

**CASING AND HOLE INFORMATION**

DEPTH HOLE 2320  
CASING 9 5/8 36#, 8RD, ST&C  
DEPTH SET 2309

**Cement report**

Company : BJ

**CASING STRING:**

**LEAD:** ( 35:65 ) Type III plus additives 1494 sacks 12.5 ppg 1.95 yld 518 bbl slurry mixed @ 4.7/3.5 bbl/min


**TAIL:** TYPE III plus additives 170 sacks 14.2 ppg 1.47 yld 38.77 bbl slurry mixed @ 3.5 bbl/min

**DISPLACED** Displaced w/ 174 bbls water @6.9 Dwn To 2.44 bbl/min bumped plug w/ 1117 psi Float held no cement to surface.

**PRESSURE BEFORE BUMPING PLUG:** 181. plug bumped at 1117

**RETURN:** No Returns.

**COMENTS:** Toped Out cement= 1136 sks. Cement to surface and did not fall back.  
Type III cement with additives, 14.2# and 1.61 yield 326 bbls slurry.

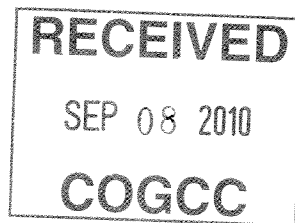

Any Questions or problems please advise

Gene Sandefer  
970-260-0587