

T5N, R62W

NW. COR.
SEC. 21, T5N, R62W
FOUND 3 1/2" ALUM. CAP
L.S. NO. 7242
LAT: 40.392389
LON: -104.337983

N 88°29'36" E 2598.77' (M)

S 88°29'14" W 2598.52' (C)


LAT: 40.392576
LON: -104.319326

50'

BOTTOM
OF HOLE

N. 1/4 COR.
SEC. 21, T5N, R62W
FOUND 3 1/2" ALUM. CAP
L.S. NO. 7242
LAT: 40.392482
LON: -104.328654

S 00°00'46" E
2645.67' (C)

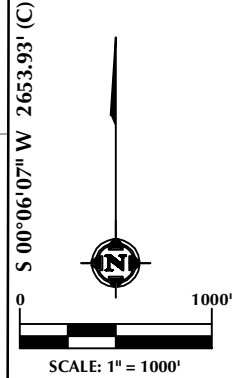

LAT: 40.385149
LON: -104.338088

N 00°07'04" W 4274' (M)

S 88°40'00" W
2593.74' (C)

21

LAT: 40.385221
LON: -104.328777

S 88°40'00" W
2593.00' (C)

SURFACE LOCATION
GROUND ELEVATION= 4640.7'
LATITUDE= 40.379316°
LONGITUDE= -104.335072°
1/4 1/4: SW1/4 SW1/4

ENTRY POINT
LATITUDE= 40.379367°
LONGITUDE= -104.337992°
1/4 1/4: SW1/4 SW1/4

BOTTOM HOLE LOCATION
LATITUDE= 40.391100°
LONGITUDE= -104.337822°
1/4 1/4: NW1/4 NW1/4

E. 1/4 COR.
SEC. 21, T5N, R62W
FOUND 3" ALUM. CAP
L.S. NO. 4845
LAT: 40.385292
LON: -104.319470

**ANTELOPE
E-A-21HNB
SURFACE POSITION**

LAT: 40.377958
LON: -104.328901

N 88°50'30" E 5177.17' (M)

SE. COR.
SEC. 21, T5N, R62W
FOUND 3" ALUM. CAP
L.S. NO. 4845
LAT: 40.378007
LON: -104.319609

SW. COR.
SEC. 21, T5N, R62W
FOUND 3 1/2" ALUM. CAP
L.S. NO. 7242
LAT: 40.377909
LON: -104.338192

ENTRY
POINT

50'

531'

507'

864'

CERTIFICATE OF SURVEYOR:

THIS IS TO CERTIFY THAT THE ABOVE PLAT WAS PREPARED FROM FIELD NOTES OF ACTUAL SURVEY MADE BY ME OR UNDER MY SUPERVISION AND THAT THE SAME ARE TRUE AND CORRECT TO THE BEST OF MY KNOWLEDGE AND BELIEF. THIS CERTIFICATE DOES NOT REPRESENT A LAND SURVEY PLAT OR IMPROVEMENT SURVEY PLAT AS DEFINED BY C.S. 38-51-102 AND CANNOT BE RELIED UPON TO DETERMINE OWNERSHIP.

Benjamin J. Reenders
BENJAMIN J. REENDERS
PROFESSIONAL LAND SURVEYOR
COLORADO REGISTRATION NUMBER 14363

NOTICE:
ACCORDING TO COLORADO STATE LAW YOU MUST COMMENCE ANY LEGAL ACTION BASED UPON ANY DEFECT IN THIS SURVEY WITHIN THREE YEARS AFTER YOU FIRST DISCOVER SUCH DEFECT. IN NO EVENT MAY ANY ACTION BASED UPON ANY DEFECT IN THIS SURVEY BE COMMENCED MORE THAN TEN YEARS FROM THE DATE ON THE CERTIFICATION SHOWN HEREON.

NEAREST CULTURAL ITEMS:

BUILDING: 5280'+
BUILDING UNIT: 5280'+
HIGH OCCUPANCY BUILDING UNIT: 5280'+
DESIGNATED OUTSIDE ACTIVITY AREA: 5280'+
PUBLIC ROAD: 5280'+
ABOVE GROUND UTILITY: ±1727' N
RAILROAD: 5280'+
PROPERTY LINE: ±507' S

NOTES:

- ▲ INDICATES SECTION CORNER
- INDICATES CALCULATED CORNER
- DRAWING LATITUDE AND LONGITUDE COORDINATES ARE NAD83 (CORS 96) (EPOCH:2002)
- ELEVATION BASED ON NAVD88 (GEOID09)
- BASIS OF BEARING DERIVED FROM COLORADO COORDINATE SYSTEM 1983 NORTH ZONE UNLESS OTHERWISE NOTED.
- ALL MEASURED DISTANCES ARE GRID.
- COMBINED SCALE FACTOR: .99974169
- OPERATOR: ROB WILSON / PDOP = 2.7
- SEE ADDENDUM TO WELL LOCATION CERTIFICATE FOR EXISTING IMPROVEMENTS WITHIN 500' OF THE WELL PAD.
- WELL FOOTAGES ARE MEASURED AT RIGHT ANGLES TO THE SECTION LINES.
- THE BOTTOM OF HOLE BEARS N00°07'04"W, 4274' FROM THE ENTRY POINT.

WELL PAD - ANTELOPE 14-21

**ANTELOPE E-A-21HNB
WELL LOCATION CERTIFICATE**
507' FSL & 864' FWL SWSW (SURFACE)
531' FSL & 50' FWL SWSW (ENTRY POINT)
470' FNL & 50' FWL NWNW (BOTTOM)
LOCATED IN SECTION 21
T5N, R62W, 6TH P.M.
WELD COUNTY, COLORADO

**BONANZA
CREEK**
410 17th Street, Suite 1400
Denver, Colorado 80202



CONSULTING, LLC

SHERIDAN OFFICE
2155 North Main Street
Sheridan, Wyoming 82801
Phone 307-674-0609

LOVELAND OFFICE
1635 Foxtrail Drive, Suite 204
Loveland, Colorado 80538
Phone 970-776-4331

DRAFTED BY: LMO	CHECKED BY: BJR	SHEET NO: 1
DATE DRAFTED: 12/10/14	DATE SURVEYED: 12/8/14	1 OF 1
REVISED:	FILE NAME: 14-108	