

SENT VIA EMAIL (robert.chesson@state.co.us)

1103 Oak Park Drive, Suite 110
Fort Collins, CO 80525
Phone (970) 377-1600
Fax (970) 377-1880
www.paragoncg.com

May 14, 2010

Mr. Robert Chesson
Colorado Oil & Gas Conservation Commission, Department of Natural Resources
1120 Lincoln Street, Suite 801
Denver, Colorado 80203

DAVID M. RAU, P.E., BCEE
SCOTT A. RUTHERFORD, P.E.
BRICK SMITH, P.E.
BRAD C. WOHLER
AMY D. WEBER, P.E.
HEATHER S. ALDERMAN
DAVID L. WALKER

RE: February 2010 Quarterly Monitoring Report
Segal Tank Battery (API Number 05-123-09053)
NW ¼ of Section 24, Township 4 North, Range 66 West
County Road 44 and County Road 35
Weld County, Colorado
Project Number 1006006

Dear Mr. Chesson:

Enclosed is the February 2010 Quarterly Monitoring Report for the above-referenced site. Please read the attached report for a summary of the groundwater-sampling activities performed at the site in February 2010. If you have any questions or require additional information, please contact us.

Sincerely,
PARAGON CONSULTING GROUP, INC.



Amy Weber, P.E.
Project Engineer



David M. Rau, P.E., BCEE
Principal Engineer

ADW/DMR:adw1

enc: February 2010 Quarterly Monitoring Report

cc: Machii-Ross Petroleum Company
Mr. Andy Peterson/Peterson Energy Management (via email)
Melvin Dinner, Esq./Melvin Dinner, P.C. via Jennifer Biever, Esq./Hogan & Hartson, LLP (via email)
Ms. Katy Evans via Andy Peterson/Peterson Energy Management

May 14, 2010

Machii-Ross Petroleum Company
2901 28th Street, Suite 205
Santa Monica, California 90405

RE: February 2010 Quarterly Monitoring Report
Segal Tank Battery (API Number 05-123-09053)
NW ¼ of Section 24, Township 4 North, Range 66 West
County Road 44 and County Road 35
Weld County, Colorado
Project Number 1006006

1103 Oak Park Drive, Suite 110
Fort Collins, CO 80525
Phone (970) 377-1600
Fax (970) 377-1880
www.paragongc.com

DAVID M. RAU, P.E., BCEE
SCOTT A. RUTHERFORD, P.E.
BRICK SMITH, P.E.
BRAD C. WOHLER
AMY D. WEBER, P.E.
HEATHER S. ALDERMAN
DAVID L. WALKER

Machii-Ross Petroleum Company:

The purpose of this report is to summarize the results of the February 2010 quarterly sampling event performed at the subject site by Paragon Consulting Group, Inc. (Paragon). A copy of this report was submitted to the Colorado Oil & Gas Conservation Commission (COGCC). The approximate location of the site is shown on Figures 1 and 2 which are attached to this letter. The approximate locations of the groundwater monitoring wells located at the site are shown on Figures 3 and 4 which are also attached to this report.

1. BACKGROUND

Previous site assessment activities are discussed below. The soil and groundwater analytical results in this chapter are compared to the former COGCC Allowable Concentrations in effective prior to April 1, 2009. Series 900 of the COGCC Rules and Regulations were revised and issued on April 1, 2009. Table 910-1 in Series 900 describes Concentration Levels for contaminants in soil and groundwater which are different than the Allowable Concentrations. For work performed after April 1, 2009, contaminant levels are compared to the COGCC Concentration Levels.

Six (6) soil borings, TB-1 through TB-6, were completed at the site in December 2005 by A. G. Wassenaar, Inc. Borings TB-1 through TB-6 were completed as monitoring wells. Soil samples were analyzed from soil borings TB-2 and TB-6 for total recoverable petroleum hydrocarbon (TRPH) analysis. TRPH concentrations were reported at 3,200 milligrams per kilogram (mg/Kg) and 540 mg/Kg in soil samples analyzed from TB-2 and TB-6, respectively. The TRPH concentration observed in the soil sample analyzed from TB-2 exceeded the Allowable Concentration. The TRPH concentration observed in the soil sample analyzed from TB-6 was not observed above the Allowable Concentration. Groundwater samples were collected from monitoring wells TB-1, TB-2, TB-3 and TB-5 on December 23, 2005 for benzene-toluene-ethylbenzene-xylenes (BTEX) analyses. Monitoring wells TB-4 and TB-6 were reportedly observed to dry on December 23, 2005. The benzene

concentrations observed in groundwater samples collected from TB-1, TB-2, TB-3 and TB-5 and the ethylbenzene and xylenes concentrations observed in the groundwater samples collected from TB-2 and TB-5 on December 23, 2005 exceeded the Allowable Concentrations. Remaining BTEX concentrations observed in groundwater samples collected from the site in December 2005 were not observed above the Allowable Concentrations.

In February 2007, three (3) monitoring wells and seven (7) direct-push probes were completed at the site by Paragon Consulting Group, Inc. to obtain information regarding potential petroleum hydrocarbon contamination. An additional monitoring well was installed at the site in April 2007. The TRPH concentration observed in the soil sample analyzed from DP-1 exceeded the Allowable Concentration of 1,000 mg/Kg. The TRPH concentrations observed in soil samples analyzed from PMW-1 through PMW-4 and DP-2 through DP-7 were not observed above the Allowable Concentration. In April 2007, the benzene concentrations observed in the groundwater samples collected from TB-1 through TB-6 and the ethylbenzene and xylenes concentrations observed in the groundwater sample collected from TB-6 exceeded the Allowable Concentrations. Remaining BTEX concentrations observed in groundwater samples collected from TB-1 through TB-6 and PMW-1 through PMW-4 on April 9, 2007 were not observed above the Allowable Concentrations.

In February 2008, two (2) monitoring wells were completed at the site by Paragon to obtain information regarding potential petroleum hydrocarbon contamination. Monitoring wells PMW-5 and PMW-6 were installed at the site on February 21, 2008 to depths ranging from approximately 20 to 22 feet below ground surface. The TRPH concentrations were not observed above the laboratory detection limit of 5.0 mg/Kg in the soil samples analyzed from PMW-5 and PMW-6. The TRPH concentrations observed in soil samples analyzed from PMW-5 and PMW-6 were not observed above the Allowable Concentration of 1,000 mg/Kg. The benzene concentrations observed in the groundwater samples collected from TB-1, TB-2, TB-3, TB-4 and through TB-6 on March 28, 2008 exceeded the Allowable Concentrations. Remaining BTEX concentrations observed in groundwater samples collected from TB-1 through TB-6 and PMW-1 through PMW-6 on March 28, 2008 were not observed above the Allowable Concentrations.

Soil excavation activities were performed near the water vault and near the ASTs in March 2009 and were summarized in the May 4, 2009 Soil Abatement Report. Approximately 684 cubic yards of contaminated soil were excavated and transported to Buffalo Ridge Landfill for disposal. The soil was transported by Bellio Trucking to Waste Management's Buffalo Ridge Landfill in Keenesburg, Colorado. Approximately 120 barrels (5,040 gallons) of groundwater were removed from the water-vault excavation and disposed of at a COGCC-

approved disposal well operated by Conquest Disposal Service. Monitoring well TB-6 was destroyed during excavation activities. The TRPH concentration observed in soil sample AST Lead Pipe collected from the excavation at the outlet of the pipe from the ASTs exceeded the Allowable Concentration. The excavation area could not be safely increased due to the close proximity of a flow line. The TRPH concentrations observed in the remaining soil samples collected from the water-vault excavation were not observed above the Allowable Concentration.

In September 2009, two (2) pilot test wells, SVE-1 and SP-1, were completed at the site by Paragon to obtain information regarding potential petroleum hydrocarbon contamination and for future pilot testing activities. The BTEX, TVPH and TEPH concentrations were not observed above their respective laboratory detection limits in the soil samples analyzed from SVE-1 and SP-1. The BTEX, total volatile petroleum hydrocarbons (TVPH) and total extractable petroleum hydrocarbons (TEPH) concentrations observed in soil samples analyzed from SVE-1 and SP-1 were not observed above the COGCC Concentration Levels.

2. GEOHYDROLOGY

Groundwater elevations in wells TB-1 through TB-5 and PMW-1 through PMW-6 were measured by Paragon on February 3, 2010. Monitoring well TB-6 was destroyed during excavation activities in March 2009. Groundwater elevation data for the site is summarized in Table 1 which is attached to this report. Groundwater was observed in wells TB-1 through TB-5 and PMW-1 through PMW-6 to range from approximately 5.6 to 10.7 feet below the top of casings on February 3, 2010. Free-phase product was not observed in monitoring wells TB-1 through TB-5 and PMW-1 through PMW-6 on February 3, 2010.

A piezometric surface diagram for groundwater elevations observed during the February 2010 sampling event is attached to this report as Figure 3. The piezometric surface was estimated using the Surfer[®] software distributed by Golden Software based on groundwater table measurements in wells TB-1 through TB-5 and PMW-1 through PMW-6. As seen from Figure 3, the general groundwater flow direction appeared to be towards the north-northeast on February 3, 2010. The hydraulic gradient observed at the site on February 3, 2010 was estimated to range from approximately 0.002 to 0.004. The groundwater flow direction observed in February 2010 appears to be slightly different from previous observations. Historically, the groundwater flow direction has been observed towards the north or northwest. It should be noted that local geohydrologic characteristics may change due to variations in precipitation, recharge, stratigraphy or conditions not apparent at the time of

sampling. The waterway to the north of the site may be affecting the groundwater flow direction.

3. GROUNDWATER QUALITY RESULTS

Information collected during the February 2010 sampling event relative to groundwater quality at the site is summarized below. That information includes temperature, electrical conductance and pH measurements, dissolved oxygen (DO) measurements, and laboratory results.

3.1 Field Data

Groundwater temperature, electrical conductance and pH measurements were performed on February 3, 2010 during purging of wells TB-1 through TB-5 and PMW-1 through PMW-6 prior to collecting groundwater samples for laboratory analysis. Purging of monitoring wells prior to sampling was accomplished using clean disposable bailers. Measurements were recorded during the removal of water from the wells. The wells were considered purged when temperature, electrical conductance, and pH measurements stabilized to within ten (10) percent for three (3) consecutive measurements and a minimum of three (3) well volumes were removed from the well or after the well was purged essentially dry. The wells were allowed to recharge prior to sampling.

DO measurements were performed in wells TB-1 through TB-5 and PMW-1 through PMW-6 on February 3, 2010. DO monitoring results are summarized in Table 2 attached to this letter. As seen from Table 2, DO concentrations were observed to range from approximately 0.3 to 1.3 milligrams per liter (mg/L) during the February 2010 sampling episode. In general, DO measurements appeared to be relatively lower in groundwater samples exhibiting relatively higher BTEX concentrations in February 2010.

3.2 Groundwater Analytical Results

Groundwater samples collected from monitoring wells TB-1 through TB-5 and PMW-1 through PMW-6 on February 3, 2010 were transported under standard chain-of-custody procedures to Technology Laboratory, Inc. (TLI) in Fort Collins, Colorado for BTEX analysis by EPA Method 8260B. Groundwater sample results are summarized in Table 2 attached to this letter. The approximate locations of TB-1 through TB-5 and PMW-1 through PMW-6 are shown on Figure 4 attached to this letter. The TLI laboratory report is also attached to this letter. Benzene concentrations were observed in the groundwater samples collected from TB-2, TB-3 and TB-4 on February 3, 2010. Xylenes concentrations were also observed in the groundwater samples collected from TB-2 and TB-4 in February 2010.

BTEX concentrations were not observed above the laboratory detection limit of 1.0 micrograms per liter ($\mu\text{g/L}$) in the groundwater samples collected from TB-1, TB-5 and PMW-1 through PMW-6 on February 3, 2010.

In general, the BTEX concentrations observed in the groundwater samples collected from TB-1 and TB-5 in February 2010 decreased compared to previous sample results. The benzene and xylenes concentrations observed in the groundwater sample collected from TB-2 in February 2010 increased compared to previous results. The toluene and ethylbenzene concentrations in that sample remained similar to previous results. The benzene concentration observed in the groundwater sample collected from TB-3 in February 2010 decreased compared to previous sample results while the ethylbenzene and xylenes concentrations in that sample increased. BTEX concentrations observed in the groundwater samples collected from PMW-1 through PMW-6 in February 2010 remained similar to previous sample results.

As seen from Table 2, the benzene concentrations observed in the groundwater samples collected from TB-2, TB-3 and TB-4 on February 3, 2010 exceeded the COGCC Concentration Level. The xylenes concentrations observed in the groundwater samples collected from TB-2 and TB-4 on February 3, 2010 exceeded the COGCC Concentration Level. BTEX concentrations observed in the groundwater samples collected from TB-1, TB-5 and PMW-1 through PMW-6 on February 3, 2010 were not observed above the COGCC Concentration Levels.

4. CONCLUSIONS AND RECOMMENDATIONS

The following conclusions are made based on information obtained during the quarterly sampling event.

1. Groundwater was observed in wells TB-1 through TB-5 and PMW-1 through PMW-6 to range from approximately 5.6 to 10.7 feet below the top of casings on February 3, 2010. Free-phase product was not observed in monitoring wells TB-1 through TB-5 and PMW-1 through PMW-6 on February 3, 2010.
2. The general groundwater flow direction appeared to be towards the north-northeast on February 3, 2010. The hydraulic gradient observed at the site on February 3, 2010 was estimated to range from approximately 0.002 to 0.004. The groundwater flow direction observed in February 2010 appears to be slightly different from previous observations. Historically, the groundwater flow direction has been observed towards

the north or northwest. It should be noted that local geohydrologic characteristics may change due to variations in precipitation, recharge, stratigraphy or conditions not apparent at the time of sampling. The waterway to the north of the site may be affecting the groundwater flow direction.

3. DO concentrations were observed to range from approximately 0.3 to 1.3 mg/L during the February 2010 sampling episode. In general, DO measurements appeared to be relatively lower in groundwater samples exhibiting relatively higher BTEX concentrations in February 2010.
4. The benzene concentrations observed in the groundwater samples collected from TB-2, TB-3 and TB-4 on February 3, 2010 exceeded the COGCC Concentration Level. The xylenes concentrations observed in the groundwater samples collected from TB-2 and TB-4 on February 3, 2010 exceeded the COGCC Concentration Level. BTEX concentrations observed in the groundwater samples collected from TB-1, TB-5 and PMW-1 through PMW-6 on February 3, 2010 were not observed above the COGCC Concentration Levels.
5. The extent of groundwater contamination observed in groundwater samples collected from the site in February 2010 appears to be bracketed.

The following recommendations are made based on information obtained during the quarterly sampling event.

1. The groundwater monitoring wells should be sampled on a quarterly basis.
2. Various remedial options are being considered and we will implement remedial actions once a method has been decided upon.

5. GENERAL COMMENTS

The analyses and opinions expressed in this report are based on data obtained from the indicated locations along with other information described in the report. The report does not reflect any variations in subsurface geohydrology or contaminant distribution which may occur between sample locations and or across the site. Actual subsurface conditions may vary and may not become evident without further exploration. Due to the dynamic nature of groundwater flow and contaminant migration, subsurface conditions will vary with time.

This report was prepared for the exclusive use of Machii-Ross Petroleum Company for specific application to the subject property and has been prepared in accordance with generally accepted geo-environmental engineering practices. No warranties, either express or implied, are intended or made. In the event that changes in the nature or location of suspected sources of contamination as outlined in this report are observed, the conclusions and recommendations contained in this report shall not be valid unless these changes are reviewed and the opinions of this report are modified and verified in writing by Paragon.

If you have questions or require additional information regarding this site, please do not hesitate to contact us.

Sincerely,
PARAGON CONSULTING GROUP, INC.



Amy D. Weber, P.E.
Colorado No. 37665



David M. Rau, P.E., BCEE
Principal Engineer

ADW/DMR:adw1

enc: Figure 1 - General Location Diagram
Figure 2 - Vicinity Map
Figure 3 - Piezometric Surface Diagram
Figure 4 - Groundwater Sample Results Diagram
Table 1 - Summary of Groundwater Elevation Data
Table 2 - Summary of Water Quality Results
Laboratory Report

cc: Mr. Robert Chesson/Colorado Oil and Gas Conservation Commission (via email)
Mr. Andy Peterson/Peterson Energy Management (via email)
Melvin Dinner, Esq./Melvin Dinner, P.C. via Jennifer Biever, Esq./Hogan & Hartson,
LLP (via email)
Ms. Katy Evans via Mr. Andy Peterson/Peterson Energy Management

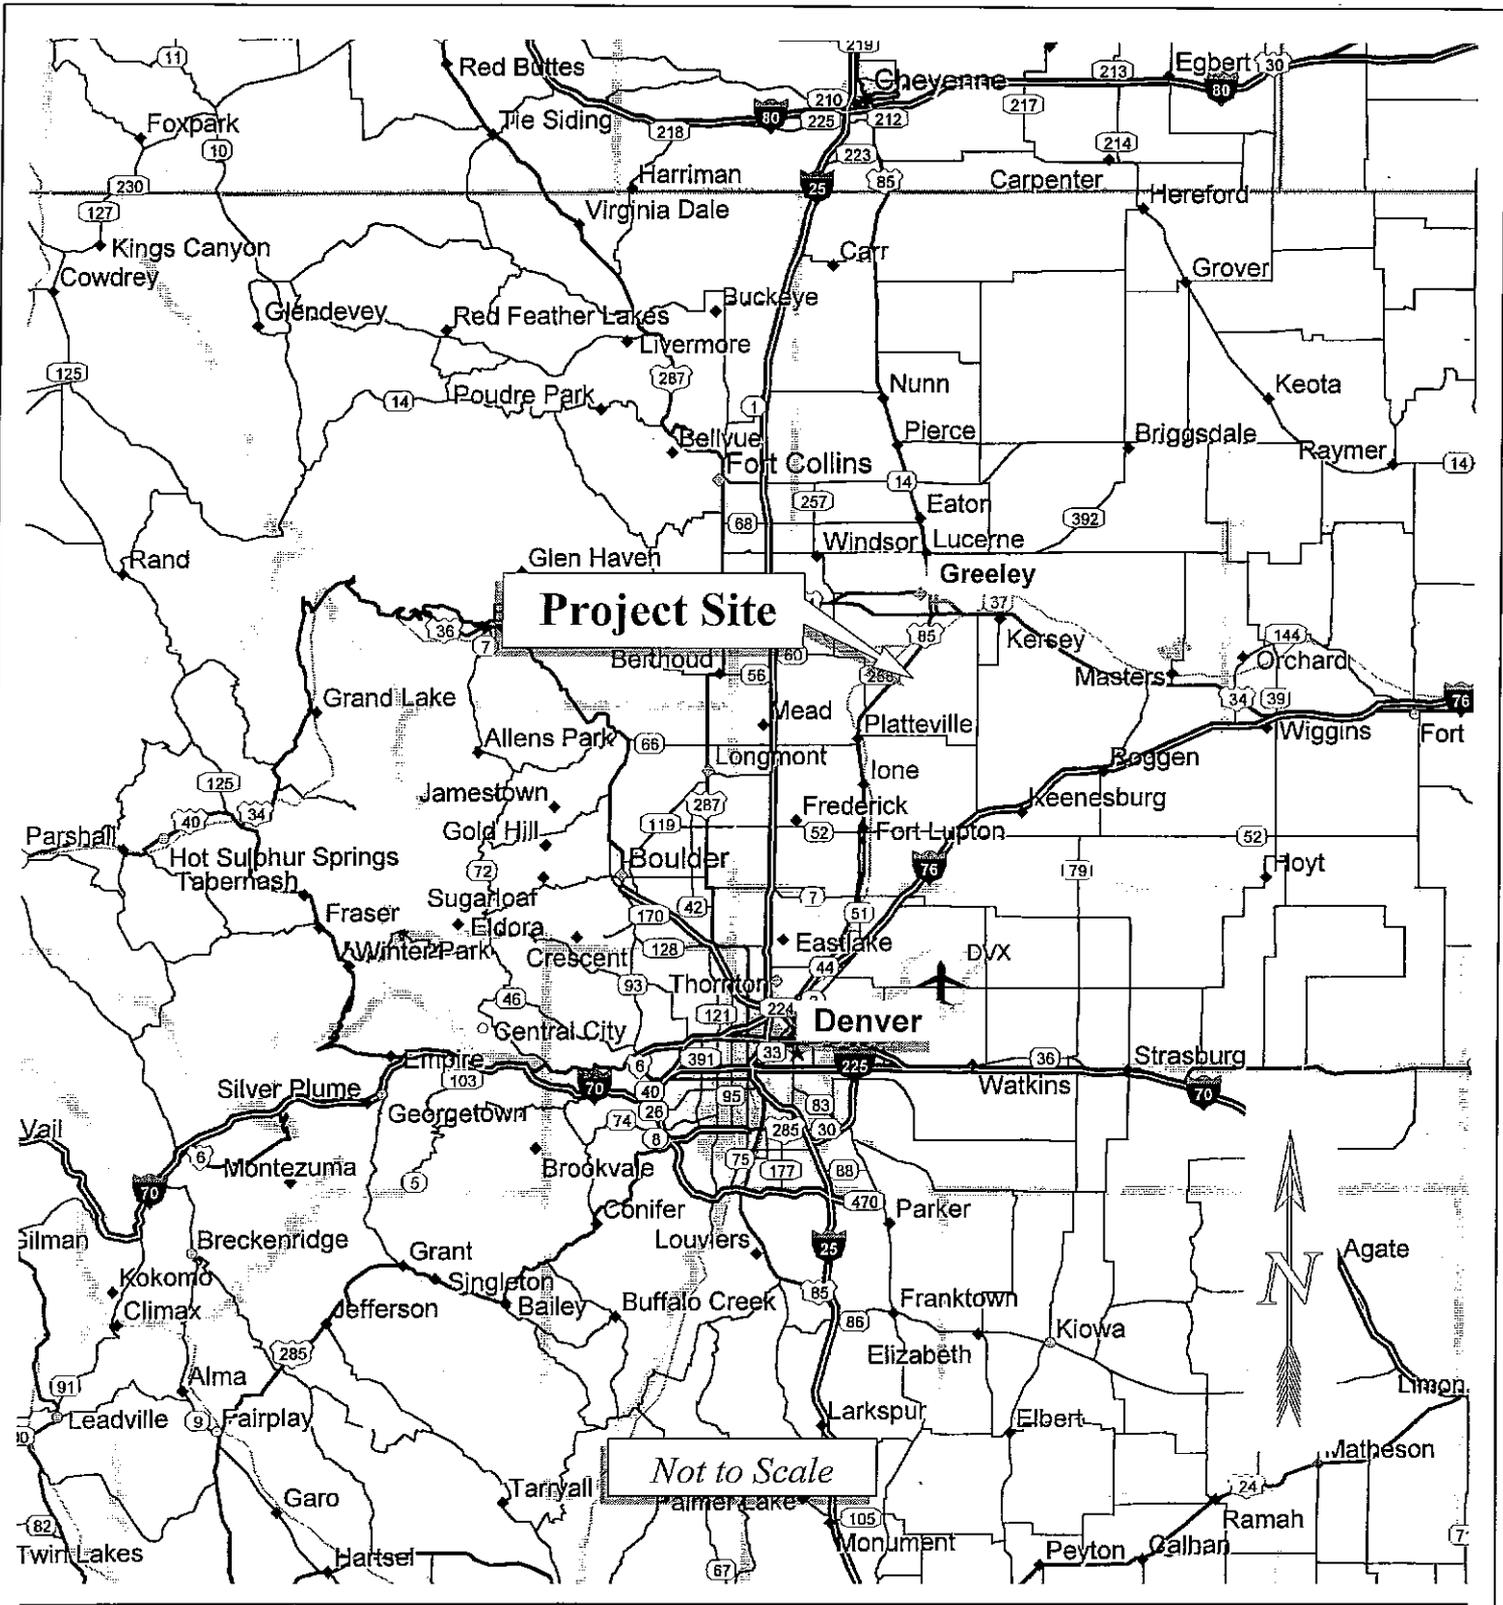


Figure 1 General Location Map
 Segal Tank Battery
 County Road 44, Weld County, Colorado
 Project No. 1006006 June 2007 Drawn by PIH(06fig1)

PARAGON



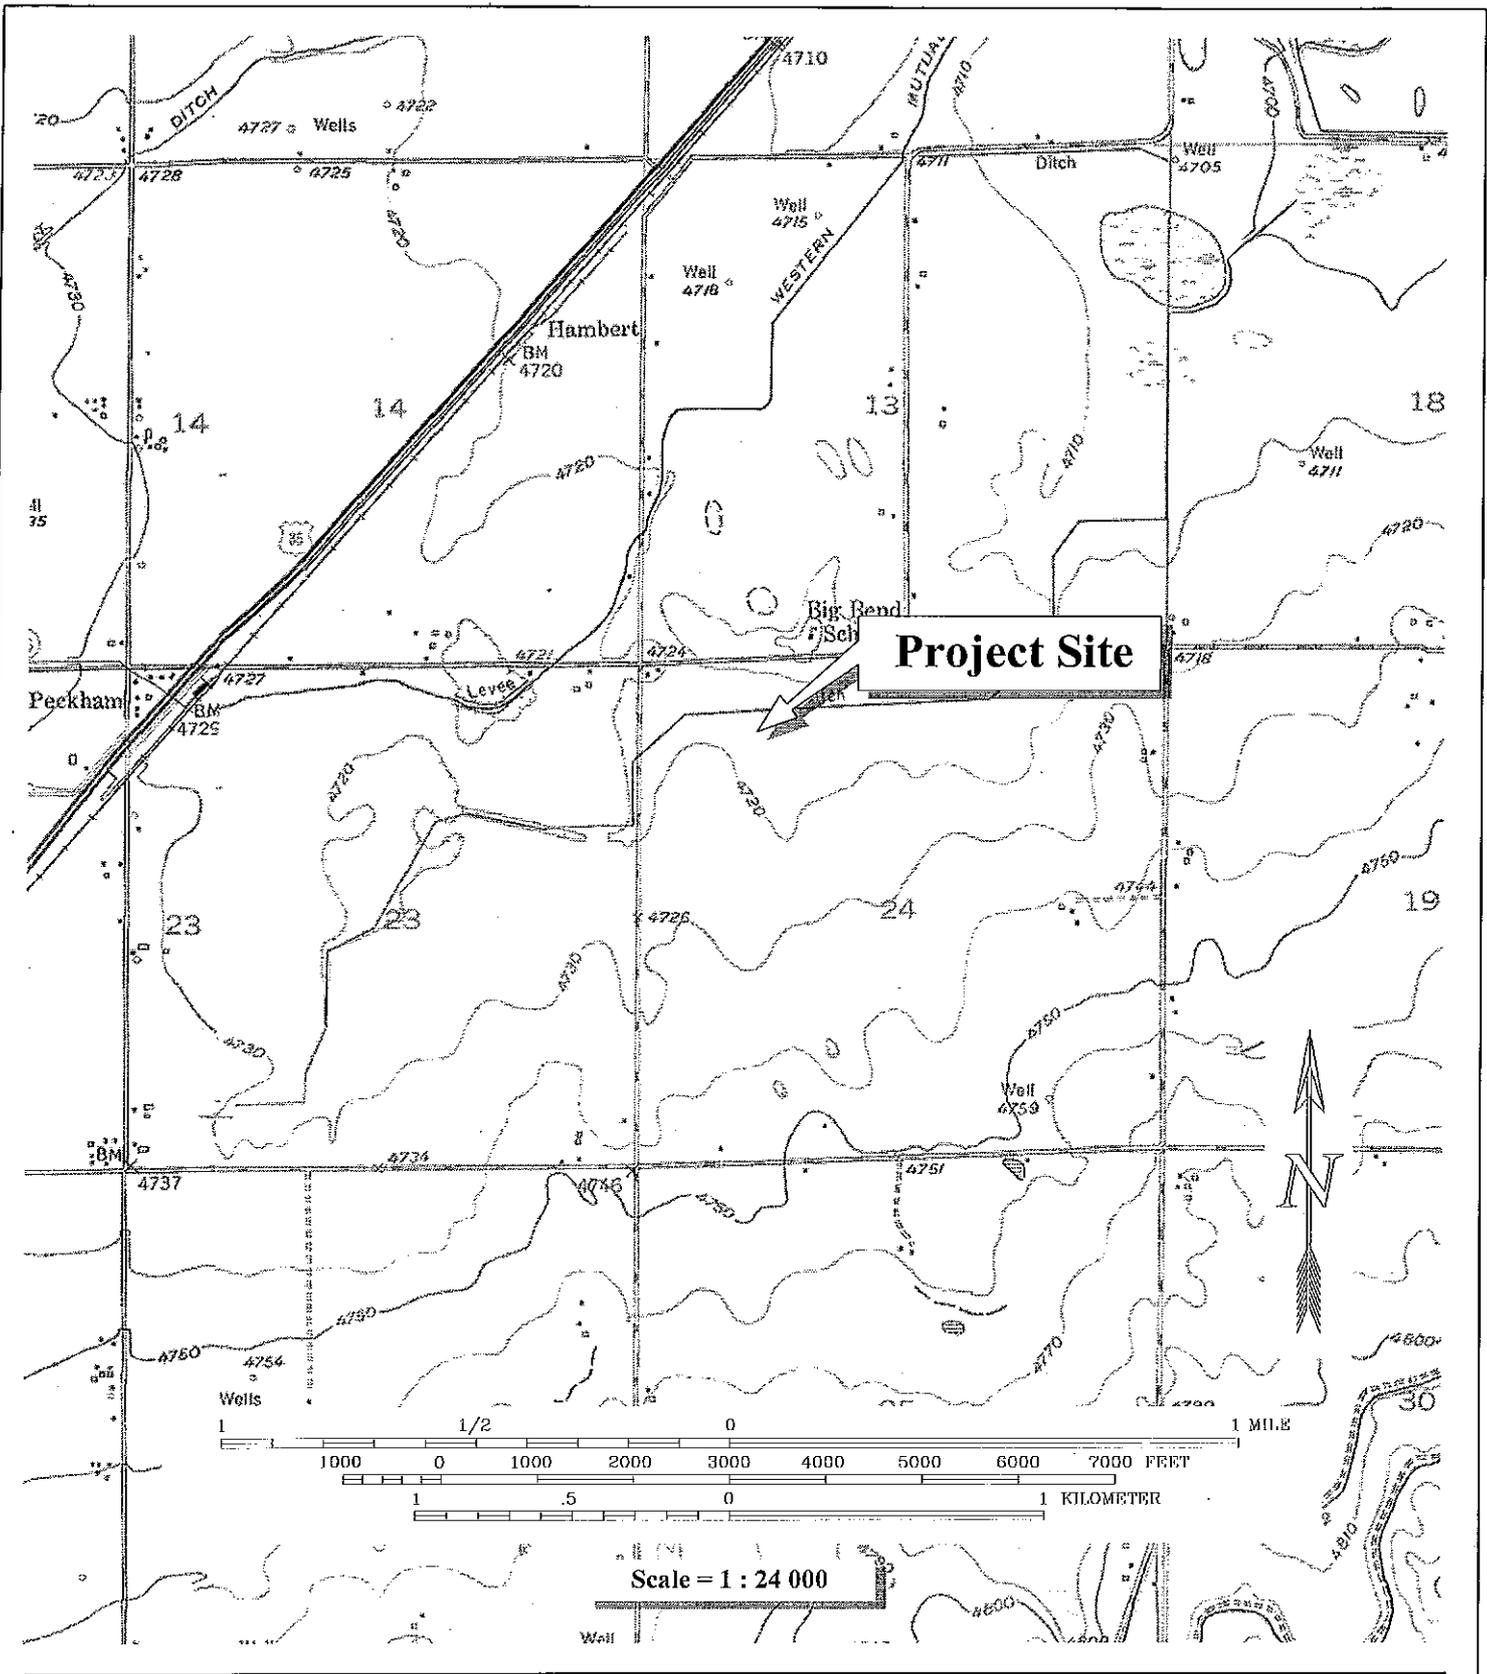


Figure 2 Vicinity Map
 Segal Tank Battery
 County Road 44, Weld County, Colorado
 Project No. 1006006 June 2007 Drawn by PJH(06fig2)

PARAGON

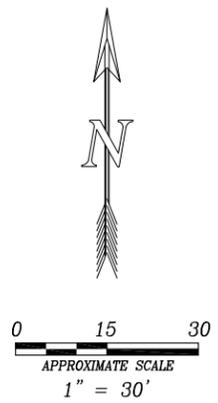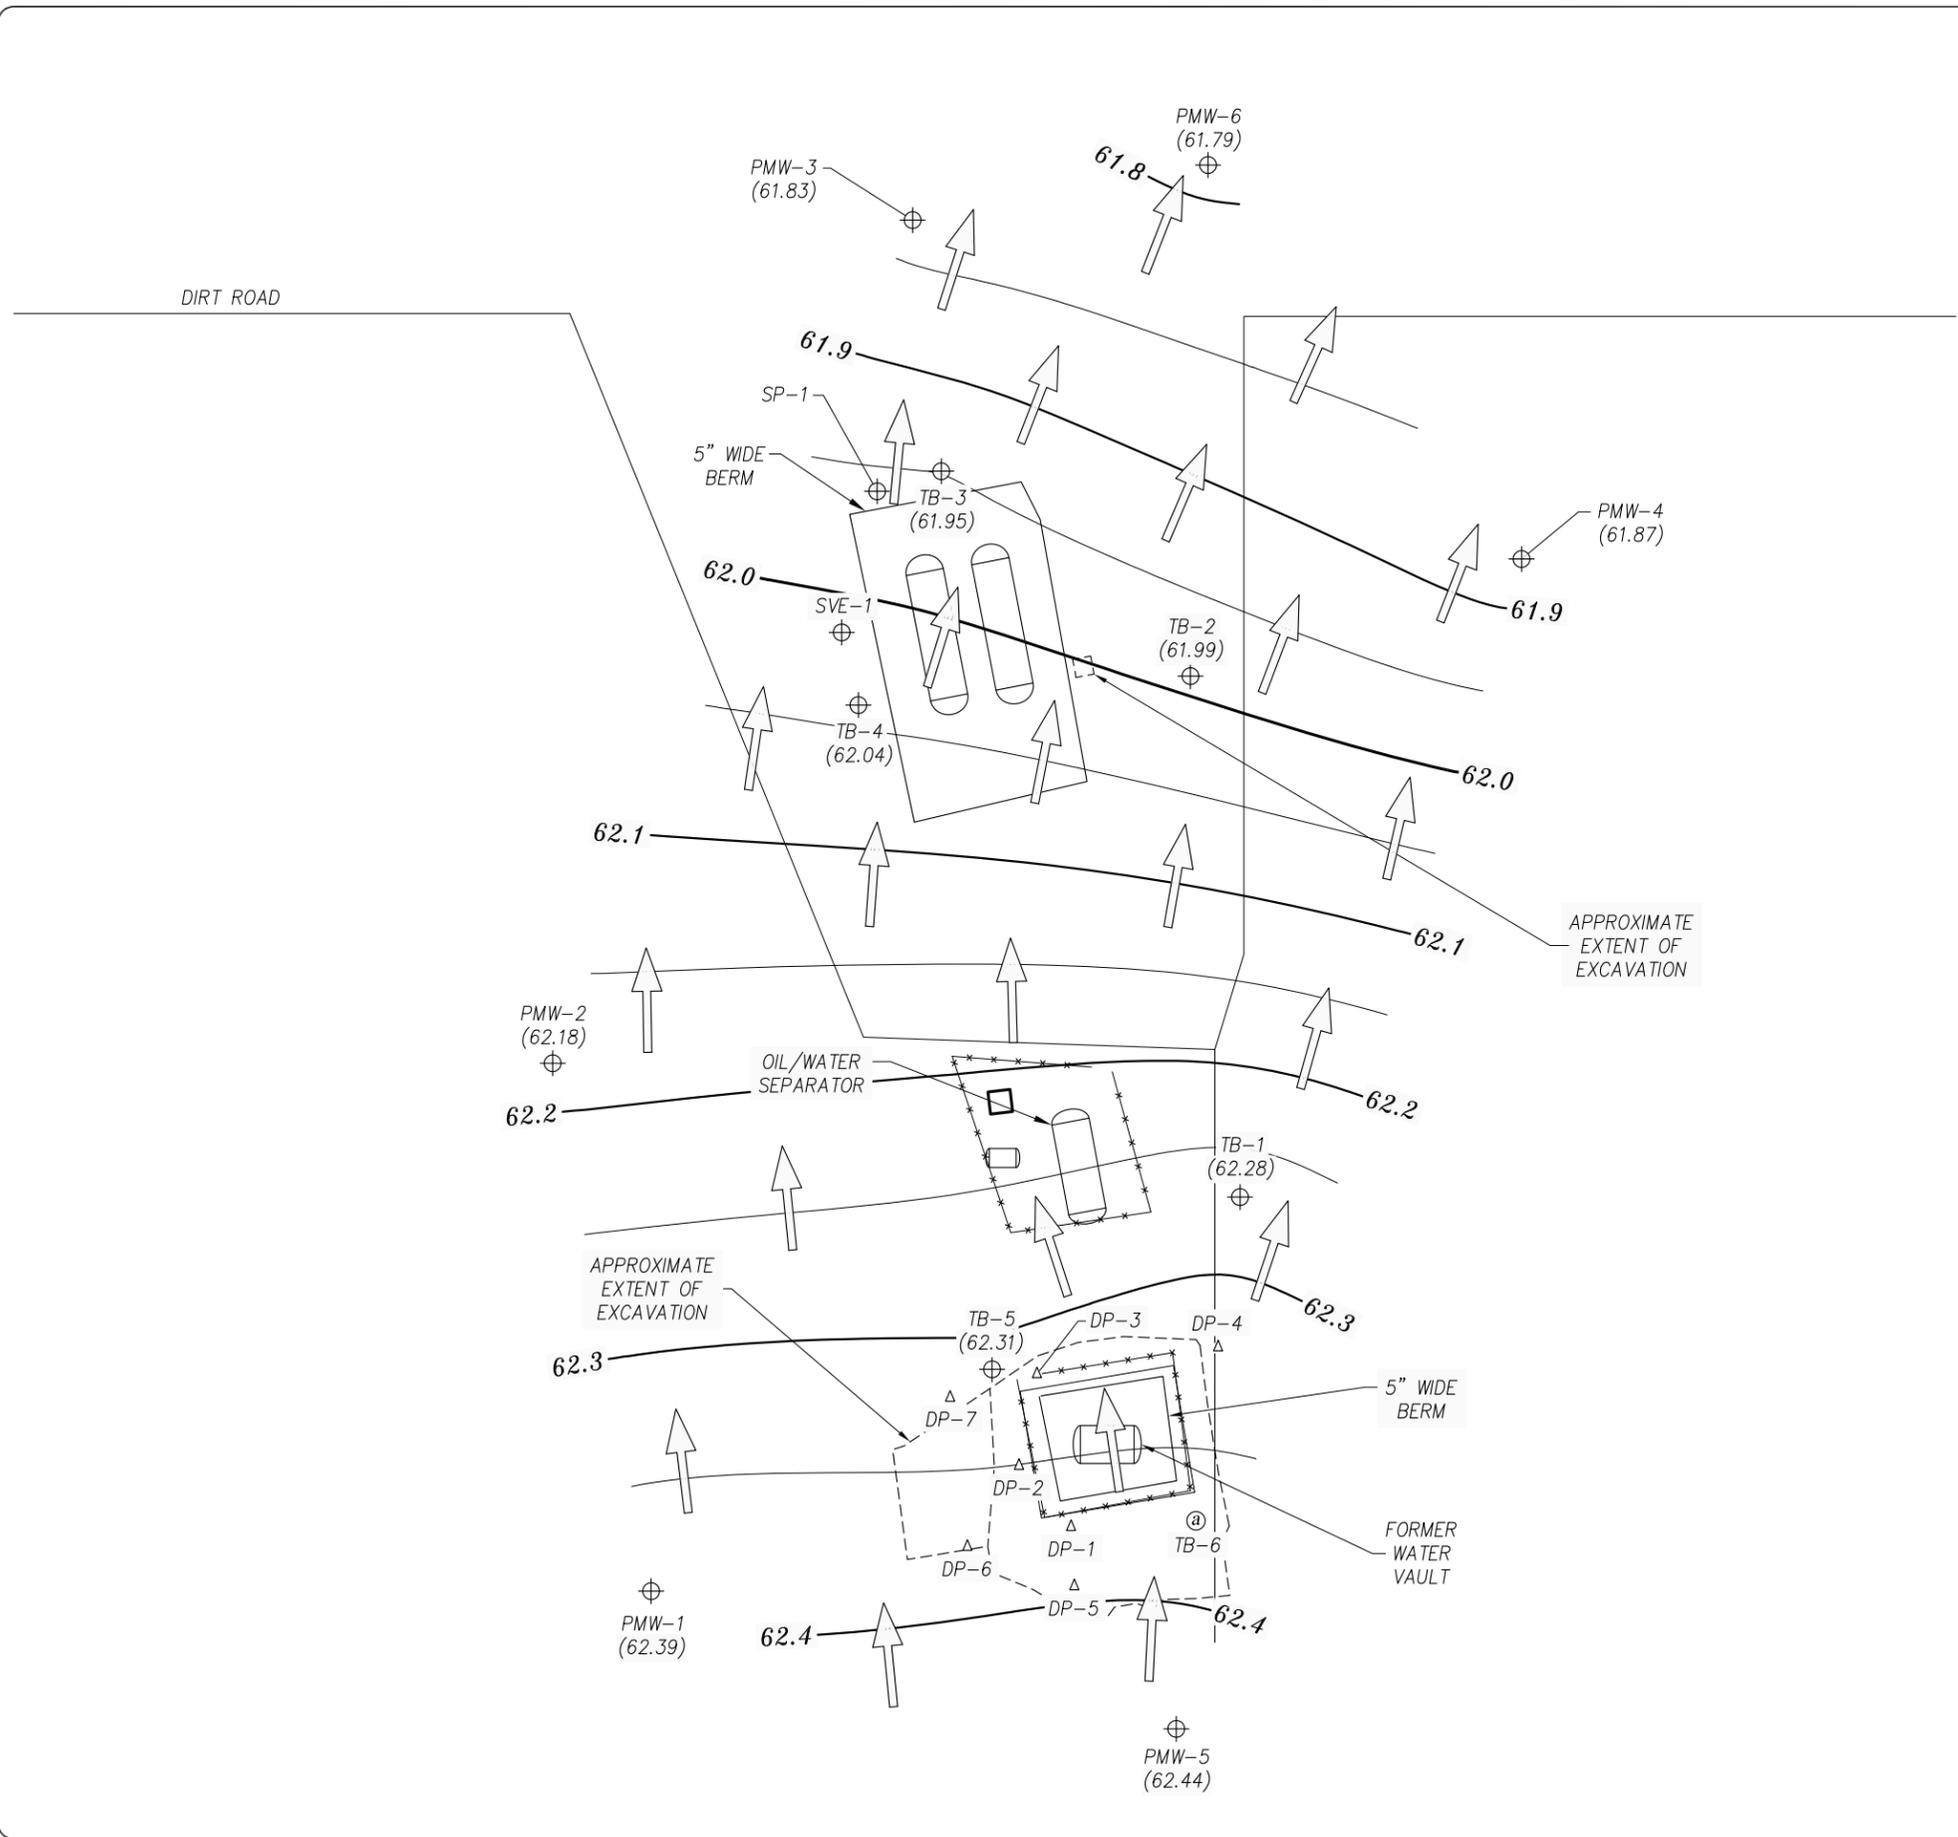



Legend

- ⊕ APPROXIMATE LOCATION OF ABANDONED/DESTROYED MONITORING WELL
- ⊕ APPROXIMATE LOCATION OF MONITORING WELL
- △ APPROXIMATE LOCATION DIRECT-PUSH BORING
- ← ESTIMATED DIRECTION OF GROUNDWATER FLOW
- 64.4— ESTIMATED GROUNDWATER ELEVATION IN FEET ABOVE A COMMON DATUM

NOTE: GROUNDWATER CONTOURS WERE ESTIMATED USING THE "SURFER" PROGRAM FROM GOLDEN SOFTWARE BASED ON DATA COLLECTED FROM WELLS PMW-1, PMW-2, PMW-3, PMW-4, PMW-5, PMW-6, TB-1, TB-2, TB-3, TB-4, AND TB-5 ON FEBRUARY 3, 2010. ACTUAL CONDITIONS MAY VARY.

Figure 3
Piezometric Surface Diagram
Segal Tank Battery
County Road 44
Weld County, Colorado

Project Mngr: ADW	<div style="font-size: 2em; font-weight: bold; margin-bottom: 10px;">PARAGON</div> <div style="font-weight: bold; margin-bottom: 5px;">Consulting Group</div> <div style="font-size: 0.8em;">Environmental Engineering and Geohydrology 1103 Oak Park Drive #110 Fort Collins, Colorado 80525</div>	Project No: 1006006
Designed by:		Scale: As Shown
Drawn by: PJH		File No: 06feb10
Checked by: ADW		Date: Mar 2010
Approved by: DMR		Sheet No:

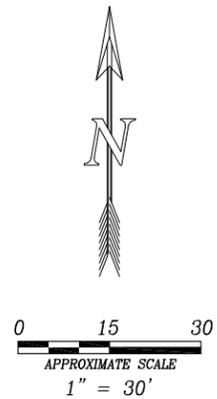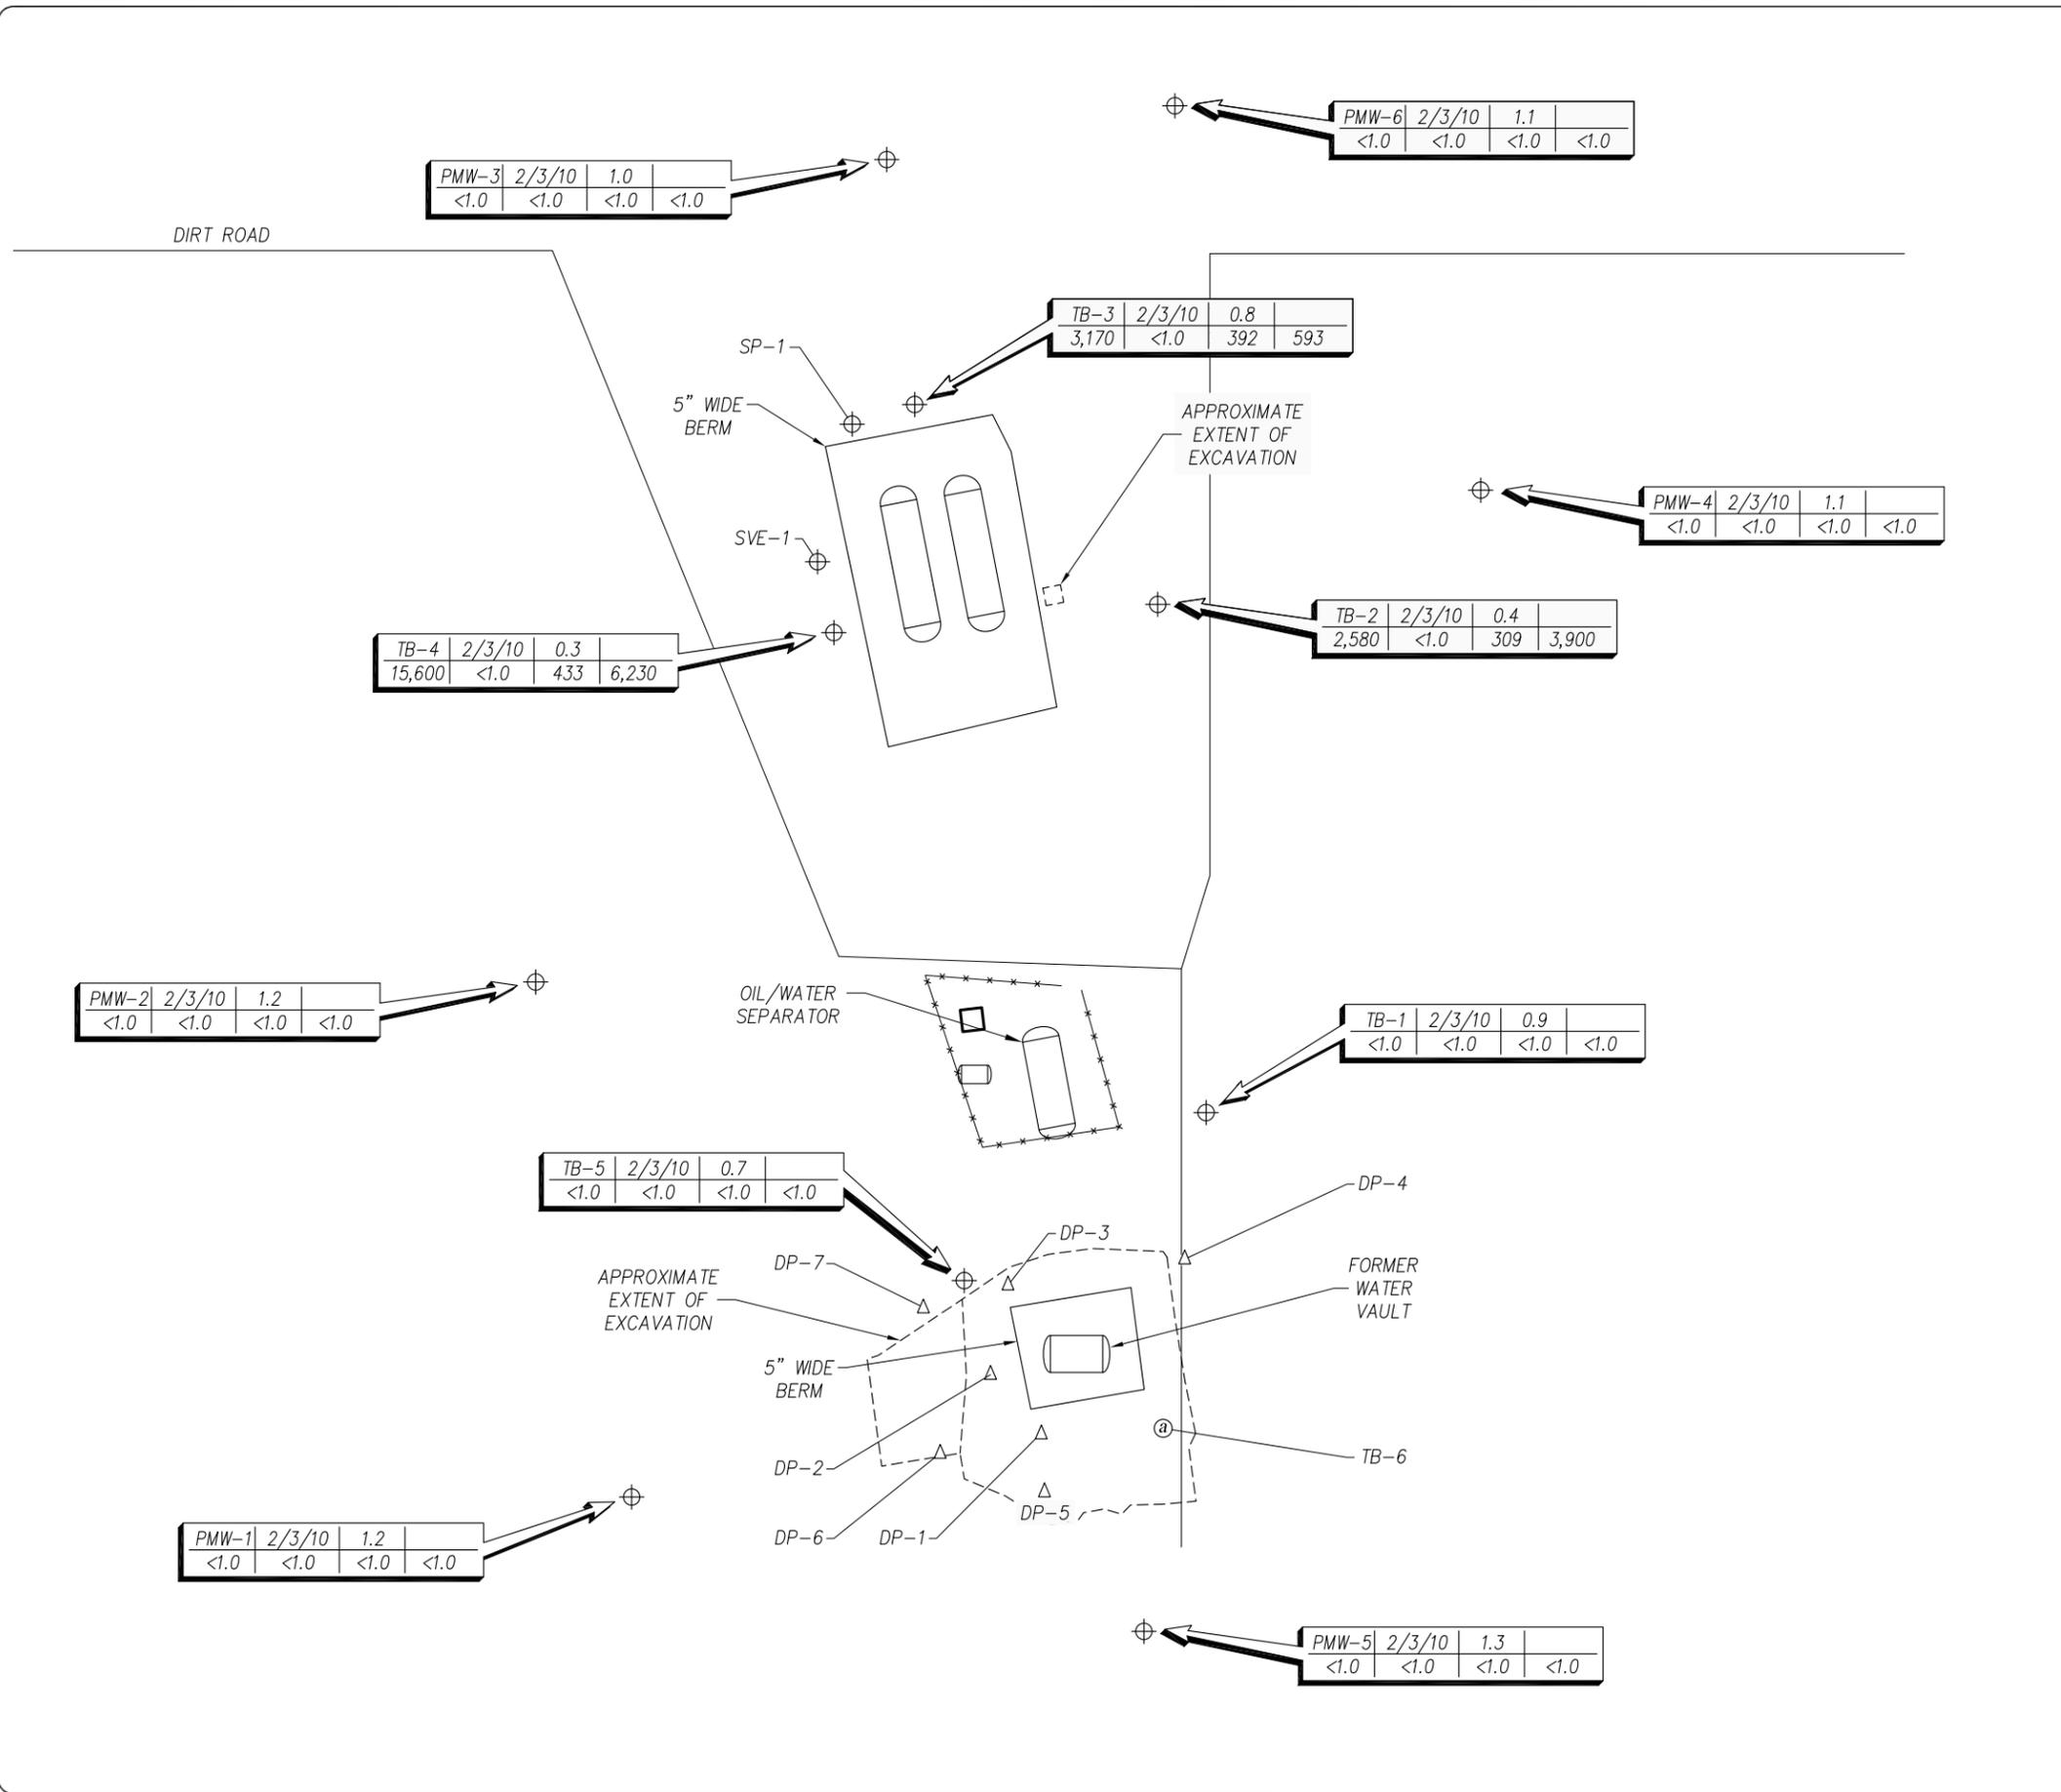

Legend

- ⊙ APPROXIMATE LOCATION OF ABANDONED/ DESTROYED MONITORING WELL
- ⊕ APPROXIMATE LOCATION OF MONITORING WELL
- △ APPROXIMATE LOCATION DIRECT-PUSH BORING

SAMPLE			
NAME	DATE	DO	
B	T	E	X

WHERE:

- B = BENZENE CONCENTRATION IN $\mu\text{g/L}$.
- T = TOLUENE CONCENTRATION IN $\mu\text{g/L}$.
- E = ETHYLBENZENE CONCENTRATION IN $\mu\text{g/L}$.
- X = TOTAL XYLENES CONCENTRATION IN $\mu\text{g/L}$.
- DO = DISSOLVED OXYGEN CONCENTRATION IN mg/L .
- NM = NOT MEASURED.

Figure 4

Groundwater Quality Results Diagram

Segal Tank Battery

County Road 44

Weld County, Colorado

Project Mngr: ADW	PARAGON Consulting Group Environmental Engineering and Geohydrology 1103 Oak Park Drive #110 Fort Collins, Colorado 80525	Project No: 1006006
Designed by:		Scale: As Shown
Drawn by: PJH		File No: 06w0210
Checked by: ADW		Date: Mar 2010
Approved by: DMR		Sheet No:

TABLE 1
SUMMARY OF GROUNDWATER ELEVATION DATA

(Page 1 of 2)

PROJECT NAME: Segal Tank Battery

PROJECT LOCATION: NW 1/4 Section 24, T 4 N, R 66 W, Weld County, Colorado

PROJECT NUMBER: 1006006

Well Name	TB-1	TB-2	TB-3	TB-4	TB-5	TB-6	PMW-1	PMW-2	PMW-3	PMW-4	PMW-5	PMW-6
Casing Elevation (feet)	68.34	67.62	67.92	68.09	68.44	68.59	71.66	71.37	71.11	71.05	73.18	71.34
<u>Date Measured: May 11, 2006</u>												
Depth to Water (feet)	DRY	DRY	DRY	DRY	DRY	DRY	NI	NI	NI	NI	NI	NI
Groundwater Elevation (feet)	DRY	DRY	DRY	DRY	DRY	DRY	NI	NI	NI	NI	NI	NI
<u>Date Measured: July 7, 2006</u>												
Depth to Water (feet)	DRY	DRY	DRY	DRY	DRY	DRY	NI	NI	NI	NI	NI	NI
Groundwater Elevation (feet)	DRY	DRY	DRY	DRY	DRY	DRY	NI	NI	NI	NI	NI	NI
<u>Date Measured: April 9, 2007</u>												
Depth to Water (feet)	11.54	11.04	11.41	11.47	11.55	11.64	14.73	14.64	14.65	14.58	NI	NI
Groundwater Elevation (feet)	56.80	56.58	56.51	56.62	56.89	56.95	56.93	56.73	56.46	56.47	NI	NI
<u>Date Measured: March 28, 2008</u>												
Depth to Water (feet)	9.79	9.37	NM	NM	9.83	10.01	13.06	12.97	13.04	12.90	14.52	13.28
Groundwater Elevation (feet)	58.55	58.25	NM	NM	58.61	58.58	58.60	58.40	58.07	58.15	58.66	58.06
<u>Date Measured: June 10, 2008</u>												
Depth to Water (feet)	8.39	7.97	8.21	8.37	8.64	7.75	11.77	11.87	11.50	11.49	13.35	11.71
Groundwater Elevation (feet)	59.95	59.65	59.71	59.72	59.80	60.84	59.89	59.50	59.61	59.56	59.83	59.63
<u>Date Measured: September 13, 2008</u>												
Depth to Water (feet)	4.07	3.98	4.03	4.44	4.13	4.64	7.68	7.57	7.69	7.47	9.17	7.55
Groundwater Elevation (feet)	64.27	63.64	63.89	63.65	64.31	63.95	63.98	63.80	63.42	63.58	64.01	63.79
<u>Date Measured: December 31, 2008</u>												
Depth to Water (feet)	6.02	5.48	5.80	5.94	6.07	6.22	9.25	9.12	9.06	9.03	10.75	9.02
Groundwater Elevation (feet)	62.32	62.14	62.12	62.15	62.37	62.37	62.41	62.25	62.05	62.02	62.43	62.32
<u>Date Measured: May 12, 2009</u>												
Depth to Water (feet)	7.35	6.53	6.70	6.92	7.29	AB	10.45	NM	9.73	10.06	12.02	9.34
Groundwater Elevation (feet)	60.99	61.09	61.22	61.17	61.15	AB	61.21	NM	61.38	60.99	61.16	62.00

Notes:

1. Approximate well locations are shown on Figure 3.
2. Wells TB-1, TB-2, TB-3, TB-4, TB-5 and TB-6 were installed by A. G. Wassenaar, Inc.
3. NI = Well not installed yet.
4. AB = Well TB-6 was destroyed during excavation activities in March 2009.
5. NM = Not Measured.

TABLE 1
SUMMARY OF GROUNDWATER ELEVATION DATA

(Page 2 of 2)

PROJECT NAME: Segal Tank Battery

PROJECT LOCATION: NW 1/4 Section 24, T 4 N, R 66 W, Weld County, Colorado

PROJECT NUMBER: 1006006

Well Name	TB-1	TB-2	TB-3	TB-4	TB-5	TB-6	PMW-1	PMW-2	PMW-3	PMW-4	PMW-5	PMW-6
Casing Elevation (feet)	68.34	67.62	67.92	68.09	68.44	68.59	71.66	71.37	71.11	71.05	73.18	71.34
<u>Date Measured: August 5, 2009</u>												
Depth to Water (feet)	5.19	NM	4.67	4.96	5.29	AB	8.49	8.23	7.79	8.01	10.07	7.45
Groundwater Elevation (feet)	63.15	NM	63.25	63.13	63.15	AB	63.17	NM	63.32	63.04	63.11	63.89
<u>Date Measured: September 29, 2009</u>												
Depth to Water (feet)	NM	4.40	3.59	3.93	NM	AB	NM	NM	NM	NM	NM	NM
Groundwater Elevation (feet)	NM	63.22	64.33	64.16	NM	AB	NM	NM	NM	NM	NM	NM
<u>Date Measured: November 2, 2009</u>												
Depth to Water (feet)	4.21	3.34	3.29	4.46	4.60	AB	7.50	7.09	6.43	6.44	9.17	5.44
Groundwater Elevation (feet)	64.13	64.28	64.63	63.63	63.84	AB	64.16	64.28	64.68	64.61	64.01	65.90
<u>Date Measured: February 3, 2010</u>												
Depth to Water (feet)	6.06	5.63	5.97	6.05	6.13	AB	9.27	9.19	9.28	9.18	10.74	9.55
Groundwater Elevation (feet)	62.28	61.99	61.95	62.04	62.31	AB	62.39	62.18	61.83	61.87	62.44	61.79

Notes:

1. Approximate well locations are shown on Figure 3.
2. Wells TB-1, TB-2, TB-3, TB-4, TB-5 and TB-6 were installed by A. G. Wassenaar, Inc.
3. NI = Well not installed yet.
4. AB = Well TB-6 was destroyed during excavation activities in March 2009.
5. NM = Not Measured.

TABLE 2
SUMMARY OF GROUNDWATER QUALITY ANALYTICAL RESULTS
 (Page 1 of 4)

PROJECT NAME: Segal Tank Battery
PROJECT LOCATION: NW 1/4 Section 24, T 4 N, R 66 W, Weld County, Colorado
PROJECT NUMBER: 1006006

Sample Name	Sample Date	Benzene (µg/L)	Toluene (µg/L)	Ethyl-benzene (µg/L)	Total Xylenes (µg/L)	Dissolved Oxygen (mg/L)
TB-1	12/23/05	550.	36.	360.	4,100.	NM
TB-1	05/11/06	DRY	DRY	DRY	DRY	NM
TB-1	04/09/07	1,734.	2.7	586.	4,636.	0.6
TB-1	03/28/08	41.	<0.5	14.	105.	0.8
TB-1	06/10/08	700.	<0.5	244.	1,423.	0.9
TB-1	09/13/08	<0.5	<0.5	<0.5	<0.5	0.7
TB-1	12/31/08	<1.	<1.	<1.	<1.	0.9
TB-1	05/12/09	35.	<1.	18.	46.	0.8
TB-1	08/05/09	<1.	<1.	<1.	<1.	1.0
TB-1	11/02/09	33.	<1.	121.	4,560.	0.7
TB-1	02/03/10	<1.	<1.	<1.	<1.	0.9
TB-2	12/23/05	1,900.	92.	850.	11,000.	NM
TB-2	05/11/06	DRY	DRY	DRY	DRY	NM
TB-2	04/09/07	1,150.	2.6	533.	N	0.7
TB-2	03/28/08	1,321.	<0.5	374.	3,858.	0.7
TB-2	06/10/08	1,336.	<0.5	495.	5,263.	0.9
TB-2	09/13/08	897.	<0.5	91.	444.	0.8
TB-2	12/31/08	2,940.	<1.	328.	3,110.	0.6
TB-2	05/12/09	1,340.	<1.	447.	5,380.	0.9
TB-2	08/05/09	1,130.	<1.	140.	778.	0.7
TB-2	11/02/09	1,240.	<1.	394.	3,190.	0.4
TB-2	02/03/10	2,580.	<1.	309.	3,900.	0.4
TB-3	12/23/05	180.	17.	400.	6,100.	NM
TB-3	05/11/06	DRY	DRY	DRY	DRY	NM
TB-3	04/09/07	373.	2.7	247.	1,470.	0.8
TB-3	03/28/08	129.	<0.5	76.	474.	NM
TB-3	06/10/08	2,179.	1.4	127.	884.	0.6
TB-3	09/13/08	2.9	<0.5	<0.5	0.9	0.8
TB-3	12/31/08	14,500.	<1.	<1.	25.	0.8
TB-3	05/12/09	3,070.	<1.	338.	2,920.	0.4
TB-3	08/05/09	30.	<1.	<1.	9.	1.1
TB-3	11/02/09	5,960.	<1.	<1.	<1.	0.9
TB-3	02/03/10	3,170.	<1.	392.	593.	0.8
COGCC Concentration Levels		5.	560.	700.	1,400.	NR

Notes:

1. Approximate sample locations are shown on Figure 5.
2. µg/L = micrograms per liter.
3. mg/L = milligrams per liter.
4. COGCC = Colorado Oil & Gas Conservation Commission.
5. COGCC Concentration Levels for groundwater are described in Table 910-1 of Series 900 of the COGCC Rules and Regulations established April 1, 2009.
6. NR = Not Regulated.
7. NM = Not Measured.
8. **Bold** concentrations indicate an exceedance of the COGCC Concentration Levels.
9. Samples were collected by A. G. Wassenaar, Inc. in December 2005.

TABLE 2
SUMMARY OF GROUNDWATER QUALITY ANALYTICAL RESULTS
 (Page 2 of 4)

PROJECT NAME: Segal Tank Battery
PROJECT LOCATION: NW 1/4 Section 24, T 4 N, R 66 W, Weld County, Colorado
PROJECT NUMBER: 1006006

Sample Name	Sample Date	Benzene (µg/L)	Toluene (µg/L)	Ethyl-benzene (µg/L)	Total Xylenes (µg/L)	Dissolved Oxygen (mg/L)
TB-4	12/23/05	DRY	DRY	DRY	DRY	NM
TB-4	05/11/06	DRY	DRY	DRY	DRY	NM
TB-4	04/09/07	11,398.	27.	218.	2,159.	0.8
TB-4	03/28/08	6,366.	327.	370.	4,947.	NM
TB-4	06/10/08	3,767.	55.	293.	3,916.	0.7
TB-4	09/13/08	8,592.	<0.5	568.	8,177.	0.6
TB-4	12/31/08	10,900.	<1.	320.	7,860.	0.6
TB-4	05/12/09	3,460.	<1.	180.	4,590.	0.4
TB-4	08/05/09	6,750.	<1.	162.	3,110.	0.5
TB-4	11/02/09	5,330.	<1.	37.	349.	0.8
TB-4	02/03/10	15,600.	<1.	433.	6,230.	0.3
TB-5	12/23/05	950.	40.	840.	11,000.	NM
TB-5	05/11/06	DRY	DRY	DRY	DRY	NM
TB-5	04/09/07	77.	<0.5	93.	2,169.	0.7
TB-5	03/28/08	<0.5	<0.5	<0.5	<0.5	NM
TB-5	06/10/08	16.	<0.5	12.	333.	0.6
TB-5	09/13/08	<0.5	<0.5	<0.5	<0.5	0.7
TB-5	12/31/08	<1.	<1.	<1.	<1.	0.7
TB-5	05/12/09	9.	<1.	50.	592.	0.5
TB-5	08/05/09	<1.	<1.	<1.	<1.	1.1
TB-5	11/02/09	9.	<1.	336.	3,780.	0.7
TB-5	02/03/10	<1.	<1.	<1.	<1.	0.7
TB-6	12/23/05	230.	<20.	120.	1,630.	NM
TB-6	05/11/06	DRY	DRY	DRY	DRY	NM
TB-6	04/09/07	2,788.	<0.5	1,026.	20,279.	0.7
TB-6	03/28/08	1,153.	<0.5	635.	10,151.	NM
TB-6	06/10/08	1,186.	<0.5	777.	11,368.	0.8
TB-6	09/13/08	697.	<0.5	350.	5,289.	0.4
TB-6	12/31/08	1,410.	2.	795.	8,230.	0.4
TB-6						

Well TB-6 was destroyed during excavation activities in March 2009.

COGCC

Concentration Levels	5.	560.	700.	1,400.	NR
-----------------------------	-----------	-------------	-------------	---------------	-----------

Notes:

1. Approximate sample locations are shown on Figure 5.
2. µg/L = micrograms per liter.
3. mg/L = milligrams per liter.
4. COGCC = Colorado Oil & Gas Conservation Commission.
5. COGCC Concentration Levels for groundwater are described in Table 910-1 of Series 900 of the COGCC Rules and Regulations established April 1, 2009.
6. NR = Not Regulated.
7. NM = Not Measured.
8. **Bold** concentrations indicate an exceedance of the COGCC Concentration Levels.
9. Samples were collected by A. G. Wassenaar, Inc. in December 2005.

TABLE 2
SUMMARY OF GROUNDWATER QUALITY ANALYTICAL RESULTS
 (Page 3 of 4)

PROJECT NAME: Segal Tank Battery
PROJECT LOCATION: NW 1/4 Section 24, T 4 N, R 66 W, Weld County, Colorado
PROJECT NUMBER: 1006006

Sample Name	Sample Date	Benzene (µg/L)	Toluene (µg/L)	Ethyl-benzene (µg/L)	Total Xylenes (µg/L)	Dissolved Oxygen (mg/L)
PMW-1	04/09/07	<0.5	<0.5	<0.5	<0.5	1.4
PMW-1	03/28/08	<0.5	<0.5	<0.5	<0.5	1.0
PMW-1	06/10/08	<0.5	<0.5	<0.5	<0.5	1.1
PMW-1	09/13/08	<0.5	<0.5	<0.5	<0.5	1.0
PMW-1	12/31/08	<1.	<1.	<1.	<1.	1.1
PMW-1	05/12/09	<1.	<1.	<1.	<1.	1.4
PMW-1	08/05/09	<1.	<1.	<1.	<1.	1.0
PMW-1	11/02/09	<1.	<1.	<1.	<1.	1.3
PMW-1	02/03/10	<1.	<1.	<1.	<1.	1.2
PMW-2	04/09/07	<0.5	<0.5	<0.5	<0.5	1.2
PMW-2	03/28/08	<0.5	<0.5	<0.5	<0.5	0.9
PMW-2	06/10/08	<0.5	<0.5	<0.5	<0.5	1.1
PMW-2	09/13/08	<0.5	<0.5	<0.5	<0.5	1.1
PMW-2	12/31/08	<1.	<1.	<1.	<1.	1.0
PMW-2	05/12/09	<1.	<1.	<1.	<1.	1.1
PMW-2	08/05/09	<1.	<1.	<1.	<1.	1.2
PMW-2	11/02/09	<1.	<1.	<1.	<1.	1.0
PMW-2	02/03/10	<1.	<1.	<1.	<1.	1.2
PMW-3	04/09/07	<0.5	<0.5	<0.5	<0.5	1.3
PMW-3	03/28/08	<0.5	<0.5	<0.5	<0.5	1.0
PMW-3	06/10/08	<0.5	<0.5	<0.5	<0.5	1.0
PMW-3	09/13/08	<0.5	<0.5	<0.5	<0.5	1.2
PMW-3	12/31/08	<1.	<1.	<1.	<1.	0.9
PMW-3	05/12/09	<1.	<1.	<1.	<1.	1.3
PMW-3	08/05/09	<1.	<1.	<1.	<1.	2.1
PMW-3	11/02/09	<1.	<1.	<1.	<1.	1.1
PMW-3	02/03/10	<1.	<1.	<1.	<1.	1.0
PMW-4	04/09/07	<0.5	<0.5	<0.5	<0.5	2.3
PMW-4	03/28/08	<0.5	<0.5	<0.5	<0.5	0.8
PMW-4	06/10/08	<0.5	<0.5	<0.5	<0.5	0.9
PMW-4	09/13/08	<0.5	<0.5	<0.5	<0.5	1.0
PMW-4	12/31/08	<1.	<1.	<1.	<1.	0.9
PMW-4	05/12/09	<1.	<1.	<1.	<1.	1.1
PMW-4	08/05/09	<1.	<1.	<1.	<1.	1.5
PMW-4	11/02/09	<1.	<1.	<1.	<1.	1.3
PMW-4	02/03/10	<1.	<1.	<1.	<1.	1.1

COGCC

Concentration Levels	5.	560.	700.	1,400.	NR
-----------------------------	-----------	-------------	-------------	---------------	-----------

Notes:

1. Approximate sample locations are shown on Figure 5.
2. µg/L = micrograms per liter.
3. mg/L = milligrams per liter.
4. COGCC = Colorado Oil & Gas Conservation Commission.
5. COGCC Concentration Levels for groundwater are described in Table 910-1 of Series 900 of the COGCC Rules and Regulations established April 1, 2009.
6. NR = Not Regulated.
7. NM = Not Measured.
8. **Bold concentrations indicate an exceedance of the COGCC Concentration Levels.**
9. Samples were collected by A. G. Wassenaar, Inc. in December 2005.

TABLE 2
SUMMARY OF GROUNDWATER QUALITY ANALYTICAL RESULTS
 (Page 4 of 4)

PROJECT NAME: Segal Tank Battery
PROJECT LOCATION: NW 1/4 Section 24, T 4 N, R 66 W, Weld County, Colorado
PROJECT NUMBER: 1006006

Sample Name	Sample Date	Benzene (µg/L)	Toluene (µg/L)	Ethyl-benzene (µg/L)	Total Xylenes (µg/L)	Dissolved Oxygen (mg/L)
PMW-5	03/28/08	<0.5	<0.5	<0.5	<0.5	1.6
PMW-5	06/10/08	<0.5	<0.5	<0.5	<0.5	1.1
PMW-5	09/13/08	<0.5	<0.5	<0.5	<0.5	1.0
PMW-5	12/31/08	<1.	<1.	<1.	<1.	1.3
PMW-5	05/12/09	<1.	<1.	<1.	<1.	1.1
PMW-5	08/05/09	<1.	<1.	<1.	<1.	2.2
PMW-5	11/02/09	<1.	<1.	<1.	<1.	1.2
PMW-5	02/03/10	<1.	<1.	<1.	<1.	1.3
PMW-6	03/28/08	<0.5	<0.5	<0.5	<0.5	1.2
PMW-6	06/10/08	<0.5	<0.5	<0.5	<0.5	1.0
PMW-6	09/13/08	<0.5	<0.5	<0.5	<0.5	1.2
PMW-6	12/31/08	<1.	<1.	<1.	<1.	1.1
PMW-6	05/12/09	<1.	<1.	<1.	<1.	1.0
PMW-6	08/05/09	<1.	<1.	<1.	<1.	2.0
PMW-6	11/02/09	<1.	<1.	<1.	<1.	1.4
PMW-6	02/03/10	<1.	<1.	<1.	<1.	1.1
COGCC Concentration Levels		5.	560.	700.	1,400.	NR

Notes:

1. Approximate sample locations are shown on Figure 5.
2. µg/L = micrograms per liter.
3. mg/L = milligrams per liter.
4. COGCC = Colorado Oil & Gas Conservation Commission.
5. COGCC Concentration Levels for groundwater are described in Table 910-1 of Series 900 of the COGCC Rules and Regulations established April 1, 2009.
6. NR = Not Regulated.
7. NM = Not Measured.
8. Bold concentrations indicate an exceedance of the COGCC Concentration Levels.
9. Samples were collected by A. G. Wassenaar, Inc. in December 2005.



TECHNOLOGY LABORATORY, INC.

CENTRE PROFESSIONAL PARK

1012 Centre Avenue
Fort Collins, Colorado 80526
(970) 490-1414

CERTIFICATE OF ANALYSIS

Paragon Consulting Group, Inc.
1103 Oak Park Drive
Fort Collins, CO 80525

Date Received: 02/03/10

Matrix: Water

Project No.: 1006006

<u>Lab ID</u>	<u>Sample ID</u>	<u>Date Sampled</u>	<u>Date Analyzed</u>	<u>Benzene mg/L</u>	<u>Toluene mg/L</u>	<u>Ethylbenzene mg/L</u>	<u>Total Xylenes mg/L</u>
9927-01	TB-1	02/03/10	02/05/10	< 0.001	< 0.001	< 0.001	< 0.001
9927-02	TB-2	02/03/10	02/05/10	2.58	< 0.001	0.309	3.90
9927-03	TB-3	02/03/10	02/05/10	3.17	< 0.001	0.392	0.593
9927-04	TB-4	02/03/10	02/05/10	15.6	< 0.001	0.433	6.23
9927-05	TB-5	02/03/10	02/05/10	< 0.001	< 0.001	< 0.001	< 0.001
9927-06	PMW-1	02/03/10	02/04/10	< 0.001	< 0.001	< 0.001	< 0.001
9927-07	PMW-2	02/03/10	02/04/10	< 0.001	< 0.001	< 0.001	< 0.001
9927-08	PMW-3	02/03/10	02/04/10	< 0.001	< 0.001	< 0.001	< 0.001
9927-09	PMW-4	02/03/10	02/05/10	< 0.001	< 0.001	< 0.001	< 0.001
9927-10	PMW-5	02/03/10	02/05/10	< 0.001	< 0.001	< 0.001	< 0.001
9927-11	PMW-6	02/03/10	02/05/10	< 0.001	< 0.001	< 0.001	< 0.001

BTEX Method:

EPA-8260B

Todd Rhea



TECHNOLOGY LABORATORY, INC.

CENTRE PROFESSIONAL PARK

1012 Centre Avenue
Fort Collins, Colorado 80526
(970) 490-1414

CERTIFICATE OF ANALYSIS

QA/QC SURROGATE RECOVERY

Paragon Consulting Group, Inc.
1103 Oak Park Drive
Fort Collins, CO 80525

Date Received: 02/03/10

Matrix: Water

Project No.: 1006006

(% Recovery)

<u>Lab ID</u>	<u>Sample ID</u>	<u>Bromofluorobenzene</u> <u>Limits (70-113%)</u>	<u>Dibromofluoromethane</u> <u>Limits (68-120%)</u>	<u>Toluene-d8</u> <u>Limits (81-128%)</u>
9927-01	TB-1	106	115	98
9927-02	TB-2	108	110	99
9927-03	TB-3	107	109	98
9927-04	TB-4	109	111	99
9927-05	TB-5	105	111	100
9927-06	PMW-1	106	113	98
9927-07	PMW-2	107	115	98
9927-08	PMW-3	104	112	97
9927-09	PMW-4	105	114	98
9927-10	PMW-5	104	114	98
9927-11	PMW-6	109	114	99

Todd Rea