


Location Name: APACHE CANYON 11-6 V & R, API #: 071-08297, Insp. #:695103368



Colorado Oil & Gas Conservation Commission
37.10063, -104.9673, 2626.0m, 257°





TIMBER CREEK
OPERATING

(719) 719-497-0448 or 911

WDID 1912531
PERMIT 74263

APACHE CANYON 11-06V
SE / NW 11-34S-68W

Lat. 37.100581
Long. 104.967777

Colorado Oil & Gas Conservation Commission
37.1005, -104.96784, 2609.0m, 335°




COLORADO
Oil & Gas Conservation
Commission
Department of Natural Resources

Phone 2: WELL SIGN



Colorado Oil & Gas Conservation Commission
37.10027, -104.96781, 2633.0m, 93°
2020/10/06 11:57:43

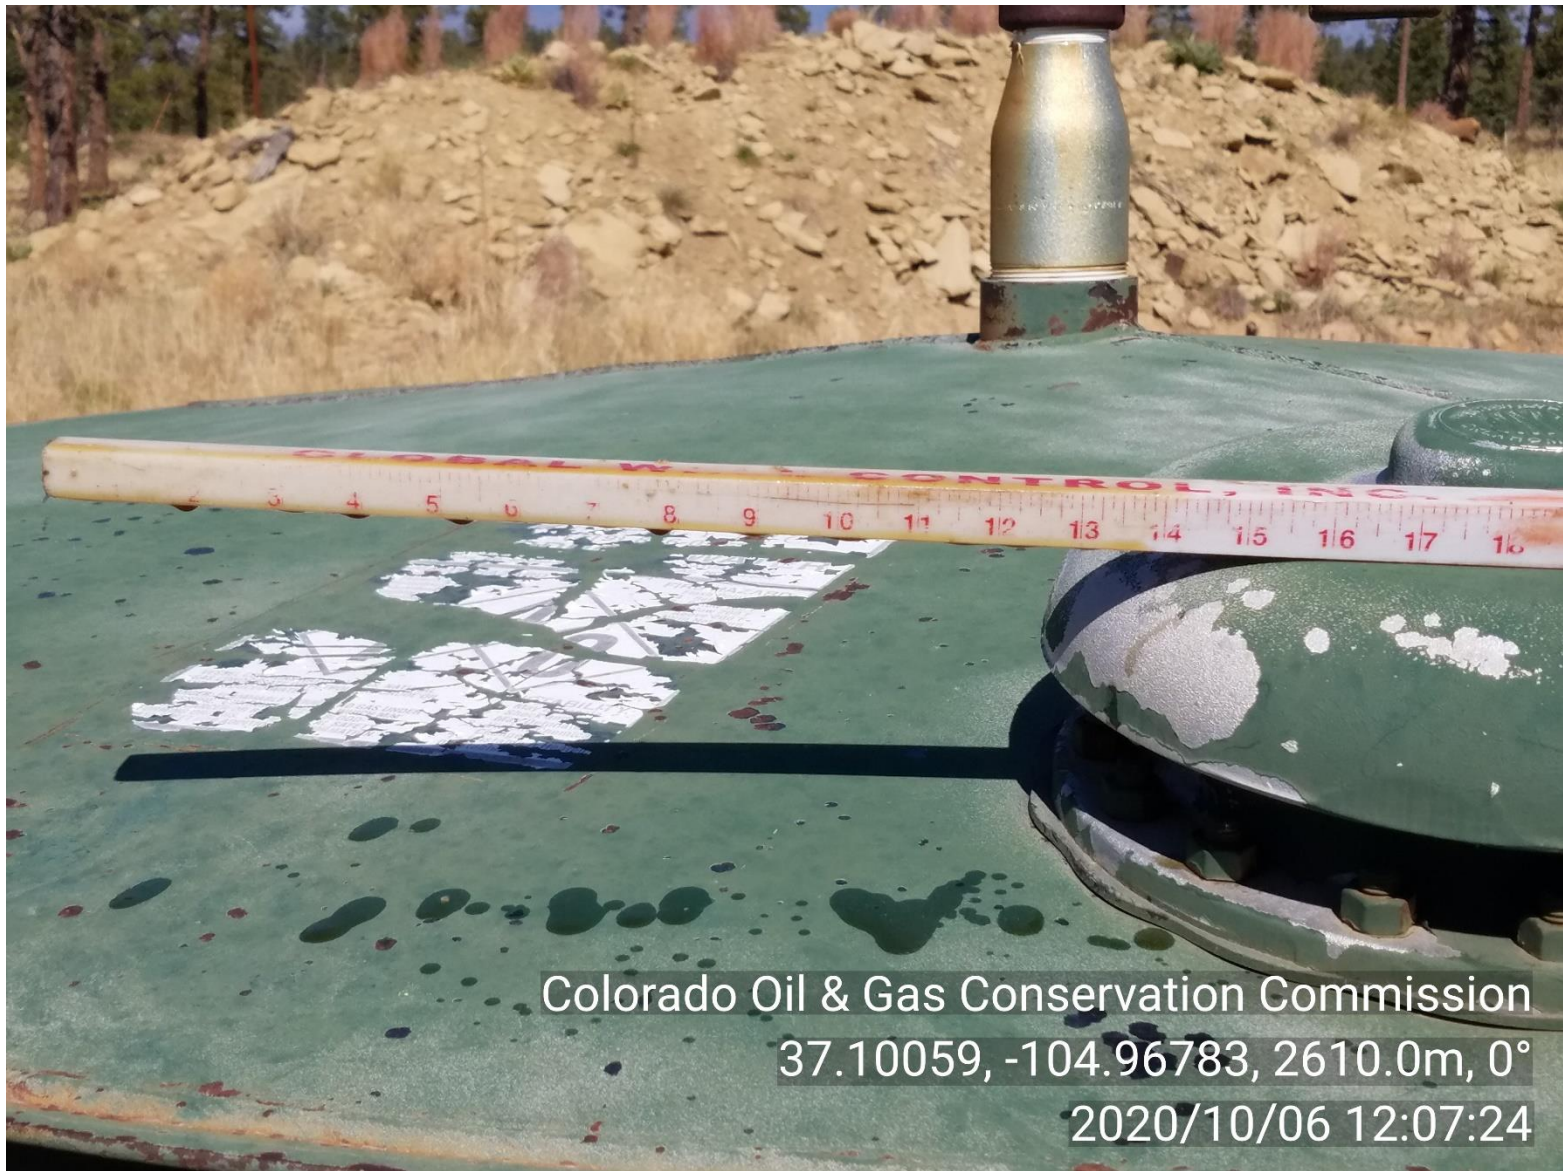

Colorado Oil & Gas Conservation Commission

37.10059, -104.96783, 2610.0m, 0°

2020/10/06 12:07:24



COLORADO
Oil & Gas Conservation
Commission
Department of Natural Resources

Phone 4: OIL IN PRODUCED WATER TANK FOR V WELL. Pursuant to Rule 907A. Operator shall properly identify and dispose of non-E&P wastes in accordance with state and federal regulations, including storing, treating, and disposing of hazardous waste in accordance with 6 C.C.R. 1007-3. All non-hazardous/non-E&P wastes are considered solid waste which require storage, treatment, and disposal in accordance with 6 C.C.R. 1007-2. Rule 907.b.(2) - provide all transportation and disposal documentation required by Rule 907.b.(2)



Colorado Oil & Gas Conservation Commission
37 10024, -104.96761, 2624.0m, 228°
2020/10/06 11:58:09



COLORADO
Oil & Gas Conservation
Commission
Department of Natural Resources

**Phone 5: AREA OF IMPACTED SOIL NEAR UNUSED RISERS TO THE SOUTH OF R WELLHEAD. Non E&P
Waste not properly stored, handled, transported, treated, or disposed per Rule 907A.**



Colorado Oil & Gas Conservation Commission
37.10065, -104.96783, 2618.0m, 76°
2020/10/06 12:03:15



COLORADO
Oil & Gas Conservation
Commission
Department of Natural Resources

Phone 6: AREA OF IMPACTED SOIL NEAR ENGINE SKID FOR V WELL. Non E&P Waste not properly stored, handled, transported, treated, or disposed per Rule 907A.



COLORADO
Oil & Gas Conservation
Commission
Department of Natural Resources

Phone 7: AREA OF IMPACTED SOIL NEAR COMPRESSOR FOR V WELL. Non E&P Waste not properly stored, handled, transported, treated, or disposed per Rule 907A.



Colorado Oil & Gas Conservation Commission

37 10024, -104.96761, 2624.0m, 228°

2020/10/06 11:58:09



COLORADO
Oil & Gas Conservation
Commission
Department of Natural Resources

Phone 8: UNUSED RISERS. REMOVE UNUSED RISERS, COMPLY WITH RULE 603.f. CA DATE 1-6-21.



Colorado Oil & Gas Conservation Commission
37.10065, -104.96783, 2618.0m, 61°
2020/10/06 12:03:11



COLORADO
Oil & Gas Conservation
Commission
Department of Natural Resources

Phone 9: OIL IN V WELL ENGINE SKID. Comply with general provisions of the oil and gas act for wildlife protection.



COLORADO
Oil & Gas Conservation
Commission
Department of Natural Resources

Phone 10: OIL IN V WELL COMPRESSOR SKID. Comply with general provisions of the oil and gas act for wildlife protection.



Colorado Oil & Gas Conservation Commission
37.10064, -104.96777, 2616.0m, 7°
2020/10/06 12:04:48



COLORADO
Oil & Gas Conservation
Commission
Department of Natural Resources

Phone 11: LEAKING OIL ALL OVER V WELL COMPRESSOR. Securely fasten all valves, pipes, and fittings to ensure good mechanical condition, inspect at regular intervals and maintain in good mechanical condition per Rule 605.d.



Colorado Oil & Gas Conservation Commission
37.10061, -104.96782, 2623.0m, 118°
2020/10/06 12:06:01



COLORADO
Oil & Gas Conservation
Commission
Department of Natural Resources

**Phone 12: ANOTHER IMAGE OF LEAKING OIL ON V WELL COMPRESSOR SKID. FOLLOW GUIDANCE
GIVEN ON PHOTO 11**