



Jack L. Crumley

P.O. Box 494
Akron, CO 80720-0494
Phone (970) 345-6550
Fax (970) 345-2643

V80136

Vendor - CRU003

Account - 7030/30

COL145/N

November 20, 2020

PADCO, LLC

800 W. 6th Street, Suite 1010

Los Angeles, CA 90017-2713

Lease and Well No.

Gulley #1D

Washington County, Colorado

Supervision of Personal & Equipment:

11/09/2020 Yetter Well Service, Inc. roaded to location. Could not rig up. Flow line was dug up. Waited on TJS to fill flow line. Rigged up for rods and pulled rods and laid on flatbed trailer. Yetter spotted in swab tank and pump. Have approximately half the rods to pull. SDFN.

11/10/2020 Warmed up rig. Finished pulling rods. Rigged up for tubing. STS on location to set CIBP. Rigged up for tbg. Tried unsetting the anchor. Would not come loose. Worked anchor approximately 1 hour. Wouldn't free up. E3 Solutions delivered 180 bbl of fresh water. Hooked up pump. Tried circulating casing. Formation taking water. Could not circulate. STS ran tool and cut off tbg at 4,553 ft. Had oil and gas permission from Susan Sherman and Steven Wolfe. Pulled tbg to derrick. SDFN.

11/11/2020 Warmed up rig. Rigged up STS and ran CIBP. Could not go past 2,850 ft. Laid down CIBP and released STS. Ordered CIBP from KB Tools. Waited for plug. Ran plug on tbg. Would not go past 2,850 ft. Pulled tbg and plug. Have permission from Steven Wolfe and Susan Sherman to circulate hole and set cement plug at 2,850 ft if we could not get tbg down. SDFN.

11/12/2020 Warmed up rig. Yetter delivered cement. Circulated tbg to 4,540 ft. Circulated hole approximately 1 hour. Mixed and ran 20 sacks of cement at 4,540 ft. Pulled tbg 2,000 ft. Let stand 4 hours. Ran in tbg and tagged plug at 4,309 ft. Pulled tbg. Left 30 stands in derrick and laid rest of tbg on flatbed trailer. Drained up equipment. SDFN.

11/13/2020 Warmed up rig. Rigged up for casing. Morrow Welding strapped a bell nipple. Rigged up STS to run cutoff tool. Could only get to 1,250 ft. Have permission from Susan Sherman and Steven Wolfe to cut casing at 1,250 ft. and pump stub plug.

Rigged down STS and released. Pulled casing and laid on the ground. Cleaned up equipment. SDFN.

11/16/2020 Warmed up rig. Did not work Saturday or Sunday. Rigged up for tbg. Ran tbg. Found heavy mud and plug at 600 ft. Laid tbg on flatbed. Hooked up pump. Circulated casing to 1,300 ft. Had E3 Solution deliver a load of fresh water. Yetter delivered another swab tank. Mixed and ran 40 sacks of cement plug. Pulled tbg and laid on flatbed. Did not tag stub plug. Mixed and ran 90 sacks of cement plug at 350 ft. Pulled tbg and laid on flatbed. Cleaned up equipment. SDFN.

11/17/2020 Warmed up rig. Ran tbg. Found plug at 134 ft. from surface. Laid tbg on flatbed. Hooked up pump. Mixed and ran 20 sacks of cement plug. Had cement to surface. Cleaned up equipment. Rig down and release. E3 cleaned out and swabbed tanks. Moved equipment to yard.

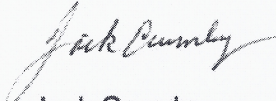
11/18/2020 Had Morrow Welding dig out surface head and cut off surface casing and install cover plate with information.

6 Days @ \$250.00
No Mileage.

Total Invoice.

\$1,500.00

Thank you.


Jack Crumley