


## 6 Month Abatement Summary

<b>Well:</b>	Wilmoth E 5J-232
<b>API:</b>	05123454870000

Bradenhead Test Data	Date	Event Measurement
Form 17 Bradenhead Test Report (psig)	11/15/2019	51
Abatement System Commission Date	12/17/2019	-
Form 17 Bradenhead Test Report, Follow Up (psig)	5/28/2020	6
Form 17 Bradenhead Test Report, Annual (psig)	4/6/2021	10
Abatement System Volume Measurement (CF/Day)	11/24/2019	0.99

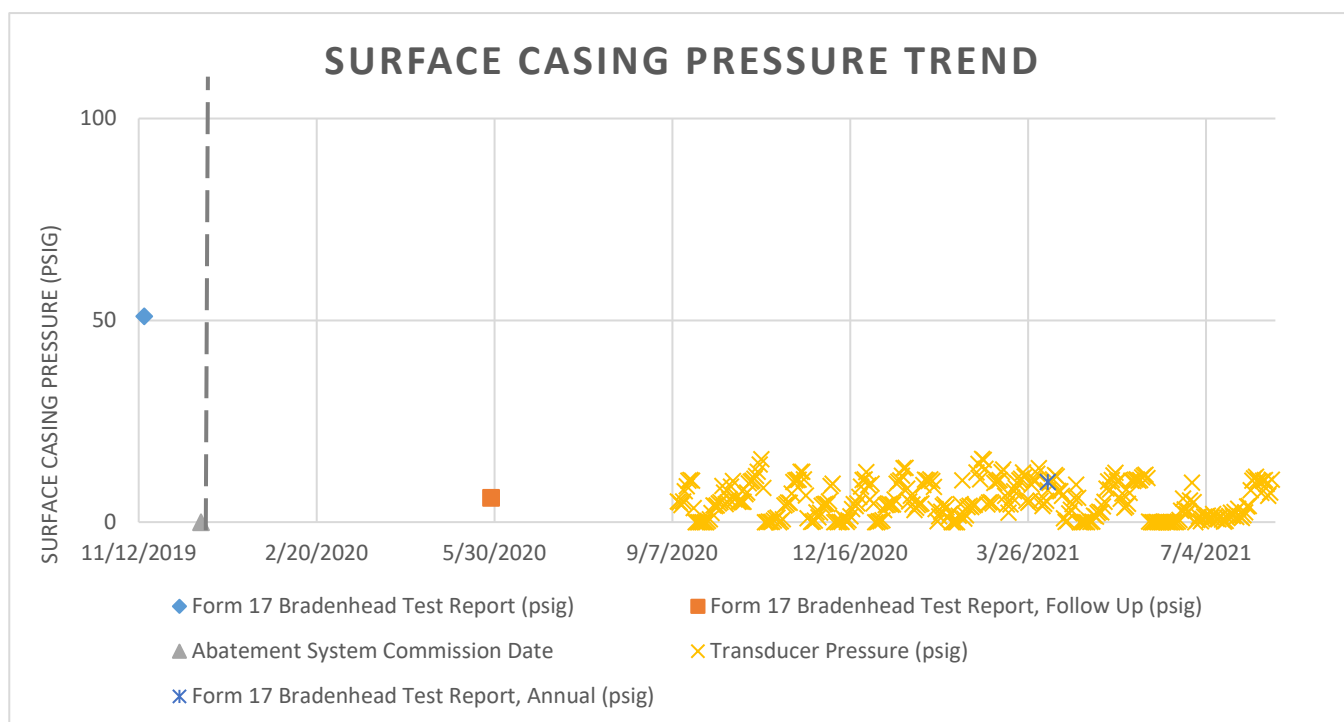

**Comments:** 2019 annual test had 51 PSI that blew down to 0 psi instantly with no flow for the remainder of the test. 6-month follow up test had 6 PSI that blew down to 0 psi instantly with no flow for the remainder of the test. 2021 annual test had 10 PSI that blew down to 5 PSI in thirty minutes. A sample was able to be collected and analyzed. Bradenhead gas determined to be mixed microbial/thermogenic gas with somewhat similar composition as the production gas sample. Bradenhead pressure remains below 50 psi limit when abatement system is operating. PDC will continue to remediate pressure using the installed abatement system.