


## 6 Month Abatement Summary

<b>Well:</b>	Wilmoth E 5A-312
<b>API:</b>	05123454840000

Bradenhead Test Data	Date	Event Measurement
Form 17 Bradenhead Test Report (psig)	11/15/2019	93
Abatement System Commission Date	12/17/2019	-
Form 17 Bradenhead Test Report, Follow Up (psig)	5/28/2020	15
Form 17 Bradenhead Test Report, Annual (psig)	4/6/2021	0
Abatement System Volume Measurement (CF/Day)	3/22/2020	3.2

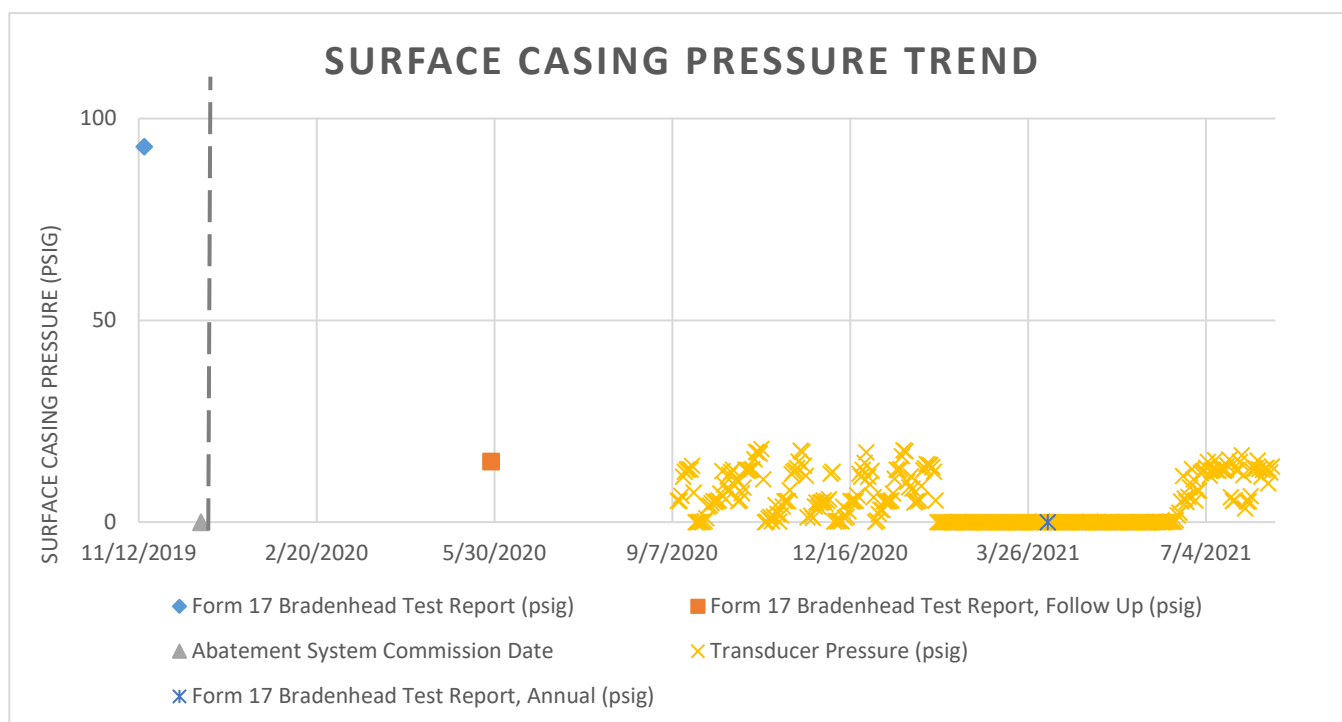

**Comments:** 2019 post-production test had 93 that blew down to 0 psi instantly with no flow for the remainder of the test. 6-month follow up test had 15 PSI that blew down to 0 psi within thirty minutes. 2021 annual test had 0 PSI with no pressure or flow observed for the duration of the test. A sample was able to be collected and analyzed. Bradenhead gas determined to be mixed microbial/thermogenic gas with somewhat similar composition as the production gas sample. Bradenhead pressure remains below 50 psi limit when abatement system is operating. PDC will continue to remediate pressure using the installed abatement system.