


## 6 Month Abatement Summary

	<b>Well:</b> Wilmoth W 5A-334
	<b>API:</b> 05123454880000

Bradenhead Test Data	Date	Event Measurement
Form 17 Bradenhead Test Report (psig)	11/15/2019	70
Abatement System Commission Date	12/17/2019	-
Form 17 Bradenhead Test Report, Follow Up (psig)	5/28/2020	6
Form 17 Bradenhead Test Report, Annual (psig)	4/6/2021	0
Abatement System Volume Measurement (CF/Day)	3/28/2020	0.4

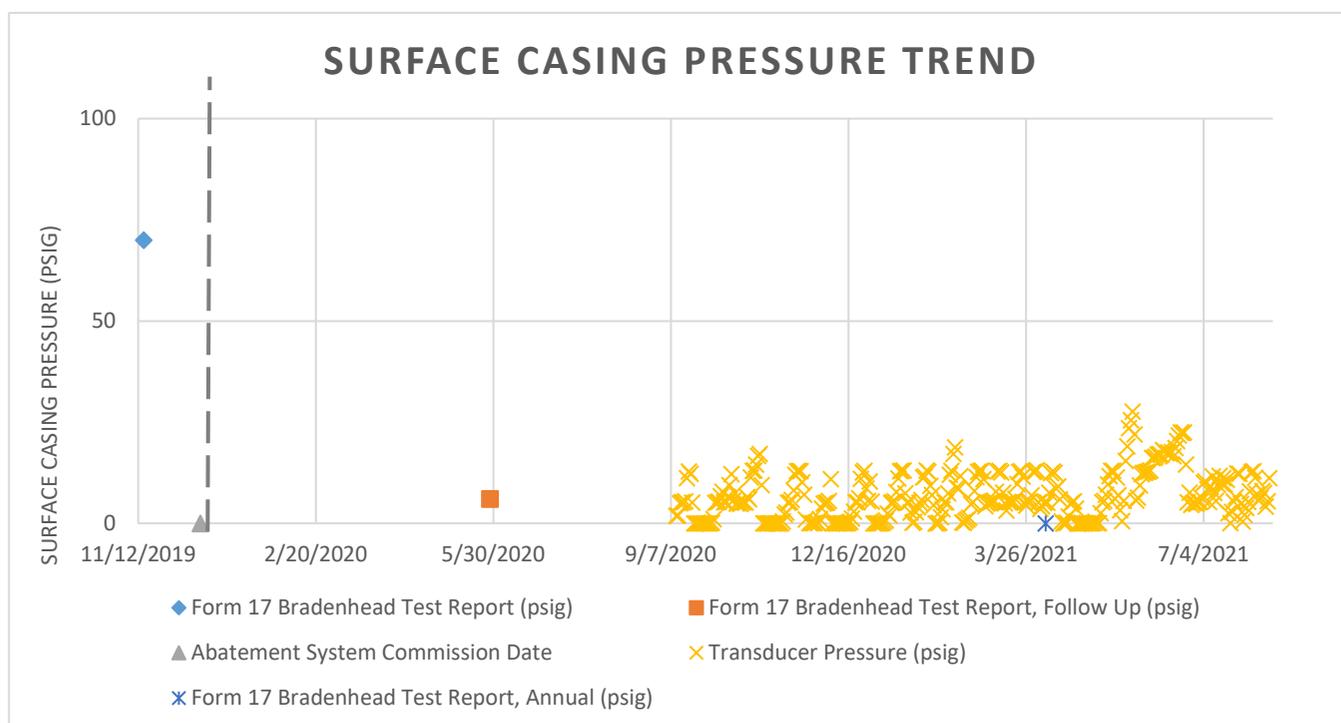

**Comments:** 2019 test had 70 PSI that blew down to 0 psi within first 5 seconds of test with no flow for the remainder of the test. 6-month follow up test had 6 PSI that blew down to 0 psi instantly, with no flow for the remainder of the test. 2021 annual test had 0 PSI with no flow or pressure observed for the duration of the test. A sample was able to be collected and analyzed. Bradenhead gas determined to be mixed microbial/thermogenic gas with somewhat similar composition as the production gas sample. Bradenhead pressure remains below 50 psi limit when abatement system is operating. PDC will continue to remediate pressure using the installed abatement system.