

Inspection Photos

4/28/2023

Operator: GENESIS GAS & OIL COLORADO LLC
- 10384

Location Number: 413918
Rio Blanco County, CO

Aaron Trujillo
NW Reclamation Specialist
COGCC

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413918



April 27, 2023



April 27, 2023

Photo 1: Photos 1-2 taken from the south end of the Location. Photos provide an overview of the Location from west, northwest, northeast to east. Photos show final reclamation including, but not limited to, compaction alleviation, recontouring/regrading and reclaiming has not been conducted on the Location.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413918



Photo 2: See comments under photo 1.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413918



Photo 3: Photos taken from the Location entrance, facing east and south. Photos show remaining cut/fill slopes.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413918



Photo 4: Photos taken from the cut slopes on the north end of the Location. Photos examples showing cut slopes lack stabilization. BMPs to minimize erosion, degradation and sediment transport missing or insufficient.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413918



Photo 5: Photos taken from the cut slopes on the north end of the Location. Photos examples showing cut slopes lack stabilization. BMPs to minimize erosion, degradation and sediment transport missing or insufficient. 6 foot measuring stick in photo left for reference. Lighter brown soils observed on flat areas of the Location is sediment deposition due to unstabilized cut slopes.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413918

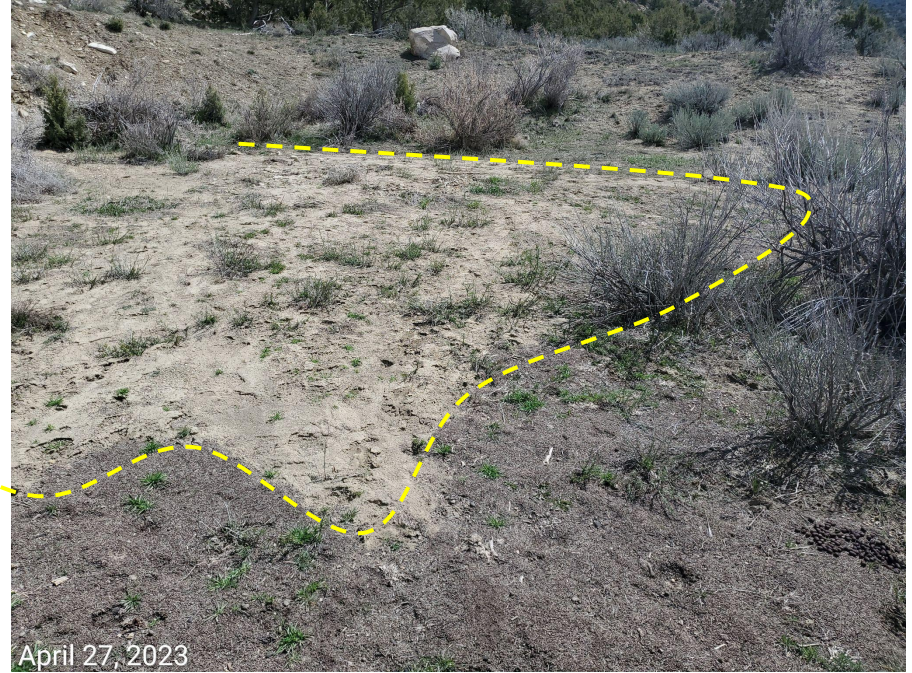


Photo 6: Sediment deposition due to unstabilized cut slopes. Darker materials on soil surface observed below the dotted line is vegetative debris carried by stormwater and deposited onto the pad surface.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413918



Photo 7: Well marker. Well has not been drilled. All Form 2 and Federal “permits to drill” on file for the Location have expired.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413918



Photo 8: Photos show pipe riser equipment remaining on the Location. Risers have not been properly capped. 6 foot measuring stick for reference.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413918



Photo 9: Photos examples showing surface equipment remaining on the Location and access road.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413918



Photo 10: Photos taken from the access road. Photos examples showing final reclamation including, but not limited to, compaction alleviation, recontouring/regrading and reclaiming has not been conducted on the access road. Photos also examples of culverts observed remaining along the access road.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413918



Photo 11: Photos 11-14 taken from the access road. Photos examples showing final reclamation including, but not limited to, compaction alleviation, recontouring/regrading and reclaiming has not been conducted on the entire access road. Photos also show erosion degradation at access road due to inadequate stormwater management. Access road intersects with Co Rd 122 at 40.076157°/-108.637129°.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413918



April 27, 2023



April 27, 2023

Photo 12: See comments under photo 11. Photo shows erosion degradation observed along cutslopes of the access road; slopes lack stabilization.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413918



April 27, 2023



April 27, 2023

Photo 13: See comments under photo 11. 6 foot measuring stick for reference.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413918



Photo 14: See comments under photo 11

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413918

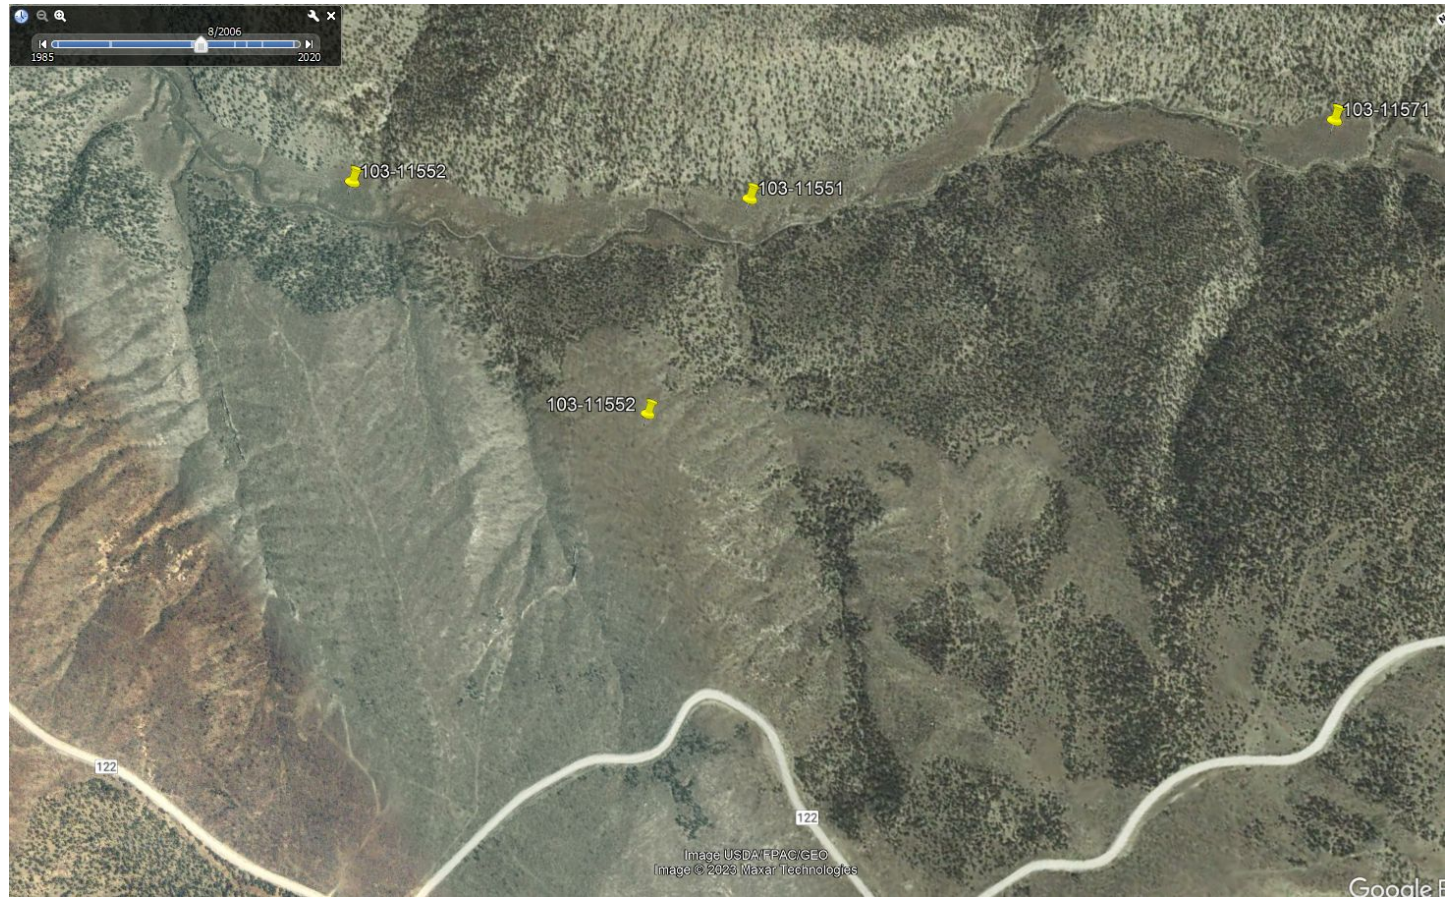


Photo 15: 2006 Google Earth aerial imagery showing the 4 expired Genesis Locations within the Fletcher Gulch Drainage, prior to construction of the Locations and access road—access roads did not exist prior to O&G disturbance.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413918

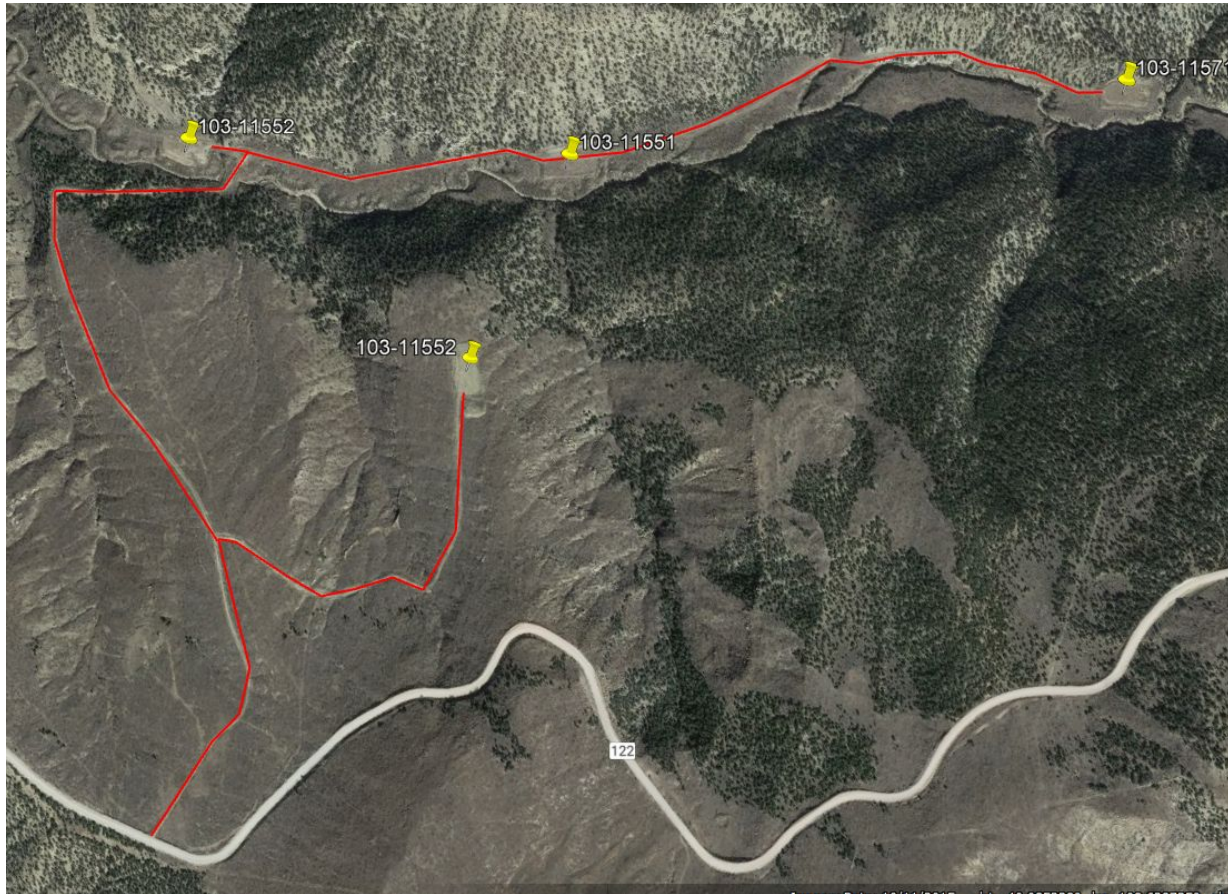


Photo 16: Google Earth aerial imagery showing the 4 expired Genesis Locations constructed within the Fletcher Gulch Drainage, and the access road(s) leading to the Locations (accessed via Co. Rd 122). Locations/Access roads subject to 1004 Reclamation.